

P02125 Lake Ave Elementary School Washrooms & Changerooms Renovations

157 Lake Ave North, Hamilton, ON



	Pages
INTRODUC	CTORY INFORMATION
00 00 01 00 01 10	Cover
Division 0	1 – General Requirements
00300 01005 01200 01340 01500 01545 01570 01710 01720 01721 01730 01740	Available Project Information
Division 0	2 – Existing Conditions
02 41 13	Selective Demolition
Division 0	3 – Concrete
03 01 30	Repairs to Concrete5
Division 0	4 – Masonry (refer to drawings)
04 01 80 04 20 00	Masonry Repairs
Division 0	7 – Thermal and Moisture Protection
07 84 00	Firestopping and Smoke Seals
Division 0	8 - Openings
08 11 13 08 31 13	Hollow Metals Doors and Frames
Division 0	9 – Finishes
09 05 61 09 29 00 09 51 13 09 65 19 09 67 23 09 91 00	Common Work Results for Flooring Preparation5Gypsum Board8Acoustical Panel Ceilings8Vinyl Tile Flooring6Resinous Flooring11Painting11

	Pages
Division 10	0 – Specialties
10 21 13 10 28 00	Metal Toilet Partitions
Appendix A	A
Door Scheo	dule – Group 87 6
DRAWING	s
NO.	Description
	ARCHITECTURAL DRAWINGS
A0.01 A1.01 A1.02 A1.03 A1.04 A2.01	Cover page Site Location, OBC Matrix, General Notes, Legends, Schedules Key Plan & Standards Demolition Plan & Notes Proposed Plan, Ceiling Plan, Legends Interior Elevations, Sections, Section Details, Schedules, Door & Door Frame Type
	MECHANICAL DRAWINGS
M0-00 M1-00 M1-01 M2-00 M2-01 M3-00 M4-00 ME1-00	Mechanical Legend & Drawing List Plumbing Systems - Demolition Plan HVAC Systems - Demolition Plan Plumbing Systems - New Enlarged Plan HVAC Systems - New Enlarged Plan Details Mechanical Specifications Mechanical & Electrical Schedules
	ELECTRICAL DRAWINGS
E0-00 E1-00 E2-00 E3-00 ME1-00	Electrical Legend & Drawing List Enlarged Plans Demo - Electrical Enlarged Plans New – Electrical Electrical Specifications Mechanical & Electrical Schedules
	STRUCTURAL DRAWINGS
S1.0 S2.0 S3.0	General Notes Framing Plan Washrooms & Changerooms Masonry Schedules & Typical Details

END OF THIS SECTION

AMRA J Architects Inc. Project No. 24-28

Available Project Information

Section 00300 Page 1 of 1

1. Hazardous Building Materials Assessment

1. A copy of the following report with respect to the identified portion of the Work is being made available as part of the Bid Documents; files titled as follows:

.1 Titled: Lake Avenue Elementary School

Washrooms & Changerooms renovation

Prepared by: PINCHIN Ltd. File No.: 352293.002

Dated: February 26, 2025


No. of Pages: 107

.2 Abatement Specifications (#pages 18)

- 2. These reports provide detailed descriptions of the assessment criteria, findings, recommendations and limitations with respect to toxic or hazardous materials present at the identified property.
- 3. The reports, by their nature, cannot reveal all conditions that exist or can occur. Should conditions, in the opinion of the Consultant, be found to vary substantially from the report, changes in the scope of Work will be made, with resulting credits or expenditures to the Contract Price accruing to the Owner.
- 4. HWDSB Construction School Specific Information Sheet
 - 1. Refer to attached HWDSB Appendix A instructions and information sample sheet, of construction site specific protocols the contractor will be required to follow. (6 pages)

End of Section



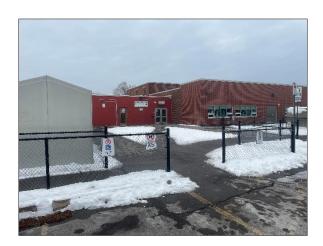

P02125 Washroom and Changeroom Renovations Lake Avenue Elementary School 157 Lake Avenue North, Hamilton, Ontario

Prepared for:

Hamilton-Wentworth District School Board

20 Education Court Hamilton, Ontario, L9A 0B9

February 26, 2025

Pinchin File: 352293.002



Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED

Issued to: Hamilton-Wentworth District School Board

Issued on: February 26, 2025

Pinchin File: 352293.002 Issuing Office: Hamilton, ON

Author: Adam Altena

Project Technologist

Project Manager: Jessica Cozzitorto, C. Tech.

Team Leader

Reviewer: Leslie Heywood, BEng Mgt

Senior Project Manager

© 2025 Pinchin Ltd.

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

Pinchin File: 352293.002 REVISED

February 26, 2025

EXECUTIVE SUMMARY

Hamilton-Wentworth District School Board (Client) retained Pinchin Ltd. (Pinchin) to conduct a hazardous building materials assessment at Lake Avenue Elementary School located at 157 Lake Avenue North, Hamilton, Ontario. Pinchin performed the assessment on February 3, 2025, February 11, 2025, and February 24, 2025.

The objective of the assessment was to identify specified hazardous building materials in preparation for building renovation. The proposed work as identified by the Client includes renovations to the Changerooms and adjacent corridors.

The results of this assessment are intended for use with a properly developed scope of work or performance specifications and safe work procedures.

The assessed area was limited to the part of the building where the upgrades are to be performed, as shown on the drawings in Appendix I.

SUMMARY OF FINDINGS

The following is a summary of significant findings; refer to the body of the report for detailed findings:

Asbestos:

- Vinyl Floor Tiles
- Transite pipe (presumed)

Lead:

Lead is present in paints and coatings.

Silica: Crystalline silica is present in concrete and other materials such as masonry, and ceramic tiles.

Mercury: Mercury vapour is present in lamp tubes.

<u>Polychlorinated Biphenyls (PCBs)</u>: Based on the date of construction, PCBs may be present in light ballasts.

Mould and Water Damage: Visible mould and water damage was not observed.

© 2025 Pinchin Ltd. Page ii

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002

REVISED

SUMMARY OF RECOMMENDATIONS

The following is a summary of significant recommendations; refer to the body of the report for detailed recommendations.

- 1. Conduct further investigation of the following items, which was not completed during this assessment:
 - a. Any items listed as exclusions in this report, prior to disturbance.
- Prepare a scope of work or specifications and safe work procedures for the hazardous materials removal required for the planned work.
- Do not disturb suspected hazardous building materials discovered during the planned work, which have not been identified in this report and arrange for further evaluation and testing.
- 4. Remove and properly dispose of asbestos-containing materials prior to renovation activities.
- Remove and properly dispose of PCB ballasts when fixtures are decommissioned. All PCB lamp ballasts must be removed from service and properly disposed of by December 31, 2025.
- 6. Recycle mercury-containing lamp tubes when removed from service.
- Follow appropriate safe work procedures when handling or disturbing asbestos, lead, silica.

This Executive Summary is subject to the same standard limitations as contained in the report and must be read in conjunction with the entire report.

© 2025 Pinchin Ltd. Page iii

PINCHIN

Hazardous Building Materials Assessment (Pre-construction)

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED

TABLE OF CONTENTS

1.0	INTF	INTRODUCTION AND SCOPE			
	1.1	Scope of Assessment	1		
2.0	MET	HODOLOGY	2		
3.0	BAC	KGROUND INFORMATION	2		
	3.1 3.2	Building Description Existing Reports			
4.0	FIND	DINGS	3		
	4.1 4.2 4.3 4.4 4.5 4.6	Asbestos Lead Silica Mercury Polychlorinated Biphenyls Mould and Water Damage	10 12 13		
5.0	REC	RECOMMENDATIONS			
	5.1 5.2	General Building Renovation Work			
6.0	TER	MS AND LIMITATIONS	15		
7.0	REF	ERENCES	15		

APPENDICES

APPENDIX I Drawings

APPENDIX II-A Asbestos Analytical Certificates

APPENDIX II-B Lead Analytical Certificates

APPENDIX III Methodology

APPENDIX IV Location Summary Report

APPENDIX V Hazardous Materials Summary Report / Sample Log

APPENDIX VI HMIS All Data Report



Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

Pinchin File: 352293.002 REVISED

February 26, 2025

1.0 INTRODUCTION AND SCOPE

Hamilton-Wentworth District School Board (Client) retained Pinchin Ltd. (Pinchin) to conduct a hazardous building materials assessment at Lake Avenue Elementary School located at 157 Lake Avenue North, Hamilton, Ontario.

Pinchin performed the assessment on February 3, 2025 and February 11, 2025. The surveyor was unaccompanied during the assessment. The assessed area was unoccupied at the time of the assessment.

The objective of the assessment was to identify specified hazardous building materials in preparation for building renovation activities. The proposed work as identified by the Client includes renovations to the Changerooms and adjacent corridors.

The results of this assessment are intended for use with a properly developed scope of work or performance specification.

1.1 Scope of Assessment

The **assessed area** is limited to the portion(s) of the building to be renovated, as described by the Client, and identified in the drawings in Appendix I.

The assessment was performed to establish the type of specified hazardous building materials, locations and approximate quantities incorporated in the structure(s) and its finishes.

For the purpose of the assessment and this report, hazardous building materials are defined as follows:

- Asbestos
- Lead
- Silica
- Mercury
- Polychlorinated Biphenyls (PCBs)
- Mould

The following Designated Substances are not typically found in building materials in a composition/state that is hazardous and were not included in this assessment:

- Arsenic
- Acrylonitrile
- Benzene

© 2025 Pinchin Ltd. Page 1 of 16

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

Pinchin File: 352293.002 REVISED

February 26, 2025

- Coke oven emissions
- Ethylene oxide
- Isocyanates
- Vinyl chloride monomer

2.0 METHODOLOGY

Pinchin conducted a room-by-room assessment to identify the hazardous building materials as defined in the scope.

The assessment included limited demolition of wall and ceiling finishes (drywall or plaster) to view concealed conditions at representative areas as permitted by the current building use. Limited destructive testing of flooring was conducted where possible (under ceramic tiles, carpets, or multiple layers of flooring). Demolition of exterior building finishes, masonry walls (chases, shafts etc.), and structural surrounds was not conducted.

Limited demolition of masonry block walls (core holes) was conducted to investigate for loose fill vermiculite insulation. Sampling of roofing materials was not conducted.

For further details on the methodology including test methods, refer to Appendix III.

3.0 BACKGROUND INFORMATION

3.1 Building Description

Description Item	Details
Use	School
Number of Floors	The building is 1 storey.
Total Area	The assessed area is approximately 3,900 square feet.
Year of Construction	The building was constructed in 1951, with renovations within the assessed area in 1982.
Structure	Structural steel
Exterior Cladding	Not assessed
HVAC	Radiators and forced air
Roof	Not assessed
Flooring	Vinyl floor tiles, ceramic tiles
Interior Walls	Concrete block, drywall
Ceilings	Drywall, acoustic ceiling tiles

© 2025 Pinchin Ltd. Page 2 of 16

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED

3.2 Existing Reports

Pinchin previously prepared the following reports, which have been reviewed as part of this assessment:

 HBMA Report - Gym and Corridor Reno Lake Avenue ES HWDSB, Dated; May 9 2022 (Pinchin file no. 303983.014).

4.0 FINDINGS

The following section summarizes the findings of the assessment and provides a general description of the hazardous building materials identified. For details on approximate quantities, condition, friability, accessibility, and locations of hazardous building materials; refer to the Hazardous Material Summary / Sample Log and All Data Report in Appendices V and VI.

Any quantities listed in this report or data tables are estimated based on visual approximations only and are subject to variation.

4.1 Asbestos

4.1.1 Pipe Insulation

Parging cement present on pipe fittings (elbows) in the assessed area does not contain asbestos (photo 1; samples S0050A-C).

Remaining pipes in the assessed area are either uninsulated or insulated with non-asbestos fibreglass or other non-asbestos insulation such as mineral fibre or elastomeric foam insulation (photo 2).

Pipes insulated with asbestos-containing insulations may be present in inaccessible spaces such as above solid ceilings, in chases, in column enclosures and within shafts.







Photo 2

© 2025 Pinchin Ltd. Page 3 of 16

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board February 26, 2025 Pinchin File: 352293.002 REVISED

4.1.2 Duct Insulation and Mastic

Ducts are either uninsulated or insulated with non-asbestos fibreglass (foil-faced or canvas jacketing) (photos 1 and 2).

Mastic was not observed on exterior sections of ducts assessed.



Photo 1



Photo 2

4.1.3 Mechanical Equipment Insulation

Mechanical equipment is uninsulated (photo 1).



Photo 1

4.1.4 Vermiculite

Destructive testing was conducted of a representative selection of masonry block walls, including creating penetrations at three locations (photos 1 and 2). The locations of destructive testing have been indicated on the drawings in Appendix I.

Loose fill vermiculite was not observed within the cavities.

© 2025 Pinchin Ltd. Page 4 of 16

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED



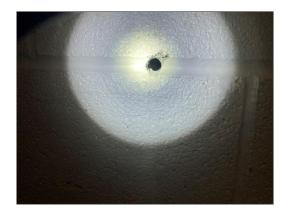


Photo 1 Photo 2

4.1.5 Acoustic Ceiling Tiles

The following is a summary of acoustic ceiling tiles sampled.

Description	Location	Date Code or Material Composition	Asbestos
24"x48", lay-in, pinhole w/ fleck (photo 1)	Girls Changeroom (Location 5833)	03/23/96	No
24"x24", lay-in, textured w/ pinhole (photo 2)	Corridor (Location 5844) Corridor (Location 5845)	Mineral Fiber	No
24"x48", lay-in, pinhole w/ fleck (photo 1)	Boys Changeroom (Location 5841)	01/22/96	No
24"x48", lay-in, pinhole w/ fleck	Office (Location 5837) Kitchen (Location 5838) Office (Location 5840)	03/23/96	No

Ceiling tiles are presumed to be non-asbestos based on the date of manufacture determined from the date stamp applied to the top of the tiles. The tiles were manufactured after asbestos stopped being used in acoustic ceiling tiles.

© 2025 Pinchin Ltd. Page 5 of 16

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED



Photo 1



Photo 2

4.1.6 Drywall Joint Compound

Drywall joint compound present on wall and ceiling finishes throughout the assessed area does not contain asbestos (photos 1-4; samples S0056A-C and S0057A-C).



Photo 1



Photo 2



Photo 3



Photo 4

© 2025 Pinchin Ltd. Page 6 of 16

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED

4.1.7 Asbestos Cement Products

Cement pipe (Transite), presumed to contain asbestos based on visual observation and covered with fibreglass insulation, is present as sanitary drains / rainwater leaders in the Storage (Location 5839; photos 1 and 2).





Photo 1

Photo 2

4.1.8 Vinyl Floor Tiles, Baseboard, and Stair Flooring

The following is a summary of vinyl floor tiles sampled.

Description	Sample Location (Location #)	Sample Number	Asbestos (Tile / Adhesive)	Photo
12"x12" beige w/ brown fleck	Girls Changeroom (Location 5833) Girls Changeroom washroom (Location 5835)	S0049A-C	Tile: Chrysotile Mastic: None detected	
12"x12" beige w/ brown flecks	Office (Location 5840) Storage (Location 5839)	S0045A-C	Yes	

© 2025 Pinchin Ltd. Page 7 of 16



Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED

Description	Sample Location (Location #)	Sample Number	Asbestos (Tile / Adhesive)	Photo
Baseboard adhesive	Girls Changeroom (Location 5833)	S0054A-C	None detected	

4.1.9 Firestopping

Firestopping (cementitious), present at structural, pipe and conduit penetrations throughout the assessed area does not contain asbestos (samples S0055A-C, photos 1 and 2).

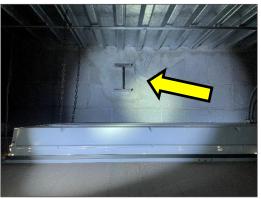


Photo 1



Photo 2

4.1.10 Sealants, Caulking, and Putty

The following is a summary of sealants, caulking, and putties sampled.

© 2025 Pinchin Ltd. Page 8 of 16

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED

Material, Description and Application	Sample Location (Location #)	Sample Number	Asbestos	Photo
Caulking, beige on door frame	Girls Changeroom (Location 5833) Vestibule (Location 5836)	S0053A-C	None detected	

4.1.11 Other Building Materials

Thin-set under ceramic tiles on the floor and walls throughout the assessed area does not contain asbestos (photos 1 and 2; samples S0051A-C and S0061A-C).

Pale yellow paint present on concrete block throughout the assessed area does not contain asbestos (photo 3; samples S0052A-C).







Photo 2

© 2025 Pinchin Ltd. Page 9 of 16

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED



Photo 3

4.1.12 Excluded Materials

The following is a list of materials which may contain asbestos and was excluded from the assessment. These materials are presumed to contain asbestos until otherwise proven by sampling and analysis:

- Floor levelling compound
- Electrical components
- Mechanical packing, ropes, and gaskets
- Adhesives and duct mastics
- Paper products
- Fire resistant doors
- Stucco, plaster or other cementitious parge coatings
- Vibration dampers on HVAC equipment
- Ropes and gaskets in cast-iron bell and spigot joints
- Sealants on pipe threads

4.2 Lead

4.2.1 Paints and Surface Coatings

Refer to the lab report(s) in Appendix II-B and the Hazardous Material Summary / Sample Log in Appendix V for details on paints sampled and their locations.

The following table summarizes the analytical results of paints sampled.

© 2025 Pinchin Ltd. Page 10 of 16



Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED

Sample Number	Colour, Substrate Description	Sample Location	Lead %	Photo
L0012	Pale yellow on block wall	Girls Changeroom (Location 5833)	<0.00023	
L0013	Red on structural steel	Girls Changeroom (Location 5833)	0.063	
L0014	Green on metal door frame	Girls Changeroom (Location 5833)	0.0033	We consider the control of the contr
L0015	Yellow on block wall	Boys Changeroom (Location 5841)	<0.00052	

© 2025 Pinchin Ltd. Page 11 of 16

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED

Sample Number	Colour, Substrate Description	Sample Location	Lead %	Photo
L0016	Grey on metal door frame	Boys Changeroom (Location 5841)	0.010	
L0017	Brown on metal duct vent	Exterior 1982 (Location 5847)	0.0088	

Results less than or equal to 0.1% (1,000 mg/kg), but equal to or greater than 0.009% (90 mg/kg), are considered low-level lead paints or surface coatings in accordance with the EACC guideline.

4.2.2 Lead Products and Applications

Lead products were not found during the assessment.

4.2.3 Excluded Lead Materials

Lead is known to be present in several materials which were not assessed or sampled. The following materials, where found, should be presumed to contain lead.

- Electrical components, including wiring connectors, grounding conductors, and solder
- Solder on pipe connections
- Glazing on ceramic tiles

4.3 Silica

Crystalline silica is assumed to be a component of the following materials where present in the building.

- Concrete
- Masonry and mortar
- Ceramic tiles and grout

© 2025 Pinchin Ltd. Page 12 of 16

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED

4.4 Mercury

4.4.1 Lamps

Mercury vapour is present in fluorescent lamp tubes (photo 1).

Thermostats inspected did not contain liquid mercury ampules (photo 2).







Photo 2

4.5 Polychlorinated Biphenyls

4.5.1 Lighting Ballasts

Based on date of renovation and confirmed by visual observations (e.g., evidence of T-5 or T-8 fixtures with electronic ballasts) the fixtures will not contain PCB ballasts.

4.5.2 Transformers

Transformers were not found during the assessment.

4.6 Mould and Water Damage

Visible mould growth and water damage was not found during the assessment.

5.0 RECOMMENDATIONS

5.1 General

1. Prepare scope of work or performance specifications for hazardous material removal required for the planned work. The specifications should include safe work practices, personal protective equipment, respiratory protection, and disposal of waste materials.

© 2025 Pinchin Ltd. Page 13 of 16

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

Pinchin File: 352293.002 REVISED

February 26, 2025

- 2. If suspected hazardous building materials are discovered during the planned work, which are not identified in this report, do not disturb, and arrange for further testing and evaluation.
- 3. Conduct further investigation of the following items, areas, or locations, which were not completed during this assessment:
 - a. Any items listed as exclusions in this report, prior to disturbance.
- Provide this report and the detailed plans and specifications to the contractor prior to bidding or commencing work.
- Retain a qualified consultant to specify, observe and document the successful removal of hazardous materials.
- 6. Update the asbestos inventory upon completion of the abatement and removal of asbestos-containing materials and any other relevant findings.

5.2 Building Renovation Work

The following recommendations are made regarding renovation involving the hazardous materials identified.

5.2.1 Asbestos

Remove asbestos-containing materials (ACM) prior to renovation, alteration, or maintenance if ACM may be disturbed by the work. If the identified ACM will not be removed prior to commencement of the work, any potential disturbance of ACM must follow asbestos precautions appropriate for the type of work being performed.

Asbestos-containing materials must be disposed of at a landfill approved to accept asbestos waste.

5.2.2 Lead

For paints identified as having low levels of lead (i.e., equal to or above 0.009% (90 mg/kg) but less than or equal to the EACC guideline of 0.1% (1,000 mg/kg) for lead-containing paints) special precautions are not recommended unless aggressive disturbance (grinding, blasting, torching) is planned. Exposure from construction disturbance of paints containing lead less than 0.009% (90 mg/kg) is assumed to be insignificant.

Lead-containing items should be recycled when taken out of service.

© 2025 Pinchin Ltd. Page 14 of 16

Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002

REVISED

5.2.3 Silica

Construction disturbance of silica-containing products may result in excessive exposures to airborne silica, especially if performed indoors and dry. Cutting, grinding, drilling or demolition of materials containing silica should be completed only with proper respiratory protection and other worker safety precautions that comply with applicable regulations and guidelines.

5.2.4 Mercury

Do not break lamps. Recycle and reclaim mercury from fluorescent lamps when taken out of service. Mercury is classified as a hazardous waste and must be disposed of in accordance with applicable regulations.

6.0 TERMS AND LIMITATIONS

This work was performed subject to the Terms and Limitations presented or referenced in the proposal for this project.

Information provided by Pinchin is intended for Client use only. Pinchin will not provide results or information to any party unless disclosure by Pinchin is required by law. Any use by a third party of reports or documents authored by Pinchin or any reliance by a third party on or decisions made by a third party based on the findings described in said documents, is the sole responsibility of such third parties. Pinchin accepts no responsibility for damages suffered by any third party as a result of decisions made or actions conducted. No other warranties are implied or expressed.

7.0 REFERENCES

The following legislation and documents were referenced in completing the assessment and this report:

- Asbestos on Construction Projects and in Buildings and Repair Operations, Ontario Regulation 278/05.
- Designated Substances, Ontario Regulation 490/09.
- 3. Lead on Construction Projects, Ministry of Labour Guidance Document.
- The Environmental Abatement Council of Canada (EACC) Lead Guideline for Construction, Renovation, Maintenance or Repair.
- 5. Ministry of the Environment Regulation, R.R.O. 1990 Reg. 347 as amended.
- 6. Ministry of the Environment Regulation, R.R.O. 1990 Reg. 362 as amended.
- 7. Silica on Construction Projects, Ministry of Labour Guidance Document.
- 8. Alert Mould in Workplace Buildings, Ontario Ministry of Labour.

© 2025 Pinchin Ltd. Page 15 of 16




Lake Avenue Elementary School, 157 Lake Avenue North, Hamilton, Ontario Hamilton-Wentworth District School Board

February 26, 2025 Pinchin File: 352293.002 REVISED

Template: Master Report for Hazardous Materials Assessment (Pre-Construction), HAZ, June 19, 2024

© 2025 Pinchin Ltd. Page 16 of 16

APPENDIX I Drawings

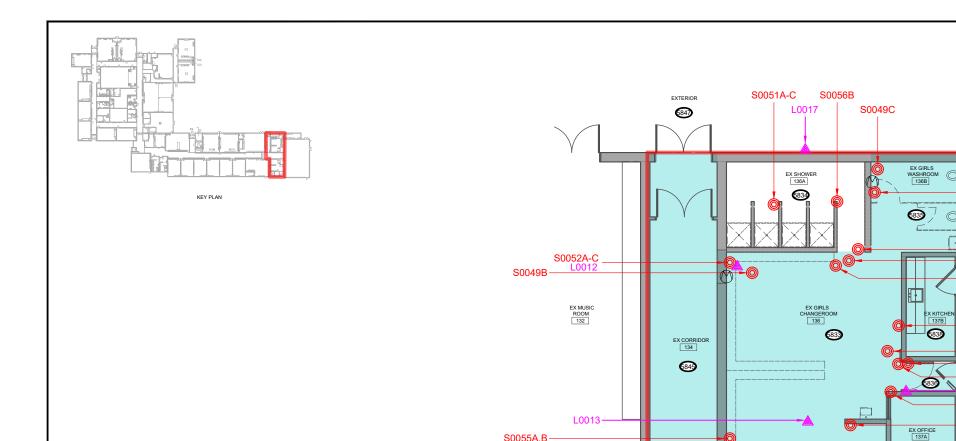

S0055A,B-

S0055C

S0061A-C-

EX CLASSROOM 139



LEGEND

S0045B

6839

EX GYMNASIUM 137

6837

6840

EX BOYS WASHROOM 138B

F **6842**

EX CORRIDOR

EX BOYS CHANGEROOM

EX BOYS SHOWER 138A

6841

6844

S0056C

S0056A

S0050C

S0054C

S0049A S0053C

S0053A,B - L0014 - S0054B

S0054A

- L0016

S0045A

S0057A

- L0015 S0057B S0057C

S0050A,B

PINCHIN LOCATION NUMBER

ASSESSED AREA



ASBESTOS BULK SAMPLE



LEAD BULK SAMPLE



VERMICULITE DRILLHOLE







NOT ALL KNOWN OR SUSPECTED HAZARDOUS BUILDING MATERIALS MAY BE DEPICTED ON THE DRAWING. REFER TO THE HAZARDOUS BUILDING MATERIALS
ASSESSMENT REPORT FOR A COMPLETE LIST OF KNOWN AND SUSPECTED HAZARDOUS BUILDING MATERIALS.

LEGEND IS COLOUR DEPENDENT. NON-COLOUR COPIES MAY ALTER INTERPRETATION.

BASE PLAN PROVIDED BY CLIENT.



HAZARDOUS BUILDING MATERIALS ASSESSMENT

HAMILTON-WENTWORTH DISTRICT SCHOOL BOARD

LAKE AVENUE ELEMENTARY SCHOOL 157 LAKE AVENUE NORTH, HAMILTON, ONTARIO

MAIN FLOOR- GYM BATHROOM

PROJECT NUMBER:	SCALE:
352293.002	NOT TO SCALE
DRAWN BY:	REVIEWED BY:
KU	JC
DATE:	FIGURE NUMBER:
FEBRUARY 2025	1 OF 1

APPENDIX II-A
Asbestos Analytical Certificates



By Polarized Light Microscopy EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E, App.E

Jessica Cozzitorto

Attn: Emily Balfour





Customer: Pinchin Ltd.

6-875 Main St West

Suite 200

Hamilton, Ontario L8S 4P9

Project: 303983.014 Lake Ave Corridor and Gym Renovations **Lab Order ID:** 71991181

Analysis ID: 71991181 PLM

Date Received: 5/2/2022 Date Reported: 5/4/2022

Sample ID	Description	A aboutou	Fibrous	Non-Fibrous	Attributes
Lab Sample ID	Lab Notes	Asbestos	Components	Components	Treatment
S0036A - A	Floor, Vinyl Floor Tile And Mastic, 9x9 Yellow, Brown, And Red With Streaks, Loc: 57	8% Chrysotile		92% Other	Brown, Red Non Fibrous Homogeneous
71991181PLM_1	tile				Dissolved
S0036A - B	Floor, Vinyl Floor Tile And Mastic, 9x9 Yellow, Brown, And Red With Streaks, Loc: 57	None Detected		100% Other	Black Non Fibrous Homogeneous
71991181PLM_41	mastic				Dissolved
S0036B - A	Floor, Vinyl Floor Tile And Mastic, 9x9 Yellow, Brown, And Red With Streaks, Loc: 57	Not Analyzed			
71991181PLM_2	tile				
S0036B - B	Floor,Vinyl Floor Tile And Mastic,9x9 Yellow, Brown, And Red With Streaks,Loc:57	None Detected		100% Other	Black Non Fibrous Homogeneous
71991181PLM_42	mastic				Dissolved
S0036C - A	Floor, Vinyl Floor Tile And Mastic, 9x9 Yellow, Brown, And Red With Streaks, Loc: 57	Not Analyzed			
71991181PLM_3	tile				
S0036C - B	Floor, Vinyl Floor Tile And Mastic, 9x9 Yellow, Brown, And Red With Streaks, Loc: 57	None Detected		100% Other	Black Non Fibrous Homogeneous
71991181PLM_43	mastic				Dissolved
S0037A - A	Wall,Plaster,Loc:5767,Stage	None Detected		100% Other	White Non Fibrous Homogeneous
71991181PLM_4	finish				Crushed
S0037A - B	Wall,Plaster,Loc:5767,Stage	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71991181PLM_44	base				Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (60)

Analyst



By Polarized Light Microscopy EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E, App.E





Customer: Pinchin Ltd.

6-875 Main St West

Suite 200

Hamilton, Ontario L8S 4P9

Proj

Attn: Emily Balfour Jessica Cozzitorto **Lab Order ID:** 71991181

Analysis ID: 71991181 PLM

Date Received: 5/2/2022 Date Reported: 5/4/2022

ject:	303983.014 Lake Ave Corridor and Gym Renovations

Sample ID	Description	A ab actor	Fibrous	Non-Fibrous	Attributes
Lab Sample ID	Lab Notes	Asbestos	Components	Components	Treatment
S0037B - A	Wall,Plaster,Loc:5766,Gymna sium	None Detected		100% Other	White Non Fibrous Homogeneous
71991181PLM_5	finish				Crushed
S0037B - B	Wall,Plaster,Loc:5766,Gymna sium	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71991181PLM_45	base				Crushed
S0037C - A	Wall,Plaster,Loc:5774,Corrido	None Detected		100% Other	White Non Fibrous Homogeneous
71991181PLM_6	finish				Crushed
S0037C - B	Wall,Plaster,Loc:5774,Corrido	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71991181PLM_46	base				Crushed
S0037D - A	Wall,Plaster,Loc:5772,Corrido	None Detected		100% Other	White Non Fibrous Homogeneous
71991181PLM_7	finish				Crushed
S0037D - B	Wall,Plaster,Loc:5772,Corrido	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71991181PLM_47	base				Crushed
S0037E - A	Ceiling,Plaster,Loc:5768,Stora ge	None Detected		100% Other	White Non Fibrous Homogeneous
71991181PLM_8	finish				Crushed
S0037E - B	Ceiling,Plaster,Loc:5768,Stora ge	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71991181PLM_48	base				Crushed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (60)

Analyst



By Polarized Light Microscopy EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E, App.E

Jessica Cozzitorto

Attn: Emily Balfour





Customer: Pinchin Ltd.

6-875 Main St West

Suite 200

Hamilton, Ontario L8S 4P9

Project: 303983.014 Lake Ave Corridor and Gym Renovations **Lab Order ID:** 71991181

Analysis ID: 71991181 PLM

Date Received: 5/2/2022 Date Reported: 5/4/2022

Sample ID	Description	A ab astas	Fibrous	Non-Fibrous	Attributes
Lab Sample ID	Lab Notes	Asbestos	Components	Components	Treatment
S0037F - A	Wall,Plaster,Loc:5765,Storage	None Detected		100% Other	White Non Fibrous Homogeneous
71991181PLM_9	finish				Crushed
S0037F - B	Wall,Plaster,Loc:5765,Storage	None Detected		70% Other 30% Vermiculite	Gray, Gold Non Fibrous Heterogeneous
71991181PLM_49	base				Crushed, Teased
S0037G - A	Wall,Plaster,Loc:5776,Corrido	None Detected		100% Other	White Non Fibrous Homogeneous
71991181PLM_10	finish				Crushed
S0037G - B	Wall,Plaster,Loc:5776,Corrido	None Detected		100% Other	Gray Non Fibrous Heterogeneous
71991181PLM_50	base				Crushed
S0039A	Wall,Paint,Loc:5766,Gymnasi um	None Detected		100% Other	Yellow, White Non Fibrous Heterogeneous
71991181PLM_11	-				Dissolved
S0039B	Wall,Paint,Under Stage,Loc:5767,Stage	None Detected		100% Other	Red Non Fibrous Heterogeneous
71991181PLM_12	-				Dissolved
S0039C	Wall,Paint,Loc:5765,Storage	None Detected		100% Other	White, Gray Non Fibrous Heterogeneous
71991181PLM_13					Dissolved
S0040A	Wall,Base,Adhesive/mastic,Loc:5766,Gymnasium	None Detected		100% Other	Brown Non Fibrous Homogeneous
71991181PLM_14	-				Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (60)

Analyst



By Polarized Light Microscopy EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E, App.E





Customer: Pinchin Ltd.

6-875 Main St West

Suite 200

Hamilton, Ontario L8S 4P9

Project: 303983.014 Lake Ave Corridor and Gym Renovations

Attn: Emily Balfour **Lab Order ID:** 71991181 Jessica Cozzitorto **Analysis ID:** 71991181 PLM

Date Received: 5/2/2022 Date Reported: 5/4/2022

Sample ID	Description	Aghagtag	Fibrous	Non-Fibrous	Attributes
Lab Sample ID	Lab Notes	Asbestos	Components	Components	Treatment
S0040B	Wall,Base,Adhesive/mastic,Loc:5766,Gymnasium	None Detected		100% Other	Brown Non Fibrous Homogeneous
71991181PLM_15					Dissolved
S0040C	Wall,Base,Adhesive/mastic,Loc:5766,Gymnasium	None Detected		100% Other	Brown Non Fibrous Homogeneous
71991181PLM_16	-				Dissolved
S0041A - A	Floor, Vinyl Floor Tile And Mastic, 12x12 White With Black Streaks, Loc: 5767, Stage	5% Chrysotile		95% Other	White Non Fibrous Homogeneous
71991181PLM_17	tile				Dissolved
S0041A - B	Floor, Vinyl Floor Tile And Mastic, 12x12 White With Black Streaks, Loc: 5767, Stage	None Detected		100% Other	Black Non Fibrous Homogeneous
71991181PLM_51	mastic				Dissolved
S0041B - A	Floor, Vinyl Floor Tile And Mastic, 12x12 White With Black Streaks, Loc: 5774, Corri	Not Analyzed			
71991181PLM_18	tile				
S0041B - B	Floor, Vinyl Floor Tile And Mastic, 12x12 White With Black Streaks, Loc: 5774, Corri	None Detected		100% Other	Black Non Fibrous Homogeneous
71991181PLM_52	mastic				Dissolved
S0041B - A	Floor, Vinyl Floor Tile And Mastic, 12x12 White With Black Streaks, Loc: 5774, Corri	Not Analyzed			
71991181PLM_19	tile	·			
S0041B - B	Floor, Vinyl Floor Tile And Mastic, 12x12 White With Black Streaks, Loc: 5774, Corri	None Detected		100% Other	Black Non Fibrous Homogeneous
71991181PLM_53	mastic				Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (60)

Analyst



By Polarized Light Microscopy EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E, App.E

Jessica Cozzitorto

Attn: Emily Balfour





Customer: Pinchin Ltd.

6-875 Main St West

Suite 200

Hamilton, Ontario L8S 4P9

Project: 303983.014 Lake Ave Corridor and Gym Renovations **Lab Order ID:** 71991181

Analysis ID: 71991181 PLM

Date Received: 5/2/2022 Date Reported: 5/4/2022

Sample ID	Description	A ala auta a	Fibrous	Non-Fibrous	Attributes
Lab Sample ID	Lab Notes	Asbestos	Components	Components	Treatment
S0042A	Piping,Firestopping (friable) ,Loc:5782,Storage	40% Chrysotile		60% Other	Gray Fibrous Homogeneous
71991181PLM_20					Teased
S0042B	Piping,Firestopping (friable) ,Loc:5780,Kitchenette	Not Analyzed			
71991181PLM_21					
S0042C	Piping,Firestopping (friable) ,Loc:5780,Kitchenette	Not Analyzed			
71991181PLM_22					
S0043A	Wall,Paint,Loc:5782,Storage	None Detected		100% Other	Cream, Gray, Red Non Fibrous Heterogeneous
71991181PLM_23					Dissolved, Crushed
S0043B	Wall,Paint,Loc:5780,Kitchene tte	None Detected		100% Other	Cream, Gray, Red Non Fibrous Heterogeneous
71991181PLM_24					Dissolved, Crushed
S0043C	Wall,Paint,Loc:5780,Kitchene tte	None Detected		100% Other	Cream, Gray, Red Non Fibrous Heterogeneous
71991181PLM_25					Dissolved, Crushed
S0044A	Piping,Parging Cement,Loc:5839,Storage	None Detected	20% Fiber Glass	80% Other	Gray Fibrous Homogeneous
71991181PLM_26					Teased
S0044B	Piping,Parging Cement,Loc:5839,Storage	None Detected	20% Fiber Glass	80% Other	Gray Fibrous Homogeneous
71991181PLM_27					Teased

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (60)

Analyst



By Polarized Light Microscopy EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E, App.E





Customer: Pinchin Ltd.

6-875 Main St West

Suite 200

Hamilton, Ontario L8S 4P9

Project: 303983.014 Lake Ave Corridor and Gym Renovations

Attn: Emily Balfour Jessica Cozzitorto **Lab Order ID:** 71991181

Analysis ID: 71991181_PLM

Date Received: 5/2/2022 Date Reported: 5/4/2022

Sample ID	Description	A alla au4 a a	Fibrous	Non-Fibrous	Attributes
Lab Sample ID	Lab Notes	Asbestos	Components	Components	Treatment
S0044C	Piping,Parging Cement,Loc:5839,Storage	None Detected	20% Fiber Glass	80% Other	Gray Fibrous Homogeneous
71991181PLM_28					Teased
S0045A - A	Floor, Vinyl Floor Tile And Mastic, 12x12 Beige With Brown Flecks, Loc: 5840, Offic	2% Chrysotile		98% Other	Beige Non Fibrous Homogeneous
71991181PLM_29	tile				Dissolved
S0045A - B	Floor, Vinyl Floor Tile And Mastic, 12x12 Beige With Brown Flecks, Loc: 5840, Offic	None Detected		100% Other	Black Non Fibrous Homogeneous
71991181PLM_54	mastic				Dissolved
S0045B - A	Floor, Vinyl Floor Tile And Mastic, 12x12 Beige With Brown Flecks, Loc: 5839, Stora	Not Analyzed			
71991181PLM_30	tile				
S0045B - B	Floor, Vinyl Floor Tile And Mastic, 12x12 Beige With Brown Flecks, Loc: 5839, Stora	None Detected		100% Other	Black Non Fibrous Homogeneous
71991181PLM_55	mastic				Dissolved
S0045C - A	Floor, Vinyl Floor Tile And Mastic, 12x12 Beige With Brown Flecks, Loc: 5839, Stora	Not Analyzed			
71991181PLM_31	tile				
S0045C - B	Floor, Vinyl Floor Tile And Mastic, 12x12 Beige With Brown Flecks, Loc: 5839, Stora	None Detected		100% Other	Black Non Fibrous Homogeneous
71991181PLM_56	mastic				Dissolved
S0046A	Wall,Base,Adhesive/mastic,Loc:5840,Office	None Detected		100% Other	Brown Non Fibrous Homogeneous
71991181PLM_32					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (60)

Analyst

P-F-002 r15 1/16/2023



By Polarized Light Microscopy EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E, App.E





Customer: Pinchin Ltd.

6-875 Main St West

Suite 200

Hamilton, Ontario L8S 4P9

Project:

Attn: Emily Balfour Jessica Cozzitorto **Lab Order ID:** 71991181 **Analysis ID:** 71991181 PLM

Date Received: 5/2/2022 Date Reported: 5/4/2022

303983.014 Lake Ave Corridor and Gym Renovations

Sample ID	Description	Ashastas	Fibrous	Non-Fibrous	Attributes
Lab Sample ID	Lab Notes	Asbestos	Components	Components	Treatment
S0046B	Wall,Base,Adhesive/mastic,Loc:10525,Gymnasium	None Detected		100% Other	Brown Non Fibrous Homogeneous
71991181PLM_33					Dissolved
S0046C	Wall,Base,Adhesive/mastic,Loc:10525,Gymnasium	None Detected		100% Other	Brown Non Fibrous Homogeneous
71991181PLM_34					Dissolved
S0047A - A	Floor,Vinyl Floor Tile And Mastic, 12x12 Red with White Streaks,Loc:5780,Kitchenette	3% Chrysotile		97% Other	Red Non Fibrous Homogeneous
71991181PLM_35	tile				Dissolved
S0047A - B	Floor, Vinyl Floor Tile And Mastic, 12x12 Red with White Streaks, Loc: 5780, Kitchenette	None Detected		100% Other	Black Non Fibrous Homogeneous
71991181PLM_57	mastic				Dissolved
S0047B	Floor,Vinyl Floor Tile And Mastic, 12x12 Red with White Streaks,Loc:5780,Kitchenette	Not Analyzed			
71991181PLM_36	tile only				
S0047C	Floor, Vinyl Floor Tile And Mastic, 12x12 Red with White Streaks, Loc: 5780, Kitchenette	Not Analyzed			
71991181PLM_37	tile only				
S0048A - A	Floor,Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks,Loc:5782,Stora	5% Chrysotile		95% Other	Tan Non Fibrous Homogeneous
71991181PLM_38	tile	-			Dissolved
S0048A - B	Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Stora	None Detected		100% Other	Black Non Fibrous Homogeneous
71991181PLM_58	mastic				Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (60)

Analyst



By Polarized Light Microscopy EPA Method: 600/R-93/116 and 40 CFR, Part 763, Subpart E, App.E





Customer: Pinchin Ltd.

6-875 Main St West

Suite 200

Hamilton, Ontario L8S 4P9

Project: 303983.014 Lake Ave Corridor and Gym Renovations

mastic

71991181PLM 60

Attn: Emily Balfour Jessica Cozzitorto **Lab Order ID:** 71991181

Analysis ID: 71991181_PLM

Dissolved

Date Received: 5/2/2022 Date Reported: 5/4/2022

S0048B - A Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Stora S0048B - B Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Stora S0048C - A Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Stora S0048C - A Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Stora S0048C - A Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Stora S0048C - A Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Stora S0048C - B Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Stora S0048C - B Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Stora S0048C - B Floor, Vinyl Floor Tile And Mastic, 12x12 Green with Non Fibro	Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Not Analyzed S0048B - A Mastic, 12x12 Green with White Streaks,Loc:5782,Stora Not Analyzed	Lab Sample ID	Lab Notes				Treatment
S0048B - B Floor,Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks,Loc:5782,Stora Mone Detected None Detected None Detected 100% Other Black Non Fibror Homogene Dissolved Floor,Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks,Loc:5782,Stora Not Analyzed Floor,Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks,Loc:5782,Stora Floor,Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks,Loc:5782,Stora Floor,Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks,Loc:5782,Stora	S0048B - A	Mastic, 12x12 Green with	Not Analyzed			
S0048B - B Mastic, 12x12 Green with White Streaks,Loc:5782,Stora None Detected None Fibro Homogene Dissolved Floor,Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks,Loc:5782,Stora Not Analyzed Not Analyzed Floor,Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks,Loc:5782,Stora Floor,Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks,Loc:5782,Stora	71991181PLM_39	tile	•			
S0048C - A Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Stora Not Analyzed Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Stora Floor, Vinyl Floor Tile And Mastic, 12x12 Green with Non Fibror	S0048B - B	Mastic, 12x12 Green with	None Detected		100% Other	Black Non Fibrous Homogeneous
S0048C - A Mastic, 12x12 Green with White Streaks, Loc: 5782, Stora Not Analyzed Tile Floor, Vinyl Floor Tile And Mastic, 12x12 Green with Non Fibrol	71991181PLM_59	mastic				Dissolved
Floor, Vinyl Floor Tile And Mastic, 12x12 Green with Black Non Fibro	S0048C - A	Mastic, 12x12 Green with	Not Analyzed			
S0048C - B Mastic, 12x12 Green with Non Fibro	71991181PLM_40	tile				
Trone Detected 100% One 100mogene	S0048C - B	Mastic, 12x12 Green with	None Detected		100% Other	Black Non Fibrous Homogeneous

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Megan Javonovich (60)

*Instructions: Version 1-15-2012 Client: Pinchin Ltd. Emily Balfour / Jessica Cozzitorto Use Column "B" for your contact info Contact: Address: To See an Example Click the Phone: bottom Example Tab. Fax: ebalfour@pinchin.com Email: icozzitorto@pinchin.com 146 303983.014 Lake Ave Corridor and **Gvm Renovations** Begin Samples with a "<< "above the first sample Scientific Project: Stop positive on all samples and end with a ">>" below the last sample. Analytical *Do not analyze plaster if present in Client Notes: Institute samples S0039A-G* *Only analyze mastic in samples S0040A-C and S0046A-C* Only Enter your data on the first sheet "Sheet1" Note: Data 1 and Data 2 are optional P.O. #. 303983.014 4604 Dundas Dr. fields that do not show up on the official Date Submitted: 04-28-2022 Greensboro, NC 27407 Phone: 336.292.3888 report, however they will be included Analysis: PLM BULK EPA 600 in the electronic data returned to you Fax: 336.292.3313 to facilitate your reintegration of the report data. Email: lab@sailab.com 48 Hour Turnaround TurnAroundTime:

Sample Number	Data 1 (Lab use only)	Sample Description	Data 2 (Lab use only\)
<<			
S0036A		Floor, Vinyl Floor Tile And Mastic, 9x9	Yellow, Brown, And Red With Streaks, Loc: 5766, Gymnasium
S0036B		Floor, Vinyl Floor Tile And Mastic, 9x9	Yellow, Brown, And Red With Streaks, Loc: 5766, Gymnasium
S0036C		Floor, Vinyl Floor Tile And Mastic, 9x9	Yellow, Brown, And Red With Streaks, Loc: 5766, Gymnasium
S0037A		Wall,Plaster,Loc:5767,Stage	
S0037B		Wall, Plaster, Loc: 5766, Gymnasium	· ·
S0037C		Wall, Plaster, Loc: 5774, Corridor	Accorded X
S0037D		Wall, Plaster, Loc: 5772, Corridor	A STATE OF THE STA
S0037E		Ceiling, Plaster, Loc: 5768, Storage	
S0037F		Wall, Plaster, Loc: 5765, Storage	
S0037G		Wall, Plaster, Loc: 5776, Comidor	
S0039A		Wall, Paint, Loc: 5766, Gymnasium	KINDO
S0039B		Wall, Paint, Under Stage, Loc: 5767, Sta	ge . OW M
S0039C		Wall,Paint,Loc:5765,Storage	AL AL
S0040A		Wall, Base, Adhesive/mastic, Loc: 5766	,Gymnasium
S0040B		Wall, Base, Adhesive/mastic, Loc: 5766	,Gymnasium
S0040C		Wall, Base, Adhesive/mastic, Loc: 5766	,Gymnasium
S0041A		Floor, Vinyl Floor Tile And Mastic, 12x1	2 White With Black Streaks,Loc:5767,Stage
S0041B		Floor, Vinyl Floor Tile And Mastic, 12x1	2 White With Black Streaks, Loc: 5774, Corridor

S0041B	Floor, Vinyl Floor Tile And Mastic, 12x12 White With Black Streaks, Loc: 5774, Corridor
S0042A	Piping, Firestopping (friable), Loc: 5782, Storage
S0042B	Piping, Firestopping (friable), Loc: 5780, Kitchenette
S0042C	Piping, Firestopping (friable), Loc: 5780, Kitchenette
S0043A	Wall,Paint,Loc:5782,Storage
S0043B	Wall,Paint,Loc:5780,Kitchenette
S0043C	Wall,Paint,Loc:5780,Kitchenette
S0044A	Piping, Parging Cement, Loc: 5839, Storage
S0044B	Piping, Parging Cement, Loc: 5839, Storage
S0044C	Piping, Parging Cement, Loc: 5839, Storage
S0045A	Floor, Vinyl Floor Tile And Mastic, 12x12 Beige With Brown Flecks, Loc: 5840, Office
S0045B	Floor, Vinyl Floor Tile And Mastic, 12x12 Beige With Brown Flecks, Loc: 5839, Storage
S0045C	Floor, Vinyl Floor Tile And Mastic, 12x12 Beige Winn Brown Flecks, Loc: 5839, Storage
S0046A	Wall, Base, Adhesive/mastic, Loc: 5840, Office
S0046B	Wall, Base, Adhesive/mastic, Loc: 10525, Gymnasium
S0046C	Wall,Base,Adhesive/mastic,Loc:10525,Gymnasium
S0047A	Floor, Vinyl Floor Tile And Mastic, 12x12 Red with White Streaks, Loc: 5780, Kitchenette
S0047B	Floor, Vinyl Floor Tile And Mastic, 12x12 Red with White Streaks, Loc: 5780, Kitchenette
S0047C	Floor, Vinyl Floor Tile And Mastic, 12x12 Red with White Streaks, Loc: 5780, Kitchenette
S0048A	Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Storage
S0048B	Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Storage
S0048C	Floor, Vinyl Floor Tile And Mastic, 12x12 Green with White Streaks, Loc: 5782, Storage
>>	



Pinchin Ltd. Asbestos Laboratory Certificate of Analysis

Project No.: 0352293.002

Prepared For: A. Altena / J. Cozzitorto

Lab Reference No.: b332150 Analyst(s): A. Kaur

Date Received: February 13, 2025 Samples Submitted: 6
Date Analyzed: February 21, 2025 Phases Analyzed: 9

The Pinchin Ltd. Mississauga asbestos laboratory is accredited by the National Institute of Standards and Technology, National Voluntary Laboratory Accreditation Program (NVLAP Lab Code 101270-0) for the 'EPA – 40 CFR Appendix E to Subpart E of Part 763, Interim Method of the Determination of Asbestos in Bulk Insulation Samples,' and the 'EPA 600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials'; and meets all requirements of ISO/IEC 17025:2017. The Pinchin asbestos laboratory uses the aforementioned methods of analysis for all bulk materials. Please be advised that bulk materials do not include debris, dust, and tape-lift samples, and the analysis and reporting of these materials does not conform with Pinchin Ltd.'s NVLAP accreditation.

Bulk samples are checked visually and scanned under a stereomicroscope. Slides are prepared and observed under a Polarized Light Microscope (PLM) at magnifications of 40X, 100X or 400X as appropriate. Asbestos fibres are identified by a combination of morphology, colour, refractive index, extinction, sign of elongation, birefringence and dispersion staining colours. A visual estimate is made of the percentage of asbestos present. A reported concentration of less than (<) the regulatory threshold indicates the presence of confirmed asbestos in trace quantities, limited to only a few fibres or fibre bundles in an entire sample. This method complies with provincial regulatory requirements where applicable. Multiple phases within a sample are analyzed and reported separately.

All bulk samples submitted to this laboratory for asbestos analysis are retained for a minimum of three months. Samples may be retrieved, upon request, for re-examination at any time during that period.

This report relates only to the items tested.

This report relates only to the items tested and is valid only when signed with a protected, authorized, electronic signature. This report may not be reproduced, except in full, without the written approval of Pinchin Ltd. The client may not use this report to claim product endorsement by NVLAP or any agency of the U.S. Government.

Internal verification studies, quality assurance / control data and laboratory documentation on measurement uncertainty are available upon request.



Pinchin Ltd. Asbestos Laboratory Certificate of Analysis

Project No.: 0352293.002

Prepared For: A. Altena / J. Cozzitorto

Lab Reference No.: b332150

Date Analyzed: February 21, 2025

BULK SAMPLE ANALYSIS

SAMPLE	SAMPLE	% COMPOSITIO	N (VISUAL ESTIMATE)	
			<u>'</u>	
IDENTIFICATION	DESCRIPTION	ASBESTOS	OTHER	
S0057A Ceiling,Drywall And Joint Compound,Loc:5841,Boys Changeroom	Homogeneous, white, drywall joint compound.	None Detected	Non-Fibrous Material	> 75%
Comments:	Cellulose is present on the s	urface of this sample.	I	
S0057B Ceiling,Drywall And Joint Compound,Loc:5841,Boys Changeroom	Homogeneous, white, drywall joint compound.	None Detected	Non-Fibrous Material	> 75%
S0057C Ceiling,Drywall And Joint Compound,Loc:5842,Boys Changeroom Washroom	Homogeneous, white, drywall joint compound.	None Detected	Non-Fibrous Material	> 75%
S0061A Wall,Thin- set,Loc:5843,Boys Shower	2 Phases: a) Homogeneous, off-white, hard, cementitious material.	None Detected	Non-Fibrous Material	> 75%
	b) Homogeneous, white, hard, cementitious material.	None Detected	Non-Fibrous Material	> 75%
Comments:	Phase b) is small in size.			



Pinchin Ltd. Asbestos Laboratory Certificate of Analysis

Project No.: 0352293.002

Prepared For: A. Altena / J. Cozzitorto


Lab Reference No.: b332150

Date Analyzed: February 21, 2025

BULK SAMPLE ANALYSIS

SAMPLE	SAMPLE	% COMPOSITION (VISUAL ESTIMATE)
IDENTIFICATION	DESCRIPTION	ASBESTOS	OTHER
S0061B Wall,Thin- set,Loc:5843,Boys Shower	2 Phases: a) Homogeneous, off-white, hard, cementitious material.	None Detected	Non-Fibrous Material > 75%
	b) Homogeneous, white, hard, cementitious material.	None Detected	Non-Fibrous Material > 75%
Comments:	Phase b) is small in size. Ceramic tile is present on the	e surface of this sample.	
S0061C	2 Phases:		
Wall,Thin- set,Loc:5843,Boys Shower	a) Homogeneous, off-white, hard, cementitious material.	None Detected	Non-Fibrous Material > 75%
	b) Homogeneous, white, hard, cementitious material.	None Detected	Non-Fibrous Material > 75%
Comments:	Phase b) is small in size. Ceramic tile is present on the	e surface of this sample.	

Reviewed by: Reporting Analyst:

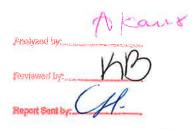

Pinchin Ltd. - Asbestos Laboratory Internal Asbestos Bulk Sample Chain of Custody

Special Instructions: Only analyze thinset on sample set S0061A-C

Client Name):			Project Address:	ON	- 17	
Portfolio/Bu	lio/Building No:			Pinchin File:	352293.002		
Submitted by: Adam Altena			Email:	aaltena@pind	hin.com		
CC Results	to:	Jessica Cozz	zitorto	CC Email:	jcozzitorto@p	oinchin.com	ì
Date Submit	tted:	February	12 2025	Required by:	February	19	2025
# of Sample	s:	6		Priority:	5 Day	y Turnarour	nd
Year of Build	ding Constru	ction (<i>Manda</i>	atory, Years ONLY):				
Do NOT Sto	p on Positive	(Sample Nu	mbers):				
Pinchin Gro	up Company	(Mandatory	Field):		Pinchin		
HMIS2 Building Reference #: 145955/202511163714956							
To be Comp	leted by Lab	Personnel O	nly:				
Lab Referen	ce #:	6332150		Time:	24	hour dock	
Received by:		FEB 1 3 2025	Date:	Month	Day	Year	
Name(s) of A	Analyst(s):	nka	ic y		Jes	21	202
Sample Prefix	Sample No.	Sample	Samp	le Description/Lo	cation (Mand	datory)	
Prenx	NO.	Suffix	915				
S	0057	А	Ceiling,Drywall And J	oint Compound,Loc:	5841,Boys Cha	angeroom	pro
S	0057	В	Ceiling, Drywall And J	oint Compound,Loc:	5841,Boys Cha	angeroom	NO
S	0057	С	Ceiling, Drywall And J Washroom	oint Compound,Loc:	5842,Boys Ch	angeroom	NO
S	0061	А	Wall,Thin-set,Loc:584	43,Boys Shower	ND		
S	0061	В	Wall,Thin-set,Loc:584	13 Boye Shower	ND ND		
S	0061	С	Wall,Thin-set,Loc:584	13 Boys Shower	NP ND		



Your Project #: 352293.002

Site Location: ON Your C.O.C. #: 1023072

Attention: Adam Altena

Pinchin Ltd 151 York Boulevard Suite 200 Hamilton, ON CANADA L8R 3M2

Report Date: 2025/02/12

Report #: R8486623 Version: 1 - Final

CERTIFICATE OF ANALYSIS

BUREAU VERITAS JOB #: C513417 Received: 2025/02/06, 14:23

Sample Matrix: Solid # Samples Received: 24

		Date	Date		
Analyses	Quantity	y Extracted	Analyzed	Laboratory Method	Analytical Method
Asbestos by PLM - 0.5 RDL (1)	24	N/A	2025/02/1	2 COR3SOP-00002	EPA 600R-93/116

Remarks:

Bureau Veritas is accredited to ISO/IEC 17025 for specific parameters on scopes of accreditation. Unless otherwise noted, procedures used by Bureau Veritas are based upon recognized Provincial, Federal or US method compendia such as CCME, EPA, APHA or the Quebec Ministry of Environment.

All work recorded herein has been done in accordance with procedures and practices ordinarily exercised by professionals in Bureau Veritas' profession using accepted testing methodologies, quality assurance and quality control procedures (except where otherwise agreed by the client and Bureau Veritas in writing). All data is in statistical control and has met quality control and method performance criteria unless otherwise noted. All method blanks are reported; unless indicated otherwise, associated sample data are not blank corrected. Where applicable, unless otherwise noted, Measurement Uncertainty has not been accounted for when stating conformity to the referenced standard.

Bureau Veritas liability is limited to the actual cost of the requested analyses, unless otherwise agreed in writing. There is no other warranty expressed or implied. Bureau Veritas has been retained to provide analysis of samples provided by the Client using the testing methodology referenced in this report. Interpretation and use of test results are the sole responsibility of the Client and are not within the scope of services provided by Bureau Veritas, unless otherwise agreed in writing. Bureau Veritas is not responsible for the accuracy or any data impacts, that result from the information provided by the customer or their agent.

Solid sample results, except biota, are based on dry weight unless otherwise indicated. Organic analyses are not recovery corrected except for isotope dilution methods.

Results relate to samples tested. When sampling is not conducted by Bureau Veritas, results relate to the supplied samples tested.

This Certificate shall not be reproduced except in full, without the written approval of the laboratory.

Bureau Veritas' Asbestos Laboratory is accredited by NVLAP for bulk asbestos analysis by polarized light microscopy, NVLAP Code 600136-0.

This report may not be reproduced, except in full, without the written approval of Bureau Veritas. This report may not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any other agency of the U.S. Government.

Bureau Veritas' scope of accreditation includes EPA -- 40 CFR Appendix E to Subpart E of Part 763, "Interim Method for the Determination of Asbestos in Bulk Insulation Samples" and EPA-600/R-93/116: "Method for the Determination of Asbestos in Bulk Building Materials".

Reference Method suffix "m" indicates test methods incorporate validated modifications from specific reference methods to improve performance.

* RPDs calculated using raw data. The rounding of final results may result in the apparent difference.

(1) P.O.B. - Percent of Bulk



Your Project #: 352293.002

Site Location: ON Your C.O.C. #: 1023072

Attention: Adam Altena

Pinchin Ltd 151 York Boulevard Suite 200 Hamilton, ON CANADA L8R 3M2

Report Date: 2025/02/12

Report #: R8486623 Version: 1 - Final

CERTIFICATE OF ANALYSIS

BUREAU VERITAS JOB #: C513417 Received: 2025/02/06, 14:23

When Asbestos data is reported with other data, this report contains data that are not covered by the NVLAP accreditation.

Encryption Key

Please direct all questions regarding this Certificate of Analysis to:

Nilushi Mahathantila, Project Manager

Email: Nilushi.Mahathantila@bureauveritas.com

Phone# (905) 817-5700

This report has been generated and distributed using a secure automated process.

Bureau Veritas has procedures in place to guard against improper use of the electronic signature and have the required "signatories", as per ISO/IEC 17025, signing the reports. For Service Group specific validation, please refer to the Validation Signatures page if included, otherwise available by request. For Department specific Analyst/Supervisor validation names, please refer to the Test Summary section if included, otherwise available by request. This report is authorized by Rodney Major, General Manager responsible for Ontario Environmental laboratory operations.



Client Project #: 352293.002

Site Location: ON Sampler Initials: JC

Asbestos Analytical Results

EPA/600R-93/116 by Polarized Light Microscopy

60049A,Floor,All,Vinyl Floor Tile And Mastic,12x12 Beige W/ Brown Fleck,Loc:5833,Girls Changeroom								
Bureau Veritas ID:	ANWL15					Date Analyzed:	2025/02/12	
	P.O.B	Sample Morphology	Asbestos		Other Fibres		Particulate	
Layer 1	95	Homogeneous grey vinyl floor tile	Chrysotile	1%			Non-Fibrous	
Layer 2	5	Homogeneous black mastic	Not Detected				Non-Fibrous	

S0049B,Floor,All,Vinyl Floor Tile And Mastic,12x12 Beige W/ Brown Fleck,Loc:5833,Girls Changeroom								
Bureau Veritas ID:	ANWL16			Date Analyzed:	2025/02/12			
	P.O.B	Sample Morphology	Asbestos	Other Fibres	Particulate			
Layer 1	95	Homogeneous grey vinyl floor tile	N/A					
	Comment:	Not Analyzed - Positive Stop						
Layer 2	5	Homogeneous black mastic	Not Detected		Non-Fibrous			

The limit of quantitation is 0.50%, although asbestos may be qualitatively detected at concentrations less than 0.50%. Samples for which asbestos is detected at <0.50% are reported as trace, "<0.50%". "Not Detected" indicates that no asbestos fibres were observed.



Client Project #: 352293.002

Site Location: ON Sampler Initials: JC

Asbestos Analytical Results

EPA/600R-93/116 by Polarized Light Microscopy

	· •	or Tile And Mastic,12x12 c:5835,Girls Changeroom				
Bureau Veritas ID:	ANWL17				Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate
Layer 1	95	Homogeneous grey vinyl floor tile	N/A		_	
	Comment:	Not Analyzed - Positive Stop				
Layer 2	5	Homogeneous black mastic	Not Detected			Non-Fibrous

Changeroom						
Bureau Veritas ID:	ANWL18]	Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate
Layer 1	100	Homogeneous grey cementitious material with fibres	Not Detected	Fibrous Glass	10%	Non-Fibrous

S0050B,Piping, Changeroom	All,Pargin	g Cement,Loc:5833,Girls				
Bureau Veritas ID:	ANWL19				Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate
Layer 1	100	Homogeneous grey cementitious material with fibres	Not Detected	Fibrous Glass	10%	Non-Fibrous

The limit of quantitation is 0.50%, although asbestos may be qualitatively detected at concentrations less than 0.50%. Samples for which asbestos is detected at <0.50% are reported as trace, "<0.50%". "Not Detected" indicates that no asbestos fibres were observed.



Client Project #: 352293.002

Site Location: ON Sampler Initials: JC

Asbestos Analytical Results

EPA/600R-93/116 by Polarized Light Microscopy

S0050C,Piping, Changeroom	All,Pargin	g Cement,Loc:5833,Girls				
Bureau Veritas ID:	ANWL20				Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate
Layer 1	100	Homogeneous grey cementitious material with fibres	Not Detected	Fibrous Glass	10%	Non-Fibrous

Shower Bureau Veritas ID:	ANWL21			Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres	Particulate
Layer 1	10	Homogeneous white thinset	Not Detected		Non-Fibrous
Layer 2	20	Homogeneous light grey thinset	Not Detected		Non-Fibrous
Layer 3	70	Homogeneous dark grey thinset	Not Detected		Non-Fibrous

The limit of quantitation is 0.50%, although asbestos may be qualitatively detected at concentrations less than 0.50%. Samples for which asbestos is detected at <0.50% are reported as trace, "<0.50%". "Not Detected" indicates that no asbestos fibres were observed.



Client Project #: 352293.002

Site Location: ON Sampler Initials: JC

Asbestos Analytical Results

EPA/600R-93/116 by Polarized Light Microscopy

S0051B,Floor,T Shower	hin-set,Lo	oc:5834,Girls Chngeroom			
Bureau Veritas ID:	ANWL22			Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres	Particulate
Layer 1	20	Homogeneous white thinset	Not Detected		Non-Fibrous
Layer 2	10	Homogeneous light grey thinset	Not Detected		Non-Fibrous
Layer 3	70	Homogeneous dark grey thinset	Not Detected		Non-Fibrous
ı					

S0051C,Floor,T Shower	hin-set,Lo	c:5834,Girls Chngeroom			
Bureau Veritas ID:	ANWL23			Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres	Particulate
Layer 1	10	Homogeneous white thinset	Not Detected		Non-Fibrous
Layer 2	60	Homogeneous light grey thinset	Not Detected		Non-Fibrous
Layer 3	30	Homogeneous dark grey thinset	Not Detected		Non-Fibrous

The limit of quantitation is 0.50%, although asbestos may be qualitatively detected at concentrations less than 0.50%. Samples for which asbestos is detected at <0.50% are reported as trace, "<0.50%". "Not Detected" indicates that no asbestos fibres were observed.



Client Project #: 352293.002

Site Location: ON Sampler Initials: JC

Asbestos Analytical Results

EPA/600R-93/116 by Polarized Light Microscopy

S0052A,Wall,Pa Changeroom	aint,Pale \	fellow,Loc:5833,Girls				
Bureau Veritas ID:	ANWL24		Date Analyzed:	2025/02/12		
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate
Layer 1	100	Non-homogeneous white paint/cementitious material	Not Detected	Fibrous Glass	10%	Non-Fibrous

S0052B,Wall,Pa Changeroom	aint,Pale Y	ellow,Loc:5833,Girls				
Bureau Veritas ID:	ANWL25				Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate
Layer 1	100	Non-homogeneous white paint/cementitious material	Not Detected	Fibrous Glass	10%	Non-Fibrous

S0052C,Wall,Pa Changeroom	int,Pale Y	ellow,Loc:5833,Girls				
Bureau Veritas ID:	ANWL26				Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate
Layer 1	100	Non-homogeneous white paint/cementitious material	Not Detected	Fibrous Glass	10%	Non-Fibrous

The limit of quantitation is 0.50%, although asbestos may be qualitatively detected at concentrations less than 0.50%. Samples for which asbestos is detected at <0.50% are reported as trace, "<0.50%". "Not Detected" indicates that no asbestos fibres were observed.



Client Project #: 352293.002

Site Location: ON Sampler Initials: JC

Asbestos Analytical Results

EPA/600R-93/116 by Polarized Light Microscopy

S0053A,Wall,D Caulking,Loc:58						
Bureau Veritas ID:	ANWL27				Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate
Layer 1	100	Homogeneous grey/beige caulking	Not Detected	Glass Fibres	<0.50%	Non-Fibrous

S0053B,Wall,D Caulking,Loc:5						
Bureau Veritas ID:	ANWL28				Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate
Layer 1	100	Homogeneous grey/beige caulking	Not Detected	Glass Fibres	<0.50%	Non-Fibrous

VL29				
			Date Analyzed:	2025/02/12
B Sample Morphology	Asbestos	Other Fibres		Particulate
Homogeneous grey/beige caulking	Not Detected	Glass Fibres	<0.50%	Non-Fibrous
	Homogeneous	Homogeneous Not Detected	Homogeneous Not Detected Glass Fibres	Homogeneous Not Detected Glass Fibres <0.50%

The limit of quantitation is 0.50%, although asbestos may be qualitatively detected at concentrations less than 0.50%. Samples for which asbestos is detected at <0.50% are reported as trace, "<0.50%". "Not Detected" indicates that no asbestos fibres were observed.



Client Project #: 352293.002

Site Location: ON Sampler Initials: JC

Asbestos Analytical Results

EPA/600R-93/116 by Polarized Light Microscopy

S0054A,Wall,Ba Mastic,Loc:583		c, Brown,Baseboard nangeroom				
Bureau Veritas ID:	ANWL30				Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate
Layer 1	100	Homogeneous brown mastic	Not Detected			Non-Fibrous

S0054B,Wall,B Mastic,Loc:583	-	c, Brown,Baseboard nangeroom			
Bureau Veritas ID:	ANWL31			Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres	Particulate
Layer 1	100	Homogeneous brown mastic	Not Detected		Non-Fibrous

S0054C,Wall,Ba Mastic,Loc:583	-	c, Brown,Baseboard nangeroom			
Bureau Veritas ID:	ANWL32			Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres	Particulate
Layer 1	100	Homogeneous brown mastic	Not Detected		Non-Fibrous
	200	mastic			

The limit of quantitation is 0.50%, although asbestos may be qualitatively detected at concentrations less than 0.50%. Samples for which asbestos is detected at <0.50% are reported as trace, "<0.50%". "Not Detected" indicates that no asbestos fibres were observed.



Client Project #: 352293.002

Site Location: ON Sampler Initials: JC

Asbestos Analytical Results

EPA/600R-93/116 by Polarized Light Microscopy

S0055A,Wall,Firestopping (cementitious),Loc:5833,Girls Changeroom									
Bureau Veritas ID:	ANWL33				Date Analyzed:	2025/02/12			
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate			
Layer 1	100	Homogeneous grey cementitious material	Not Detected			Non-Fibrous			

S0055B,Wall,F (cementitious)		ng s,Girls Changeroom			
Bureau Veritas ID:	ANWL34			Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres	Particulate
Layer 1	100	Homogeneous grey cementitious material	Not Detected		Non-Fibrous

S0055C,Wall,Firestopping cementitious),Loc:5833,Girls Changeroom									
Bureau Veritas ID:	ANWL35				Date Analyzed:	2025/02/12			
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate			
Layer 1	100	Homogeneous grey cementitious material	Not Detected			Non-Fibrous			

The limit of quantitation is 0.50%, although asbestos may be qualitatively detected at concentrations less than 0.50%. Samples for which asbestos is detected at <0.50% are reported as trace, "<0.50%". "Not Detected" indicates that no asbestos fibres were observed.



Report Date: 2025/02/12

Pinchin Ltd

Client Project #: 352293.002

Site Location: ON Sampler Initials: JC

Asbestos Analytical Results

EPA/600R-93/116 by Polarized Light Microscopy

S0056A,Ceiling,Drywall And Joint Compound,Loc:5834,Girls Chngeroom Shower									
Bureau Veritas ID:	ANWL36				Date Analyzed:	2025/02/12			
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate			
Layer 1	100	Homogeneous white drywall joint compound	Not Detected			Non-Fibrous			

S0056B,Ceiling Compound,Lo	-	And Joint Is Chngeroom Shower				
Bureau Veritas D:	ANWL37			С	Date Analyzed:	2025/02/12
	P.O.B	Sample Morphology	Asbestos	Other Fibres		Particulate
Layer 1	100	Homogeneous white drywall joint compound	Not Detected		_	Non-Fibrous

-	nd Joint s Chngeroom Shower			
ANWL38			Date Analyze	d: 2025/02/12
P.O.B	Sample Morphology	Asbestos	Other Fibres	Particulate
100	Homogeneous white drywall joint compound	Not Detected		Non-Fibrous
•	25834,Girl ANWL38 P.O.B	E5834,Girls Chngeroom Shower ANWL38 P.O.B Sample Morphology Homogeneous white	E5834, Girls Chngeroom Shower ANWL38 P.O.B Sample Morphology Asbestos Homogeneous white Not Detected	25834,Girls Chngeroom Shower ANWL38 Date Analyzed P.O.B Sample Morphology Homogeneous white Not Detected

The limit of quantitation is 0.50%, although asbestos may be qualitatively detected at concentrations less than 0.50%. Samples for which asbestos is detected at <0.50% are reported as trace, "<0.50%". "Not Detected" indicates that no asbestos fibres were observed.



Client Project #: 352293.002

Site Location: ON Sampler Initials: JC

GENERAL COMMENTS

Results relate only to the items tested.



Client Project #: 352293.002

Site Location: ON Sampler Initials: JC

VALIDATION SIGNATURE PAGE

The analytical data and all QC contained in this report were reviewed and validated by:

Dina Yousif, Analyst 2

Cillien es

Bureau Veritas has procedures in place to guard against improper use of the electronic signature and have the required "signatories", as per ISO/IEC 17025, signing the reports. For Service Group specific validation, please refer to the Validation Signatures page if included, otherwise available by request. For Department specific Analyst/Supervisor validation names, please refer to the Test Summary section if included, otherwise available by request. This report is authorized by Rodney Major, General Manager responsible for Ontario Environmental laboratory operations.

06-Feb-25 14:23 lora Di Bratto



FNV-777

Report Sent by:

Pinchin Ltd. - Asbestos Laboratory Internal Asbestos Bulk Sample Chain of Custody

Special In	structions:	9						3	
						(4)			
Client Name	:				Project Address:	ON			
Portfolio/Bu	ilding No:				Pinchin File:	352293.002			
Submitted b	y:	Adam Altena			Email:	aaltena@pin	chin.com		
CC Results	to:	Jessica Cozz	zitorto	HOLDER STREET	CC Email:	jcozzitorto@pinchin.com			
Date Submit	ted:	February	04	2025	Required by:	February	12	2025	
# of Sample:	s: —	24			Priority:	5 Da	y Turnarou	nd	
Year of Build	ding Constru	ction (<i>Manda</i>	tory, Years	ONLY):		E. THESE	YM EST		
Do NOT Sto	p on Positive	(Sample Nu	mbers):	0			- 710		
Pinchin Gro	up Company	(Mandatory	Field):			Pinchin			
HMIS2 Build	ing Reference	e #:	1, 1977	145601/20251315333350					
To be Comp	leted by Lab	Personnel O	nly:			COMPANY OF THE PERSON NAMED IN			
Lab Reference #:			Time:	24	hour clock				
Received by	Received by: SZUZ 9 0 834			Date:	Month	Day	Year		
Name(s) of	Analyst(s):	Live State Live							
Sample Prefix	Sample No.	Sample Suffix		Samp	le Description/Lo	cation (Man	datory)		
S	0049	А			Tile And Mastic,12x12 Changeroom	2 Beige W/ Bro	own		
S	0049	В			Tile And Mastic,12x1: Changeroom	2 Beige W/ Bro	own		
S	0049	С			Tile And Mastic,12x12 Changeroom Washr		own		
S	0050	A	Piping,All,F	Parging Ce	ement,Loc:5833,Girls	Changeroom			
S	0050	В	Piping,All,F	Parging Ce	ement,Loc:5833,Girls	Changeroom			
S	0050	С	Piping,All,F	Parging Ce	ement,Loc:5833,Girls	Changeroom		11	

Sample Prefix	Sample No.	Sample Suffix	Sample Description/Location (Mandatory)
S	0051	А	Floor,Thin-set,Loc:5834,Girls Chngeroom Shower
S	0051	В	Floor,Thin-set,Loc:5834,Girls Chngeroom Shower
s	0051	С	Floor, Thin-set, Loc: 5834, Girls Chngeroom Shower
s	0052	А	Wall,Paint,Pale Yellow,Loc:5833,Girls Changeroom
s	0052	В	Wall,Paint,Pale Yellow,Loc:5833,Girls Changeroom
s	0052	С	Wall,Paint,Pale Yellow,Loc:5833,Girls Changeroom
s	0053	- А	Wall, Door, Caulking, Beige Caulking, Loc: 5833, Girls Changeroom
S	0053	В	Wall, Door, Caulking, Beige Caulking, Loc: 5833, Girls Changeroom
S	0053	С	Wall, Door, Caulking, Beige Caulking, Loc: 5836, Vestibule
S	0054	А	Wall, Base, Mastic, Brown, Baseboard Mastic, Loc: 5833, Girls Changeroom
s	0054	В	Wall, Base, Mastic, Brown, Baseboard Mastic, Loc: 5833, Girls Changeroom
S	0054	С	Wall, Base, Mastic, Brown, Baseboard Mastic, Loc: 5833, Girls Changeroom
S	0055	А	Wall, Firestopping (cementitious), Loc: 5833, Girls Changeroom
S	0055	В	Wall, Firestopping (cementitious), Loc: 5833, Girls Changeroom
s	0055	С	Wall, Firestopping (cementitious), Loc: 5833, Girls Changeroom

Page 2 of 3

Sample Prefix	Sample No.	Sample Suffix	Sample Description/Location (Mandatory)
S	0056	А	Ceiling, Drywall And Joint Compound, Loc: 5834, Girls Chngeroom Shower
S	0056	В	Ceiling, Drywall And Joint Compound, Loc: 5834, Girls Chngeroom Shower
S	0056	С	Ceiling, Drywall And Joint Compound, Loc: 5834, Girls Chngeroom Shower

APPENDIX II-B Lead Analytical Certificates



Your Project #: 352293.002

Your C.O.C. #: N/A

Attention: Jessica Cozzitorto

Pinchin Ltd 151 York Boulevard Suite 200 Hamilton, ON CANADA L8R 3M2

Report Date: 2025/02/12

Report #: R8486528 Version: 1 - Final

CERTIFICATE OF ANALYSIS

BUREAU VERITAS JOB #: C513406 Received: 2025/02/06, 14:23

Sample Matrix: Paint # Samples Received: 3

	Date	Date		
Analyses	Quantity Extracted	Analyzed	Laboratory Method	Analytical Method
Metals in Paint	3 2025/02/1	2 2025/02/1	2 CAM SOP-00408	EPA 6010D m

Remarks:

Bureau Veritas is accredited to ISO/IEC 17025 for specific parameters on scopes of accreditation. Unless otherwise noted, procedures used by Bureau Veritas are based upon recognized Provincial, Federal or US method compendia such as CCME, EPA, APHA or the Quebec Ministry of Environment.

All work recorded herein has been done in accordance with procedures and practices ordinarily exercised by professionals in Bureau Veritas' profession using accepted testing methodologies, quality assurance and quality control procedures (except where otherwise agreed by the client and Bureau Veritas in writing). All data is in statistical control and has met quality control and method performance criteria unless otherwise noted. All method blanks are reported; unless indicated otherwise, associated sample data are not blank corrected. Where applicable, unless otherwise noted, Measurement Uncertainty has not been accounted for when stating conformity to the referenced standard.

Bureau Veritas liability is limited to the actual cost of the requested analyses, unless otherwise agreed in writing. There is no other warranty expressed or implied. Bureau Veritas has been retained to provide analysis of samples provided by the Client using the testing methodology referenced in this report. Interpretation and use of test results are the sole responsibility of the Client and are not within the scope of services provided by Bureau Veritas, unless otherwise agreed in writing. Bureau Veritas is not responsible for the accuracy or any data impacts, that result from the information provided by the customer or their agent.

Solid sample results, except biota, are based on dry weight unless otherwise indicated. Organic analyses are not recovery corrected except for isotope dilution methods.

Results relate to samples tested. When sampling is not conducted by Bureau Veritas, results relate to the supplied samples tested.

This Certificate shall not be reproduced except in full, without the written approval of the laboratory.

Reference Method suffix "m" indicates test methods incorporate validated modifications from specific reference methods to improve performance.

* RPDs calculated using raw data. The rounding of final results may result in the apparent difference.



Your Project #: 352293.002

Your C.O.C. #: N/A

Attention: Jessica Cozzitorto

Pinchin Ltd 151 York Boulevard Suite 200 Hamilton, ON CANADA L8R 3M2

Report Date: 2025/02/12

Report #: R8486528 Version: 1 - Final

CERTIFICATE OF ANALYSIS

BUREAU VERITAS JOB #: C513406 Received: 2025/02/06, 14:23

Encryption Key

Please direct all questions regarding this Certificate of Analysis to: Nilushi Mahathantila, Project Manager Email: Nilushi.Mahathantila@bureauveritas.com Phone# (905) 817-5700

This report has been generated and distributed using a secure automated process.

Bureau Veritas has procedures in place to guard against improper use of the electronic signature and have the required "signatories", as per ISO/IEC 17025, signing the reports. For Service Group specific validation, please refer to the Validation Signatures page if included, otherwise available by request. For Department specific Analyst/Supervisor validation names, please refer to the Test Summary section if included, otherwise available by request. This report is authorized by Rodney Major, General Manager responsible for Ontario Environmental laboratory operations.



Report Date: 2025/02/12

Pinchin Ltd

Client Project #: 352293.002

0.0015 9874309

Sampler Initials: AA

0.00053

0.0033

ELEMENTS BY ATOMIC SPECTROSCOPY (PAINT)

Bureau Veritas ID Sampling Date		ANWK27 2025/02/03 17:30		ANWK28 2025/02/03 17:30		ANWK29 2025/02/03 17:30		
COC Number		N/A		N/A		N/A		
	UNITS	L0012, WALL, CONCRETE (POURED), PALE YELLOW ON BLOCK,LOC:5833	RDL	L0013, STRUCTURE, METAL, RED ON JOISTS AND BEAMS,LOC:5833,	RDL	L0014, OTHER, METAL, GREEN ON DOOR FRAME,LOC:5833, GIRLS	RDL	QC Batch
Metals								

0.063

0.00023

< 0.00023

RDL = Reportable Detection Limit

Lead (Pb)

QC Batch = Quality Control Batch



Client Project #: 352293.002

Sampler Initials: AA

GENERAL COMMENTS

Sample ANWK27 [L0012, WALL, CONCRETE (POURED), PALE YELLOW ON BLOCK,LOC:5833]: Metals Analysis: Due to limited amount of sample available for analysis, a smaller than usual portion of the sample was used. Detection limits were adjusted accordingly.

Sample ANWK28 [L0013, STRUCTURE, METAL, RED ON JOISTS AND BEAMS,LOC:5833,] : Metals Analysis: Due to limited amount of sample available for analysis, a smaller than usual portion of the sample was used. Detection limits were adjusted accordingly.

Sample ANWK29 [L0014, OTHER, METAL, GREEN ON DOOR FRAME,LOC:5833, GIRLS]: Metals Analysis: Due to limited amount of sample available for analysis, a smaller than usual portion of the sample was used. Detection limits were adjusted accordingly.

Results relate only to the items tested.



Bureau Veritas Job #: C513406 Report Date: 2025/02/12 Pinchin Ltd

Client Project #: 352293.002

Sampler Initials: AA

QUALITY ASSURANCE REPORT

QA/QC								
Batch	Init	QC Type	Parameter	Date Analyzed	Value	Recovery	UNITS	QC Limits
9874309	JOH	Matrix Spike	Lead (Pb)	2025/02/12		NC	%	75 - 125
9874309	JOH	QC Standard	Lead (Pb)	2025/02/12		105	%	75 - 125
9874309	JOH	Method Blank	Lead (Pb)	2025/02/12	<0.00010		%	
9874309	JOH	RPD	Lead (Pb)	2025/02/12	6.3		%	35

Duplicate: Paired analysis of a separate portion of the same sample. Used to evaluate the variance in the measurement.

Matrix Spike: A sample to which a known amount of the analyte of interest has been added. Used to evaluate sample matrix interference.

QC Standard: A sample of known concentration prepared by an external agency under stringent conditions. Used as an independent check of method accuracy.

Method Blank: A blank matrix containing all reagents used in the analytical procedure. Used to identify laboratory contamination.

NC (Matrix Spike): The recovery in the matrix spike was not calculated. The relative difference between the concentration in the parent sample and the spike amount was too small to permit a reliable recovery calculation (matrix spike concentration was less than the native sample concentration)



Client Project #: 352293.002

Sampler Initials: AA

VALIDATION SIGNATURE PAGE

The analytical data and all QC contained in this report were reviewed and validated by:

Louise Harding, Scientific Specialist

Bureau Veritas has procedures in place to guard against improper use of the electronic signature and have the required "signatories", as per ISO/IEC 17025, signing the reports. For Service Group specific validation, please refer to the Validation Signatures page if included, otherwise available by request. For Department specific Analyst/Supervisor validation names, please refer to the Test Summary section if included, otherwise available by request. This report is authorized by Rodney Major, General Manager responsible for Ontario Environmental laboratory operations.



6740 Campobello Road, Mississauga, Ontario L5N 2L8

Phone: 905-817-5700 Fax: 905-817-5779 Toll Free: 800-563-6266 CAM FCD-01191/6

CHAIN OF CUSTODY RECORD

Invoice Information		Report Information (if differs from invoice)					Project Information (where applicable)						Turnaround Time (TAT) Required				
Company Name: Pinchin Ltd.	Compa	Company Name:							Quotation #:					X Regular TAT (5-7 days) Most analyses			
Contact Name: Adam Altena Jessica Cozzitort	o Contac	Contact Name:								P.O. #/ AFE#:					PLEASE PROVIDE ADVANCE NOTICE FOR RUSH PROJECTS		
Address:	Addres	Address:					Project #				3522	293.002	2	Rush TAT (Surcharges will be applied)			
									Site Loca	ition:					lije S	1 Day 2 Days 3-4 Days	
Phone: Fax:	Phone:			Fax:				Site #:									
Email: aaltena@pinchin.com jcozzitorto@pinch	in.com Email:	Email:						Site Location Province:ON					Date Required: Feb 12 2025				
MOE REGULATED DRINKING WATER OR WATER INTENDED	FOR HUMAN CONSUMPTION OF CUSTODY	MUST BE SUBMITTED	D ON THE BUI	REAU VE	RITAS D	RINKING	WATER	CHAIN	Sampled	Ву:	Adar	n Altena				Rush Confirmation #:	
Regulation 153	THE RESERVE THE PARTY OF THE PA	Regulations							Analysis	Reque	sted					LABORATORY USE ONLY	
Table 1 Res/Park Med/Fine Table 2 Ind/Comm Coarse Table 3 Agri/ Other Table FOR RSC (PLEASE CIRCLE) Y / N Include Criteria on Certificate of Analysis: Y SAMPLES MUST BE KEPT COOL (< 10 °C) FROM TIM	MISA PWQO Other (Specify) REG 558 (MIN. 3 II REG 406 Table	LIVERY TO BUREA	aw D)	# OF CONTAINERS SUBMITTED	ivierals /	PHCs F2 - F4	VOCs	REG 153 ICPMS METALS	REG 153 METALS (Hg, Cr VI, ICPMS Metals, HWS - B)	Lead (Pb) in Paints	PCBs				HOLD- DO NOT ANALYZE	COOLING MEDIA PRESENT: Y / N COOMMENTS COST TEMPERATURES COOLING TEMPERATURES	
L0012, Wall, Concrete (poured), Pale Yellow On Block	,Loc:58 2025-02-03	17:30 BUL	_K							x							
L0013, Structure, Metal, Red On Joists And Beams, Loc	::5833, 2025-02-03	17:30 BUL	_K							х							
L0014, Other, Metal, Greenon Door Frame,Loc:5833,0	Girls Ch 2025-02-03	17:30 BUL	_K							x							
RELINQUISHED BY: (Signature/Print)	DATE: (YYYY/MM/DD)	TIME: (HH:MM)	RECEIVED BY:	(Signatu	re/Print)				DATE:	(YYYY/MM/	DD)	TIME: (I	IH:MM)		BV JOB #	
Adam Altena	2025-02-04				no	75	R	21	_	ι	OW	7 U	46	/ ነ′	3		

Unless otherwise agreed to in writing, work submitted on this Chain of Custody is subject to Bureau Veritas' standard Terms and Conditions. Signing of this Chain acceptance of our terms available at https://www.bvna.com/coc-terms-and-conditions



NONT-2025-02-951



Your Project #: 352293.002

Your C.O.C. #: N/A

Attention: Adam Altena

Pinchin Ltd 151 York Boulevard Suite 200 Hamilton, ON CANADA L8R 3M2

Report Date: 2025/02/20

Report #: R8490550 Version: 1 - Final

CERTIFICATE OF ANALYSIS

BUREAU VERITAS JOB #: C516160 Received: 2025/02/13, 14:27

Sample Matrix: Bulk # Samples Received: 2

	Date	Date			
Analyses	Quantity Extracted	Analyzed	Laboratory Method	Analytical Method	
Metals in Paint	2 2025/02/1	9 2025/02/1	9 CAM SOP-00408	EPA 6010D m	

Remarks:

Bureau Veritas is accredited to ISO/IEC 17025 for specific parameters on scopes of accreditation. Unless otherwise noted, procedures used by Bureau Veritas are based upon recognized Provincial, Federal or US method compendia such as CCME, EPA, APHA or the Quebec Ministry of Environment.

All work recorded herein has been done in accordance with procedures and practices ordinarily exercised by professionals in Bureau Veritas' profession using accepted testing methodologies, quality assurance and quality control procedures (except where otherwise agreed by the client and Bureau Veritas in writing). All data is in statistical control and has met quality control and method performance criteria unless otherwise noted. All method blanks are reported; unless indicated otherwise, associated sample data are not blank corrected. Where applicable, unless otherwise noted, Measurement Uncertainty has not been accounted for when stating conformity to the referenced standard.

Bureau Veritas liability is limited to the actual cost of the requested analyses, unless otherwise agreed in writing. There is no other warranty expressed or implied. Bureau Veritas has been retained to provide analysis of samples provided by the Client using the testing methodology referenced in this report. Interpretation and use of test results are the sole responsibility of the Client and are not within the scope of services provided by Bureau Veritas, unless otherwise agreed in writing. Bureau Veritas is not responsible for the accuracy or any data impacts, that result from the information provided by the customer or their agent.

Solid sample results, except biota, are based on dry weight unless otherwise indicated. Organic analyses are not recovery corrected except for isotope dilution methods.

Results relate to samples tested. When sampling is not conducted by Bureau Veritas, results relate to the supplied samples tested.

This Certificate shall not be reproduced except in full, without the written approval of the laboratory.

Reference Method suffix "m" indicates test methods incorporate validated modifications from specific reference methods to improve performance.

* RPDs calculated using raw data. The rounding of final results may result in the apparent difference.



Your Project #: 352293.002

Your C.O.C. #: N/A

Attention: Adam Altena

Pinchin Ltd 151 York Boulevard Suite 200 Hamilton, ON CANADA L8R 3M2

Report Date: 2025/02/20

Report #: R8490550 Version: 1 - Final

CERTIFICATE OF ANALYSIS

BUREAU VERITAS JOB #: C516160 Received: 2025/02/13, 14:27

Encryption Key

Please direct all questions regarding this Certificate of Analysis to: Nilushi Mahathantila, Project Manager Email: Nilushi.Mahathantila@bureauveritas.com Phone# (905) 817-5700

This report has been generated and distributed using a secure automated process.

Bureau Veritas has procedures in place to guard against improper use of the electronic signature and have the required "signatories", as per ISO/IEC 17025, signing the reports. For Service Group specific validation, please refer to the Validation Signatures page if included, otherwise available by request. For Department specific Analyst/Supervisor validation names, please refer to the Test Summary section if included, otherwise available by request. This report is authorized by Rodney Major, General Manager responsible for Ontario Environmental laboratory operations.



Client Project #: 352293.002

Sampler Initials: AA

ELEMENTS BY ATOMIC SPECTROSCOPY (BULK)

Bureau Veritas ID		AOBI68		AOBI69		
Sampling Date		2025/02/11 16:30		2025/02/11 16:30		
COC Number		N/A		N/A		
	UNITS	L0015,WALL,CONCRET E (PRECAST), YELLOW ON BLOCK, LOC:5841, BO	RDL	L0016,OTHER, METAL, GREY ON DOOR FRAME, LOC:5841, BOYS CHA	RDL	QC Batch

 Metals

 Lead (Pb)
 %
 <0.00052</td>
 0.00052
 0.010
 0.00071
 9877378

RDL = Reportable Detection Limit

QC Batch = Quality Control Batch



Client Project #: 352293.002

Sampler Initials: AA

GENERAL COMMENTS

Sample AOBI68 [L0015,WALL,CONCRETE (PRECAST), YELLOW ON BLOCK, LOC:5841, BO] : Metals Analysis: Due to limited amount of sample available for analysis, a smaller than usual portion of the sample was used. Detection limits were adjusted accordingly.

Sample AOBI69 [L0016,OTHER, METAL, GREY ON DOOR FRAME, LOC:5841, BOYS CHA] : Metals Analysis: Due to limited amount of sample available for analysis, a smaller than usual portion of the sample was used. Detection limits were adjusted accordingly.

Results relate only to the items tested.



Bureau Veritas Job #: C516160 Report Date: 2025/02/20 Pinchin Ltd

Client Project #: 352293.002

Sampler Initials: AA

QUALITY ASSURANCE REPORT

QA/QC								
Batch	Init	QC Type	Parameter	Date Analyzed	Value	Recovery	UNITS	QC Limits
9877378	MEN	Matrix Spike	Lead (Pb)	2025/02/19		99	%	75 - 125
9877378	MEN	QC Standard	Lead (Pb)	2025/02/19		102	%	75 - 125
9877378	MEN	Method Blank	Lead (Pb)	2025/02/19	<0.00010		%	
9877378	MEN	RPD	Lead (Pb)	2025/02/19	33		%	35

Duplicate: Paired analysis of a separate portion of the same sample. Used to evaluate the variance in the measurement.

Matrix Spike: A sample to which a known amount of the analyte of interest has been added. Used to evaluate sample matrix interference.

QC Standard: A sample of known concentration prepared by an external agency under stringent conditions. Used as an independent check of method accuracy.

Method Blank: A blank matrix containing all reagents used in the analytical procedure. Used to identify laboratory contamination.



Client Project #: 352293.002

Sampler Initials: AA

VALIDATION SIGNATURE PAGE

The analytical data and all QC contained in this report were reviewed and validated by:

Louis A Hardey Louise Harding, Scientific Specialist

Bureau Veritas has procedures in place to guard against improper use of the electronic signature and have the required "signatories", as per ISO/IEC 17025, signing the reports. For Service Group specific validation, please refer to the Validation Signatures page if included, otherwise available by request. For Department specific Analyst/Supervisor validation names, please refer to the Test Summary section if included, otherwise available by request. This report is authorized by Rodney Major, General Manager responsible for Ontario Environmental laboratory operations.



Adam Altena

6740 Campobello Road, Mississauga, Ontario L5N 2L8 Phone: 905-817-5700 Fax: 905-817-5779 Toll Free: 800-563-6266

CAM FCD-01191/6 CHAIN OF CUSTODY RECORD Report Information (if differs from invoice) Project Information (where applicable) Turnaround Time (TAT) Required Pinchin Ltd. Regular TAT (5-7 days) Most analyses Quotation #: PLEASE PROVIDE ADVANCE NOTICE FOR RUSH PROJECTS Adam Altena Jessica Cozzitorto P.O. #/ AFE#: Address: Rush TAT (Surcharges will be applied) Project #: Fax: Site #: Email: aaltena@pinchin.com jcozzitorto@pinchin.com Email: Date Required: February 19 2025 Site Location Province:_____ON LUMPTION MUST BE SUBMITTED ON THE BUREAU VERITAS DRINKING WATER CHAIN OF CUSTODY Rush Confirmation #: Regulation 153 Other Regulations Analysis Requested LABORATORY USE ONLY Sanitary Sewer Bylav Res/Park Med/ Fine Table 2 MISA COOLER TEMPERATURES Table 3 Agri/ Other PWQO Present Intact Table __ Other (Specify) FOR RSC (PLEASE CIRCLE) Y / N REG 558 (MIN. 3 DAY TAT REQUIRED) DO NOT ANALYZE SAMPLES MUST BE KEPT COOL (< 10 °C) FROM TIME OF SAMPLING UNTIL DELIVERY TO BUREAU VERITAS OOLING MEDIA PRESENT: SAMPLE IDENTIFICATION COMMENTS 16:30 BULK L0015, Wall, Concrete (precast), Yellow On Block, Loc: 5841, Bi 2025-02-11 .0016, Other, Metal, Grey On Door Frame,Loc:5841,Boys Cha 2025-02-11 16:30 BULK RELINQUISHED BY: (Signature/Print) TIME: (HH:MM) BV JOB #

Adam Altena 2025-02-12 13:30 Unless otherwise agreed to in writing, work submitted on this Chain of Custody is subject to Bureau Veritas' standard Terms and Conditions. Signing of this Chain of Custody document is acknowledgment and acceptance of our terms available at https://www.bvna.com/coc-terms-and-conditions



NONT-2025-02-2430



Your Project #: 352293.002

Your C.O.C. #: N/A

Attention: Jessica Cozzitorto

Pinchin Ltd 151 York Boulevard Suite 200 Hamilton, ON CANADA L8R 3M2

Report Date: 2025/02/26

Report #: R8493739 Version: 1 - Final

CERTIFICATE OF ANALYSIS

BUREAU VERITAS JOB #: C520076 Received: 2025/02/26, 09:08

Sample Matrix: Solid # Samples Received: 1

	Date	Date		
Analyses	Quantity Extracted	Analyzed	Laboratory Method	Analytical Method
Metals in Paint	1 2025/02/2	6 2025/02/2	6 CAM SOP-00408	EPA 6010D m

Remarks:

Bureau Veritas is accredited to ISO/IEC 17025 for specific parameters on scopes of accreditation. Unless otherwise noted, procedures used by Bureau Veritas are based upon recognized Provincial, Federal or US method compendia such as CCME, EPA, APHA or the Quebec Ministry of Environment.

All work recorded herein has been done in accordance with procedures and practices ordinarily exercised by professionals in Bureau Veritas' profession using accepted testing methodologies, quality assurance and quality control procedures (except where otherwise agreed by the client and Bureau Veritas in writing). All data is in statistical control and has met quality control and method performance criteria unless otherwise noted. All method blanks are reported; unless indicated otherwise, associated sample data are not blank corrected. Where applicable, unless otherwise noted, Measurement Uncertainty has not been accounted for when stating conformity to the referenced standard.

Bureau Veritas liability is limited to the actual cost of the requested analyses, unless otherwise agreed in writing. There is no other warranty expressed or implied. Bureau Veritas has been retained to provide analysis of samples provided by the Client using the testing methodology referenced in this report. Interpretation and use of test results are the sole responsibility of the Client and are not within the scope of services provided by Bureau Veritas, unless otherwise agreed in writing. Bureau Veritas is not responsible for the accuracy or any data impacts, that result from the information provided by the customer or their agent.

Solid sample results, except biota, are based on dry weight unless otherwise indicated. Organic analyses are not recovery corrected except for isotope dilution methods.

Results relate to samples tested. When sampling is not conducted by Bureau Veritas, results relate to the supplied samples tested.

This Certificate shall not be reproduced except in full, without the written approval of the laboratory.

Reference Method suffix "m" indicates test methods incorporate validated modifications from specific reference methods to improve performance.

* RPDs calculated using raw data. The rounding of final results may result in the apparent difference.



Your Project #: 352293.002

Your C.O.C. #: N/A

Attention: Jessica Cozzitorto

Pinchin Ltd 151 York Boulevard Suite 200 Hamilton, ON CANADA L8R 3M2

Report Date: 2025/02/26

Report #: R8493739 Version: 1 - Final

CERTIFICATE OF ANALYSIS

BUREAU VERITAS JOB #: C520076 Received: 2025/02/26, 09:08

Encryption Key

Please direct all questions regarding this Certificate of Analysis to: Nilushi Mahathantila, Project Manager Email: Nilushi.Mahathantila@bureauveritas.com Phone# (905) 817-5700

This report has been generated and distributed using a secure automated process.

Bureau Veritas has procedures in place to guard against improper use of the electronic signature and have the required "signatories", as per ISO/IEC 17025, signing the reports. For Service Group specific validation, please refer to the Validation Signatures page if included, otherwise available by request. For Department specific Analyst/Supervisor validation names, please refer to the Test Summary section if included, otherwise available by request. This report is authorized by Rodney Major, General Manager responsible for Ontario Environmental laboratory operations.



Pinchin Ltd

Client Project #: 352293.002

Sampler Initials: AA

ELEMENTS BY ATOMIC SPECTROSCOPY (SOLID)

Bureau Veritas ID		AOJD63				
Sampling Date		2025/02/24 17:00				
COC Number		N/A				
	UNITS	L0017, DUCT, PAINT, BROWN PAINT ON EXTERIOR DUCT VENT, LOC:5	RDL	QC Batch		
Metals						
Lead (Pb)	%	0.0088	0.0019	9881443		
RDL = Reportable Detection Limit QC Batch = Quality Control Batch						



Pinchin Ltd

Client Project #: 352293.002

Sampler Initials: AA

GENERAL COMMENTS

Sample AOJD63 [L0017, DUCT, PAINT, BROWN PAINT ON EXTERIOR DUCT VENT, LOC:5]: Metals Analysis: Due to limited amount of sample available for analysis, a smaller than usual portion of the sample was used. Detection limits were adjusted accordingly.

Results relate only to the items tested.



Bureau Veritas Job #: C520076 Report Date: 2025/02/26 Pinchin Ltd

Client Project #: 352293.002

Sampler Initials: AA

QUALITY ASSURANCE REPORT

QA/QC								
Batch	Init	QC Type	Parameter	Date Analyzed	Value	Recovery	UNITS	QC Limits
9881443	GR1	Matrix Spike	Lead (Pb)	2025/02/26		91	%	75 - 125
9881443	GR1	QC Standard	Lead (Pb)	2025/02/26		101	%	75 - 125
9881443	GR1	Method Blank	Lead (Pb)	2025/02/26	<0.00010		%	
9881443	GR1	RPD	Lead (Pb)	2025/02/26	4.1		%	35

Duplicate: Paired analysis of a separate portion of the same sample. Used to evaluate the variance in the measurement.

Matrix Spike: A sample to which a known amount of the analyte of interest has been added. Used to evaluate sample matrix interference.

QC Standard: A sample of known concentration prepared by an external agency under stringent conditions. Used as an independent check of method accuracy.

Method Blank: A blank matrix containing all reagents used in the analytical procedure. Used to identify laboratory contamination.



Pinchin Ltd

Client Project #: 352293.002

Sampler Initials: AA

VALIDATION SIGNATURE PAGE

The analytical data and all QC contained in this report were reviewed and validated by:

Louise Harding, Scientific Specialist

Bureau Veritas has procedures in place to guard against improper use of the electronic signature and have the required "signatories", as per ISO/IEC 17025, signing the reports. For Service Group specific validation, please refer to the Validation Signatures page if included, otherwise available by request. For Department specific Analyst/Supervisor validation names, please refer to the Test Summary section if included, otherwise available by request. This report is authorized by Rodney Major, General Manager responsible for Ontario Environmental laboratory operations.





NONT-2025-02-4276

BUREAU VERITAS	CAM	FCD-01191/6		, , , , , , , , , , , , , , , , , , , ,	300.31		156m	4.00					νT	ODY	REC	ORD			Page	1 of:	L
-12	Invoice Information		Repo	rt Information (f differs	from in	voice)				Proje	ect Infor	nation (where a	plicabl	e)		Turnaround Time (TAT) Required		d	
Company Name:	Pinchin Ltd.		Company Name:					Quotati	tion#:				Regular TAT (5-7 days) Most analyses		ses						
Contact Name:	Adam Altena Jessica Cozzitorto	TOTAL CONTRACTOR OF THE PARTY O	Contact Name:							P.O. #/ AFE#:					PLEASE PROVIDE ADVANCE NOTICE FOR RUSH PROJECTS						
Address:			Address:							Project Site Loc					352293.	002	x			es will be appl	
Phone:	Fax:		Phone:		Fa	ix:				Site #:	cation:					J'	" Ш ""·	,3			
Email: aaltena@	pinchin.com jcozzitorto@pinchin.co	om I	Email:							Site Loc	ation F	Province:		ON			Date Re	quired: Feb	27 2025		
MOE REGULATED DE	RINKING WATER OR WATER INTENDED FO		MPTION MUST BE SUB USTODY	MITTED ON THE BI	IREAU VEI	RITAS DR	INKING	WATER	CHAIN	Sampled	By:	A	lam Alte	na			Rush Confirmation #:				
	Regulation 153		Other Regulations	it						Analysi	s Requ	ested						LABORATORY USE ONLY			
Table 3	Res/Park Med/ Fine Ind/Comm Coarse Agri/ Other ASE CIRCLE) Y / N	The same of the sa	Sanitary Se Storm Sewin Region cify) AIN. 3 DAY TAT REQ Table	r Bylaw JIRED)	MITTED Marale / Ha / Crivi	200		& INORGANICS	S	3 METALS VI, ICPMS Metals, HWS - B)						ZE	AND REPORT OF THE PROPERTY.	STODY SEAL Y / N It Intact		OLER TEMPER	ATURES
	Certificate of Analysis: Y /			Vicinity in	ERS SUB	diam'r.		LS & INC	METALS	LS 15 Meta	nts					ANALYZE					
	E KEPT COOL (< 10 °C) FROM TIME (DE SAMPLING UI DATE SAM (YYYY/MM	MPLED TIME	JREAU VERITAS MATRIX	# OF CONTAINE	BTEX/ PHC F1	PHCs.F2 - F4	VOCs REG 153 METALS	REG 153 ICPMS	REG 153 METALS (Hg, Cr VI, ICPMS	Lead (Pb) in Paints	PCBs				HOLD- DO NOT	COOLING	MEDIA PRESI	ENT: COMMI	y / (N)	
L0017, Duct, Paint,	Brown Paint On Exterior Duct Vent,L	oc:5, 2025-	02-24 17:00	BULK							x										
RELINQUISHED BY: (Sig	ignature/Print)	DATE: (YYYY/MM/	DD) TIME: (HH:M	и) RECEIVED B	/; (Signatu	re/Print)		li .	22		DATE	: (YYYY/N	M/DD)	TIN	1E: (HH:N	им)	BV JOB#	B 101			
Adam Altena	×	2025-	02-25 1:	2:30	_	~	n	12	a	1	U) US	ov	126	ی	اس ا	8				

Unless otherwise agreed to in writing, work submitted on this Chain of Custody is subject to Bureau Veritas' standard Terms and Conditions. Signing of this Chain of Custody document is acknowledgment and acceptance of our terms available at https://www.bvna.com/coc-terms-and-conditions

APPENDIX III
Methodology

1.0 GENERAL

An investigation was conducted to identify the type of Hazardous Building Materials incorporated in the structure and its finishes.

Pinchin File: 352293.002

Information regarding the location and condition of hazardous building materials encountered and visually estimated quantities were recorded. The locations of any samples collected were recorded on small-scale plans. As-built drawings and previous reports were referenced where provided.

Sample collection was conducted in accordance with our Standard Operating Procedures.

1.1 Asbestos

The investigation for asbestos included friable and non-friable asbestos-containing materials (ACM). A friable material is a material that when dry can be crumbled, pulverized or powdered by hand pressure, or a material that has already become crushed, pulverized, or powdered.

A separate set of samples was collected of each type of homogenous material suspected to contain asbestos. A homogenous material is defined by the US EPA as material that is uniform in texture and appearance, was installed at one time, and is unlikely to consist of more than one type or formulation of material. The homogeneous materials were determined by visual examination and available information on the phases of construction and prior renovations.

Samples were collected at a rate that is in compliance with the requirements of local regulations and guidelines. The sampling strategy was also based on known ban dates and phase out dates of the use of asbestos; sampling of certain building materials is not conducted after specific construction dates. In addition, to be conservative, several years past these dates are added to account for some uncertainty in the exact start / finish date of construction and associated usage of ACM. In some cases, manufactured products such as asbestos cement pipe were visually identified without sample confirmation.

The asbestos analysis of select materials was completed using a stop-positive approach. Only one result meeting the regulated criteria was required to determine that a material is asbestos-containing, but all samples must be analyzed to conclusively determine that a material is non-asbestos. The laboratory stopped analyzing samples from a homogeneous material once a result equal to or greater than the regulated criteria is detected in any of the samples of that material. All samples of a homogeneous material were analyzed if no asbestos is detected. In some cases, all samples were analyzed in the sample set regardless of result.

The analysis was performed in accordance with Test Method EPA/600/R-93/116: Method for the Determination of Asbestos in Bulk Building Materials, July 1993.

© 2025 Pinchin Ltd. Page 1 of 4

Pinchin File: 352293.002

Analytical results were compared to the following criteria:

Jurisdiction*	Friable	Non-Friable
BC	0.5%1	0.5%
Alberta	Any Amount ²	Any Amount ²
Saskatchewan	>0.5%1	>1%
Manitoba	0.1%1	1%
Ontario	0.5%	0.5%
Nova Scotia	0.5%1	0.5%
New Brunswick	1%	1%
Prince Edward Island	1%	1%
Newfoundland and Labrador	1%	1%
Yukon	1%	1%
Nunavut	1%	1%
Northwest Territories	1%	1%
Federal	1%	1%

^{*} If there is a conflict between federal and provincial criteria, the more stringent will apply.

Where building materials are described in the report as "non-asbestos" or "does not contain asbestos", this means that either no asbestos was detected by the analytical method utilized in any of the multiple samples or, if detected, it is below the lower limit of an asbestos-containing material in the applicable regulation. Additionally, these terms are used for materials which historically are known to not include asbestos in their manufacturing.

Asbestos materials were evaluated in order to make recommendations regarding any remedial work. The priority for remedial action was based on several factors:

- Friability (friable or non-friable)
- Condition (good, fair, poor, debris)
- Accessibility (ranking from accessible to all building users to inaccessible)
- Visibility (whether the material is obscured by other building components)
- Efficiency of the work (for example, if damaged ACM is being removed in an area, it may be most practical to remove all ACM in the area even if it is in good condition)

© 2025 Pinchin Ltd. Page 2 of 4

¹ Or any amount if vermiculite

² The Government of Alberta in their guideline document entitled the "Alberta Asbestos Abatement Manual" (August 2019), defines an Asbestos-Containing Material as a product or building material that contains asbestos in any quantity or percentage.

1.2 Lead

Samples of distinctive paint finishes, and surface coatings present in more than a limited application, where removal of the paint is possible were collected. The samples were collected by scraping the painted finish to include base and covering applications.

Pinchin File: 352293.002

Analysis for lead in paints or surface coatings was performed by an accredited laboratory.

Analytical results were compared to the following criteria.

Jurisdiction*	Units (%)	Units (ppm) / (mg/kg)
British Columbia**	0.009	90
Alberta	0.009	90
Saskatchewan	0.009	90
Manitoba	0.009	90
Ontario	0.009	90
Nova Scotia	0.009	90
New Brunswick	0.009	90
Prince Edward Island	0.009	90
Newfoundland	0.009	90
Yukon	0.009	90
Nunavut	0.1	1,000
Northwest Territories	0.1	1,000
Federal	0.009	90

^{*} If there is a conflict between federal and provincial criteria, the more stringent will apply.

Other lead building products (e.g. batteries, lead sheeting, flashing) were identified by visual observation only.

1.3 Silica

Building materials known to contain crystalline silica (e.g. concrete, cement, tile, brick, masonry, mortar) were identified by visual inspection only. Pinchin did not perform sampling of these materials for laboratory analysis of crystalline silica content.

© 2025 Pinchin Ltd. Page 3 of 4

^{**} WorkSafe BC health and safety regulations do not numerically define what would be considered a lead-containing paint or coating. In general, paints containing lead >0.009% may require work procedures if disturbed.

1.4 Mercury

Building materials, products or equipment (e.g. thermostats, barometers, pressure gauges, lamp tubes), suspected to contain mercury were identified by visual inspection only. Dismantling of equipment suspected of containing mercury was not performed. Sampling of these materials for laboratory analysis of mercury content was not performed.

Pinchin File: 352293.002

1.5 Polychlorinated Biphenyls

The potential for light ballast and oil filled transformers to contain PCBs was based on the age of the building, a review of maintenance records, and examination of labels or nameplates on equipment, where present and accessible. The information was compared to known ban dates of PCBs and Environment Canada publications.

Dry type transformers were presumed to be free of dielectric fluids and hence non-PCB.

Fluids (mineral oil, hydraulic, Aroclor or Askarel) in transformers or other equipment were not sampled for PCB content.

1.6 Visible Mould

The presence of mould or water damage was determined by visual inspection of exposed building surfaces. If any mould growth or water damage was concealed within building cavities it was not addressed in this assessment.

Template: Methodology for Hazardous Building Materials Assessment, HAZ, November 13 2024

© 2025 Pinchin Ltd. Page 4 of 4

APPENDIX IV Location Summary Report



LOCATIONS LIST



Client:Hamilton-Wentworth District School Board Site: 157 Lake Ave, Hamilton, ON

Building Name: Lake Avenue School

Survey Date: 2025-02-24 **Building Phases: A: 1951**

Last Re-Assessment:

	363. A. 1931				
Location No.	Name or Description	Area ft ²	Floor No.	Bldg. Phase	Notes
5833	Girls Changeroom, room no. 136	480	1	Α	
5834	Girls Chngeroom Shower, room no. 136A	152	1	Α	
5835	Girls Changeroom Washroom, room no. 136B	100	1	Α	
5836	Vestibule, room no. 136C	80	1	Α	
5837	Office, room no. 137A	150	1	D	
5838	Kitchen, room no. 137B	200	1	Α	
5839	Storage, room no. 137C	200	1	D	
5840	Office, room no. 137D	150	1	D	
5841	Boys Changeroom	480		Α	
5842	Boys Changeroom Washroom	136		Α	
5843	Boys Shower	152		Α	
5844	Corridor, room no. 133	400	1	Α	
5845	Corridor, room no. 134	400	1	Α	
5847	1982 Exterior	0		Α	

APPENDIX V

Hazardous Materials Summary Report / Sample Log



HAZARDOUS MATERIALS SUMMARY / SAMPLE LOG



Survey Date: 2025-02-24

Client:Hamilton-Wentworth District School Board

Site: 157 Lake Ave, Hamilton, ON

Building Name: Lake Avenue School


HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Туре	Positive	Friability
Asbestos	V0031	Wall Paint Cream On Masonry Walls	5837,5838,5839,5840	A,D	0	0	0	100	None Detected	No	
Asbestos	S0044 ABC	Piping Parging Cement	5839	D	0	0	12	0	None Detected	No	
Asbestos	S0045 ABC	Floor Vinyl Floor Tile And Mastic 12x12 Beige With Brown Flecks	5837,5838,5839,5840	A,D	0	650	0	0	Chrysotile	Yes	NF
Asbestos	S0046 A	Wall Base Adhesive/mastic	5840	D	0	0	0	100	None Detected	No	
Asbestos	S0049 ABC	Floor All Vinyl Floor Tile And Mastic 12x12 Beige W/ Brown Fleck	5833,5835,5836,5841,5842,5844,5845	А	0	2076	0	0	Chrysotile	Yes	NF
Asbestos	S0050 ABC	Piping All Parging Cement	5833	Α	0	0	4	0	None Detected	No	
Asbestos	S0051 ABC	Floor Thin-set	5834,5843	Α	0	304	0	0	None Detected	No	
Asbestos	S0052 ABC	Wall Paint Pale Yellow	5833,5836,5841	Α	0	260	0	100	None Detected	No	
Asbestos	S0053 ABC	Wall Door Caulking Beige Caulking	5833,5836	Α	57	0	0	0	None Detected	No	
Asbestos	S0054 ABC	Wall Base Mastic, Brown Baseboard Mastic	5833,5836,5841	Α	14	0	0	100	None Detected	No	
Asbestos	S0055 ABC	Wall Firestopping (cementitious)	5833,5841,5842	Α	0	180	0	0	None Detected	No	
Asbestos	S0056 ABC	Ceiling All Drywall And Joint Compound	5834,5835,5843	Α	0	404	0	0	None Detected	No	
Asbestos	S0057 ABC	Ceiling Drywall And Joint Compound	5841,5842	Α	0	256	0	0	None Detected	No	
Asbestos	S0061 ABC	Wall Thin-set	5834,5843	Α	0	320	0	0	None Detected	No	
Asbestos	V9500	Piping Drain Cement Product	5839	D	15	0	0	0	Presumed Asbestos	Yes	NF
Asbestos	V0000	Ceiling All Ceiling Tiles (lay-in) 24x24 Textured With Pinhole	5844,5845	А	0	800	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling All Ceiling Tiles (lay-in) 24x48 Pinhole W/ Fleck	5833,5836,5841	А	0	1040	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tiles (lay-in) 24x48 Pinhole With Fleck (03/23/96)	5837,5840	D	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Ceiling Acoustic Tile Ceiling Tiles (lay-in) 24x48 Pinhole With Fleck (stamped 03/23/96)	5838	А	0	0	0	0	Non Asbestos	No	
Asbestos	V0000	Duct All Not Insulated	5833,5834,5841,5843,5844,5847	Α	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Mechanical Equipment Fan Unit Not Insulated	5841	Α	0	0	1	0	Non Asbestos	No	
Asbestos	V0000	Piping All Fibreglass	5833,5835,5836,5841,5842,5844,5845	Α	502	0	0	0	Non Asbestos	No	
Asbestos	V0000	Structure Concrete (poured)	5847	Α	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Wall Door Caulking Yellow Caulking	5841,5843	Α	120	0	0	0	Non Asbestos	No	
Asbestos	V0000	Wall All Concrete Block	5833,5834,5836,5841,5843,5844,5845	Α	0	0	0	100	Non Asbestos	No	
Asbestos	V0000	Wall All Masonry	5845	Α	0	0	0	100	Non Asbestos	No	
Paint	V0006	Wall Masonry White	5839	D	0	0	0	100		No	-
Paint	L0012	Wall Concrete (poured) Pale Yellow On Block	5833,5834,5835,5836,5837,5838,5840,5841,5842 5843	A,D	0	0	0	100		No	-
Paint	L0013	Structure Metal Red On Joists And Beams	5833,5834,5835,5836,5841,5842,5843,5844,5845	А	0	0	0	100	Lead (Low)	Yes	-



HAZARDOUS MATERIALS SUMMARY / SAMPLE LOG



HAZMAT	Sample No	System/Component/Material/Sample Description	Locations	Bldg. Phase	LF	SF	EA	%	Туре	Positive	Friability
Paint	L0014	Other Metal Greenon Door Frame	5833,5836	Α	0	0	0	100		No	-
Paint	L0015	Wall Concrete (precast) Yellow On Block	5841	Α	0	0	0	100		No	-
Paint	L0016	Other Metal Grey On Door Frame	5841	Α	0	0	0	100	Lead (Low)	Yes	-
Paint	L0017	Duct Paint Brown Paint On Exterior Duct Vent	5847	Α	0	20	0	0		No	-
Lead Product	V9000	Batteries In Emer. Lights	5833	А	0	0	1	0	Lead Product	Yes	-
РСВ	V0000	Light Ballasts	5833,5834,5835,5836,5841,5842,5843,5844,5845	Α	0	0	26	0	-	No	-
Hg	V9500	Light Fixture	5833,5834,5835,5836,5841,5842,5843,5844,5845	А	0	0	26	0	Presumed Hg	Yes	-

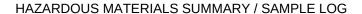





Legend:

Sample nu	ımber
S####	Asbestos sample collected
L####	Paint sample collected
P####	PCB sample collected
M####	Mould sample collected
V ####	Material visually similar to numbered sample collected
V0000	Known non Hazardous Material
V9000	Material is visually identified as Hazardous Material
V9500	Material is presumed to be Hazardous Material
[Loc. No.]	Abated Material
_	

Units	
SF	Square feet
LF	Linear feet
EA	Each
%	Percentage
	•

NF	Non Friable material.
F	Friable material
PF	Potentially Friable material

APPENDIX VI HMIS All Data Report





Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5833 : Girls Changeroom Floor: 1

Survey Date: 2025-02-24

Building Name: Lake Avenue School

Room #: 136

Area (sqft): 480

Last Re-Assessment: 0000-00-00

ou. roy but	. 2020 02 24								13303311101	0000 00	••					
							AS	BESTOS								
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	All	Ceiling Tiles (lay-in), 24x48 pinhole w/ fleck			С	Υ		480			SF	V0000	Non-Asbestos		None	
Duct	All	Not Insulated			D	N		100			%	V0000	Non-Asbestos		None	
Floor	All	Vinyl Floor Tile and Mastic, 12x12 beige w/ brown fleck			Α	Υ		480(7)			SF	S0049AB	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Mechanical Equipment	All	None Found														
Piping		Fibreglass	Straight		D	N		160			LF	V0000	Non-Asbestos		None	
Piping	All	Parging Cement	Elbow	Unjacketed	D	N		4			EA	S0050ABC	None Detected	N.D.	None	
Structure	Beam And Joist				С	N		480			SF	V0000	Non-Asbestos		None	
Wall ¹		Paint, Pale yellow			Α	Υ		33			%	S0052ABC	None Detected	N.D.	None	
Wall		Firestopping (Cementitious)			С	N		60			SF	S0055ABC	None Detected	N.D.	None	
Wall	All	Concrete Block			Α	Υ		100			%	V0000	Non-Asbestos		None	
Wall	Base	Mastic, Brown, Baseboard mastic			A	N		33			%	S0054ABC	None Detected	N.D.	None	
Wall	Door	Caulking, Beige caulking			Α	Υ		40			LF	S0053AB	None Detected	N.D.	None	

1 - On block

Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5833 : Girls Changeroom

Survey Date: 2025-02-24

Building Name: Lake Avenue School

Room #: 136

Area (sqft): 480

Last Re-Assessment: 0000-00-00

				PAINT				
System	Item	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard
Wall								No
Structure	Metal	100		%	L0013	Red on joists and beams	Pb: 0.063 %	Lead (Low)
Wall	Concrete (poured)	100		%	L0012	Pale yellow on block	Pb: <0.00023	No
Other ¹	Metal	100		%	L0014	Greenon door frame	Pb: .0033 %	No

1 - Door frame

Client: Hamilton-Wentworth District School Board

Location: #5833 : Girls Changeroom

Site: Schools

Site: Schools

Floor: 1

Floor: 1

Building Name: Lake Avenue School

Room #: 136

Area (sqft): 480

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

	PB PRODUCTS	PB PRODUCTS PB PRODUCTS											
Component	Quantity	Unit	Sample	Hazard									
Batteries In Emer. Lights	1	EA	V9000	Yes									

Client: Hamilton-Wentworth District School Board

Location: #5833 : Girls Changeroom Floor: 1 **Building Name: Lake Avenue School**

Room #: 136

Area (sqft): 480

Survey Date: 2025-02-24

Last Re-Assessment: 0000-00-00

	INERCOSICI	MEROORI									
Component	Quantity	Unit	Sample	Hazard							
Light Fixture	6	EA	V9500	Presumed							

MERCLIRY





Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5833 : Girls Changeroom Floor: 1 Room #: 136 Area (sqft): 480

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

	PCB												
Component	Good	Poor	Unit	Sample	Sample Description	Amount	PCB						
Light Ballasts	6			V0000			No						

Building Name: Lake Avenue School



Survey Date: 2025-02-24

Survey Date: 2025-02-24

Survey Date: 2025-02-24

ALL DATA REPORT



Client: Hamilton-Wentworth District School Board

Location: #5834 : Girls Chngeroom Shower

Site: Schools Floor: 1

Building Name: Lake Avenue School

Room #: 136A

Area (sqft): 152

Last Re-Assessment: 0000-00-00

•																
							AS	BESTOS								
System	Component	Material	Item	Covering	Α*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			С	Υ		152			SF	S0056ABC	None Detected	N.D.	None	
Duct	All	Not Insulated										V0000	Non-Asbestos		None	
Floor		Thin-set		Ceramic Tiles	С	N		152			SF	S0051ABC	None Detected	N.D.	None	
Mechanical Equipment	All	None Found														
Piping	All	Fibreglass			С	N		100			%					
Structure	Beam And Joist				С	N		152			SF					
Wall		Thin-set			Α	Υ		160			SF	V0061	None Detected	N.D.	None	
\/\/all	ΔII	Concrete Block			Λ	V		100			0/6	\/0000	Non-Achaetae		Mone	

Client: Hamilton-Wentworth District School Board

Location: #5834 : Girls Chngeroom Shower

Floor: 1

Site: Schools

Building Name: Lake Avenue School

Room #: 136A

Area (sqft): 152

Last Re-Assessment: 0000-00-00

				PAINT				
System	Item	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard
Wall	Concrete (poured)				V0012	Pale yellow on block	Pb: <0.00023	No
Structure	Metal	100		%	V0013	Red on joists and beams	Pb: 0.063 %	Lead (Low)
Wall	Concrete (poured)	100		%	V0012	Pale yellow on block	Pb: <0.00023	No

Client: Hamilton-Wentworth District School Board

Location: #5834 : Girls Chngeroom Shower

Floor: 1

Site: Schools

Building Name: Lake Avenue School

Room #: 136A

Area (sqft): 152

Last Re-Assessment: 0000-00-00

	MERCURY												
Component	Quantity	Unit	Sample	Hazard									
Light Fixture	2	EA	V9500	Presumed									

Client: Hamilton-Wentworth District School Board

Location: #5834 : Girls Chngeroom Shower

Site: Schools

Floor: 1

Building Name: Lake Avenue School

Room #: 136A

Area (sqft): 152

Survey Date: 2025-02-24

	PCB												
Component	Good	Poor	Unit	Sample	Sample Description	Amount	PCB						
Light Ballasts	2		EA	V0000			No						





Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5835 : Girls Changeroom Washroom Floor: 1

Survey Date: 2025-02-24

Building Name: Lake Avenue School

Room #: 136B

Area (sqft): 100

Last Re-Assessment: 0000-00-00

	ASBESTOS															
System	Component	Material	Item	Covering	A*	٧*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	All	Drywall and joint compound			С	Υ		100			SF	V0056	None Detected	N.D.	None	
Duct	All	Not Insulated			С	N										
Floor	All	Vinyl Floor Tile and Mastic, 12x12 beige w/ brown fleck			Α	Υ		100(7)			SF	S0049C	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Mechanical Equipment	All	None Found														
Piping	All	Fibreglass			С	N						V0000	Non-Asbestos		None	
Structure	Beam Deck Joist	Steel			С	N		100			SF	V				
Wall	All	Concrete Block			Α	Υ										

Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5835 : Girls Changeroom Washroom Floor: 1

Survey Date: 2025-02-24

Building Name: Lake Avenue School

Room #: 136B

Area (sqft): 100

Last Re-Assessment: 0000-00-00

					PAINT					
	System	Item	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard	
	Wall								No	
	Structure	Metal	100		%	V0013	Red on joists and beams	Pb: 0.063 %	Lead (Low)	
	Wall	Concrete (poured)	100		%	V0012	Pale vellow on block	Pb: <0.00023	No	

Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5835 : Girls Changeroom Washroom Floor: 1

Room #: 136B

Survey Date: 2025-02-24

Last Re-Assessment: 0000-00-00

Building Name: Lake Avenue School

Area (sqft): 100

	MERCURY			
Component	Quantity	Unit	Sample	Hazard
Light Fixture	1	EA	V9500	Presumed

Client: Hamilton-Wentworth District School Board

Site: Schools Location: #5835 : Girls Changeroom Washroom

Floor: 1

Building Name: Lake Avenue School

Room #: 136B Area (sqft): 100

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

				PCB			
Component	Good	Poor	Unit	Sample	Sample Description	Amount	PCB
Light Ballasts	1		EA	V0000			No



Building Name: Lake Avenue School



Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5836 : Vestibule Floor: 1 Room #: 136C

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00 Area (sqft): 80

ou. roy but	LULU UL L-	ASBESTOS														
							AS	BESTOS								
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	All				С	Υ										
Ceiling	All	Ceiling Tiles (lay-in), 24x48 pinhole w/ fleck			С	Υ		80			SF	V0000	Non-Asbestos		None	
Duct	All															
Duct	All	None Found			D	N		100			%					
Floor	All				Α	Υ										
Floor	All	Vinyl Floor Tile and Mastic, 12x12 beige w/ brown fleck			Α	Υ		80(7)			SF	V0049	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Mechanical Equipment	All	None Found														
Piping		Fibreglass	Straight		D	N		12			LF	V0000	Non-Asbestos		None	
Piping	All															
Structure	All				С	N										
Structure	Beam And Joist				С	N		80			SF	V0000	Non-Asbestos		None	
Wall ¹		Paint, Pale yellow			Α	Υ		260			SF	V0052	None Detected	N.D.	None	
Wall	All				Α	Υ										
Wall	All	Concrete Block			Α	Υ		100			%	V0000	Non-Asbestos		None	
Wall	Base	Mastic, Brown, Baseboard mastic			Α	N		14			LF	V0054	None Detected	N.D.	None	
Wall	Door	Caulking, Beige caulking			Α	Υ		17			LF	S0053C	None Detected	N.D.	None	

1 - On block

Client: Hamilton-Wentworth District School Board Site: Schools **Building Name: Lake Avenue School**

Location: #5836 : Vestibule Floor: 1 Room #: 136C Area (sqft): 80

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

				PAINT				
System	Item	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard
Wall								No
Other ¹	Other ¹ Metal			%	V0014	Greenon door frame	Pb: .0033 %	No
Wall	Concrete (poured)	100		%	V0012	Pale yellow on block	Pb: <0.00023	No
Structure	Structure Metal					Red on joists and beams	Pb: 0.063 %	Lead (Low)

1 - Door frame

Client: Hamilton-Wentworth District School Board Site: Schools **Building Name: Lake Avenue School**

Location: #5836 : Vestibule Floor: 1 Room #: 136C Area (sqft): 80

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

	MERCURY			
Component	Quantity	Unit	Sample	Hazard
Light Fixture	1	EA	V9500	Presumed

Client: Hamilton-Wentworth District School Board Site: Schools **Building Name: Lake Avenue School**

Location: #5836 : Vestibule Floor: 1 Room #: 136C Area (sqft): 80





Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

				PCB			
Component	Good	Poor	Unit	Sample	Sample Description	Amount	PCB
Light Ballasts	1		EA	V0000			No





Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5837 : Office

Floor: 1

Building Name: Lake Avenue School

Room #: 137A

Area (sqft): 150

Survey Dat	e: 2025-02-24			Last Re-Assessment: 0000-00-00												
							AS	BESTOS								
System	Component	Material	Item	Covering	Α*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 24x48 pinhole with fleck (03/23/96)			С	Υ						V0000	Non-Asbestos		None	
Duct		Fibreglass	Insulation	Foil Face	С	N										
Floor		Vinyl Floor Tile and Mastic, 12x12 beige with brown flecks			Α	Υ		150(7)			SF	V0045	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Armaflex			С	N										
Structure	Beam Deck Joist	Steel			С	N										
Wall		Masonry			Α	Υ										
Wall		Paint			Α	Υ						V0031	None Detected	N.D.	None	

Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5837 : Office

Floor: 1

Building Name: Lake Avenue School

Room #: 137A

Area (sqft): 150

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

				PAINT				
System	ltem	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard
Wall	Concrete (poured)	100		%	V0012	Pale yellow on block	Pb: <0.00023	No





Client: Hamilton-Wentworth District School Board Site: Schools

Floor: 1

Building Name: Lake Avenue School

Room #: 137B

Area (sqft): 200

Location: #5838 : Kitchen Survey Date: 2025-02-24

Last Re-Assessment: 0000-00-00

cu. roj but	0. 2020 02 2 1					aust No Abbussinenti uuu uu uu										
							AS	BESTOS								
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 24x48 pinhole with fleck (Stamped 03/23/96)			С	Υ						V0000	Non-Asbestos		None	
Duct		Fibreglass	Insulation	Foil Face	С	N										
Floor		Vinyl Floor Tile and Mastic, 12x12 beige with brown flecks			А	Υ		150(7)			SF	V0045	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Fibreglass			С	N										
Structure	Beam Deck Joist	Steel			С	N										
Wall		Masonry			Α	Υ										
Wall		Paint			Α	Υ						V0031	None Detected	N.D.	None	

Client: Hamilton-Wentworth District School Board Site: Schools

Floor: 1

Location: #5838 : Kitchen Survey Date: 2025-02-24

Building Name: Lake Avenue School

Room #: 137B

Area (sqft): 200

				PAINT				
System	Item	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard
Wall	Concrete (poured)	100		%	V0012	Pale yellow on block	Pb: <0.00023	No





Client: Hamilton-Wentworth District School Board Site: Schools

Building Name: Lake Avenue School Floor: 1 Room #: 137C

Location: #5839 : Storage Survey Date: 2025-02-24

Area (sqft): 200

Last Re-Assessment: 0000-00-00

							AS	BESTOS								
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Duct		Not Insulated			С	Υ										
Floor		Vinyl Floor Tile and Mastic, 12x12 beige with brown flecks			Α	Υ		200(7)			SF	S0045BC	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Mechanical Equipment	Fan Unit	Not Insulated			С	Υ										
Piping		Fibreglass	Insulation		С	Υ										
Piping		Parging Cement	Fitting		С	Υ		12			EA	S0044ABC	None Detected	N.D.	None	
Piping	Drain	Cement Product		Fibreglass	Α	Υ		15(7)			LF	V9500	Presumed Asbestos		Presumed Asbestos	NF
Structure	Beam Deck Joist	Steel			С	Υ										
Wall		Masonry, Concrete block			Α	Υ										
Wall		Paint			Α	Υ		100			%	V0031	None Detected	N.D.	None	

Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5839 : Storage Floor: 1 **Building Name: Lake Avenue School**

Room #: 137C Area (sqft): 200

Survey Date: 2025-02-24				Last R	e-Assessm	nent: 0000-00-00		
				PAINT				
System	Item	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard
Wall	Masonry	100		%	V0006	White	Pb: <0.0064 %	No





Client: Hamilton-Wentworth District School Board Site: Schools

Site: Schools Building Name: Lake Avenue School Floor: 1 Room #: 137D

Location: #5840 : Office Floor: 1
Survey Date: 2025-02-24

Area (sqft): 150

Last Re-Assessment: 0000-00-00

our vey but	C. 2020 02 24					Lustite	13363311161	11. 0000 00	00							
							AS	BESTOS								
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	Acoustic Tile	Ceiling Tiles (lay-in), 24x48 pinhole with fleck (03/23/96)			С	Υ						V0000	Non-Asbestos		None	
Duct		Fibreglass	Insulation	Foil Face	С	N										
Floor		Vinyl Floor Tile and Mastic, 12x12 beige with brown flecks			Α	Υ		150(7)			SF	S0045A	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Piping		Armaflex			С	N										
Structure	Beam Deck Joist	Steel			С	N										
Wall		Masonry			Α	Υ										
Wall		Paint			Α	Υ						V0031	None Detected	N.D.	None	
Wall	Base	Adhesive/mastic			D	N		100			%	S0046A	None Detected	N.D.	None	

Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5840 : Office Floor: 1

Survey Date: 2025-02-24

Building Name: Lake Avenue School

Room #: 137D Area (sqft): 150

PAINT												
System	ltem	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard				
Wall	Concrete (poured)	100		%	V0012	Pale yellow on block	Pb: <0.00023	No				





Client: Hamilton-Wentworth District School Board

Location: #5841 : Boys Changeroom

Survey Date: 2025-02-24

Site: Schools Floor:

Building Name: Lake Avenue School

Room #:

Area (sqft): 480

Last Re-Assessment: 0000-00-00

							AS	BESTOS								
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			С	Υ		120			SF	S0057AB	None Detected	N.D.	None	
Ceiling	All	Ceiling Tiles (lay-in), 24x48 pinhole w/ fleck			С	Υ		480			SF	V0000	Non-Asbestos		None	
Duct	All	Not Insulated			D	N		100			%	V0000	Non-Asbestos		None	
Floor	All	Vinyl Floor Tile and Mastic, 12x12 beige w/ brown fleck			Α	Υ		480(7)			SF	V0049	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Mechanical Equipment	Fan Unit	Not Insulated			С	N		1			EA	V0000	Non-Asbestos		None	
Piping		Fibreglass	Straight		D	N		160			LF	V0000	Non-Asbestos		None	
Structure	Beam And Joist				С	N		480			SF	V0000	Non-Asbestos		None	
Wall ¹		Paint, Pale yellow			Α	Υ		100			%	V0052	None Detected	N.D.	None	
Wall		Firestopping (Cementitious)			С	N		60			SF	V0055	None Detected	N.D.	None	
Wall	All	Concrete Block			Α	Υ		100			%	V0000	Non-Asbestos		None	
Wall	Base	Mastic, Brown, Baseboard mastic			Α	N		100			%	V0054	None Detected	N.D.	None	
Wall	Door	Caulking, Yellow caulking			Α	Υ		40			LF	V0000	Non-Asbestos		None	

1 - On block

Client: Hamilton-Wentworth District School Board

Location: #5841 : Boys Changeroom

Component

Light Fixture

Floor:

Site: Schools

Building Name: Lake Avenue School

Room #:

Area (sqft): 480

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

				PAINT				
System	Item	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard
Wall	Concrete (poured)	100		%	V0012	Pale yellow on block	Pb: <0.00023	No
Structure	Metal	100		%	V0013	Red on joists and beams	Pb: 0.063 %	Lead (Low)
Wall	Concrete (precast)	100		%	L0015	Yellow on block	Pb: <0.00052 %	No
Other	Metal	100		%	L0016	Grey on door frame	Pb: 0.010 %	Lead (Low)

Client: Hamilton-Wentworth District School Board

Floor:

Location: #5841 : Boys Changeroom

Site: Schools

Building Name: Lake Avenue School Room #:

Area (sqft): 480

Last Re-Assessment: 0000-00-00

MERCURY Quantity Unit Sample Hazard EΑ V9500 Presumed

Client: Hamilton-Wentworth District School Board

Location: #5841 : Boys Changeroom

Site: Schools Floor:

Building Name: Lake Avenue School

Room #:

Area (sqft): 480

Survey Date: 2025-02-24

Survey Date: 2025-02-24

				РСВ			
Component	Good	Poor	Unit	Sample	Sample Description	Amount	PCB
Light Ballasts	7		EA	V0000			No











Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5842 : Boys Changeroom Washroom Floor: Room #:

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

Area (sqft): 136

							AS	BESTOS								
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			С	Υ		136			SF	S0057C	None Detected	N.D.	None	
Duct	All	Not Insulated			С	N		100			%					
Floor	All	Vinyl Floor Tile and Mastic, 12x12 beige w/ brown fleck			Α	Υ		136(7)			SF	V0049	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Mechanical Equipment		None Found			С	N										
Piping	All	Fibreglass			С	N						V0000	Non-Asbestos		None	
Structure	Beam Deck Joist	Steel			С	N		136			SF					
Wall		Firestopping (Cementitious)			С	N		60			SF	V0055	None Detected	N.D.	None	
Wall	All	Concrete Block			Α	Υ		100			%					

Building Name: Lake Avenue School

Building Name: Lake Avenue School

Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5842 : Boys Changeroom Washroom Floor: Room #: Area (sqft): 136

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

				PAINI				
System	Item	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard
Structure	Metal	100		%	V0013	Red on joists and beams	Pb: 0.063 %	Lead (Low)
Wall	Concrete (poured)	100		%	V0012	Pale yellow on block	Pb: <0.00023	No

Client: Hamilton-Wentworth District School Board Site: Schools Building Name: Lake Avenue School

Location: #5842 : Boys Changeroom Washroom Floor: Room #: Area (sqft): 136

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

	MERCURY			
Component	Quantity	Unit	Sample	Hazard
Light Fixture	1	EA	V9500	Presumed

Client: Hamilton-Wentworth District School Board Site: Schools Building Name: Lake Avenue School

Location: #5842 : Boys Changeroom Washroom Floor: Room #: Area (sqft): 136

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

				PCB			
Component	Good	Poor	Unit	Sample	Sample Description	Amount	PCB
Light Ballasts	1		EA	V0000			No





Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5843 : Boys Shower Floor:

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

Area (sqft): 152 Room #:

	eiling Drywall and joint compound C Y 152 SF V0056 None Detected N.D. None															
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling		Drywall and joint compound			С	Υ		152			SF	V0056	None Detected	N.D.	None	
Duct	All	Not Insulated										V0000	Non-Asbestos		None	
Floor		Thin-set		Ceramic Tiles	С	N		152			SF	V0051	None Detected	N.D.	None	
Mechanical Equipment	All	None Found														
Piping	All	Fibreglass			С	N		100			%					
Structure	Beam And Joist				С	N		152			SF					
Wall		Thin-set			Α	Υ		160			SF	S0061ABC	None Detected	N.D.	None	
Wall	All	Concrete Block			Α	Υ		100			%	V0000	Non-Asbestos		None	
Wall	Door	Caulking, Yellow caulking			Α	Υ		40			LF	V0000	Non-Asbestos		None	
Wall	Door	Caulking, Yellow caulking			Α	Υ		40			LF	V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth District School Board

Site: Schools

Floor:

Building Name: Lake Avenue School

Building Name: Lake Avenue School

Location: #5843 : Boys Shower

Room #:

Area (sqft): 152

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

	PAINT											
System	Item	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard				
Structure	Metal	100		%	V0013	Red on joists and beams	Pb: 0.063 %	Lead (Low)				
Wall	Concrete (poured)	100		%	V0012	Pale yellow on block	Pb: <0.00023	No				

Client: Hamilton-Wentworth District School Board

Site: Schools

Floor:

Building Name: Lake Avenue School

Location: #5843 : Boys Shower

Survey Date: 2025-02-24

Room #:

Last Re-Assessment: 0000-00-00

MERCURY										
Component	Quantity	Unit	Sample	Hazard						
Light Fixture	2	EA	V9500	Presumed						

Client: Hamilton-Wentworth District School Board

Site: Schools

Building Name: Lake Avenue School

Location: #5843 : Boys Shower

Floor:

Room #:

Area (sqft): 152

Area (sqft): 152

Survey Date: 2025-02-24

				PCB			
Component	Good	Poor	Unit	Sample	Sample Description	Amount	PCB
Light Ballasts	2		EA	V0000			No





Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5844 : Corridor Floor: 1

Survey Date: 2025-02-24

Building Name: Lake Avenue School

Room #: 133 Area (sqft): 400

Last Re-Assessment: 0000-00-00

Building Name: Lake Avenue School

Building Name: Lake Avenue School

Building Name: Lake Avenue School

240110 700000110111 0000 00 00																
	ASBESTOS															
System	Component	Material	Item	Covering	A*	V*	AP*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable
Ceiling	All				С	Υ										
Ceiling	All	Ceiling Tiles (lay-in), 24x24 Textured with pinhole			С	Υ		400			SF	V0000	Non-Asbestos		None	
Duct	All	Not Insulated										V0000	Non-Asbestos		None	
Floor	All				Α	Υ										
Floor	All	Vinyl Floor Tile and Mastic, 12x12 beige w/ brown fleck			Α	Υ		400(7)			SF	V0049	Chrysotile	0.5-5%	Confirmed Asbestos	NF
Mechanical Equipment	All	None Found														
Piping		Fibreglass	Straight		D	N		80			LF	V0000	Non-Asbestos		None	
Piping	All															
Structure	All				С	N										
Structure	Beam And Joist				С	N		400			SF	V0000	Non-Asbestos		None	
Wall	All				Α	Υ										
Wall	All	Concrete Block			Α	Υ		100			%	V0000	Non-Asbestos		None	

Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5844 : Corridor Floor: 1 Room #: 133 Area (sqft): 400

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

PAINT System Item Good Poor Unit Sample Sample Description Amount Hazard Wall No Structure Metal 100 % V0013 Red on joists and beams Pb: 0.063 % Lead (Low)

Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5844 : Corridor Floor: 1 Room #: 133 Area (sqft): 400

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

MERCURY									
Component	Quantity	Unit	Sample	Hazard					
Light Fixture	3	EA	V9500	Presumed					

Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5844 : Corridor Floor: 1 Room #: 133 Area (sqft): 400

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

PCB											
Component	Good	Poor	Unit	Sample	Sample Description	Amount	PCB				
Light Ballasts	3		EA	V0000			No				





Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5845 : Corridor Floor: 1

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00 Area (sqft): 400

ASBESTOS Α* System Component Material Item Covering ۷* AP* Good Fair Poor Unit Sample Asbestos Type Amount Hazard Friable С Υ Ceiling Αll Ceiling Tiles (lay-in), 24x24 Textured with С Υ Ceiling Αll 400 SF V0000 Non-Asbestos None pinhole All Duct Not Insulated Αll Υ Floor Α Vinyl Floor Tile and Mastic, 12x12 beige w/ Confirmed Υ SF NF Floor ΑII Α 400(7) V0049 Chrysotile 0.5-5% brown fleck Asbestos Mechanical Αll None Found Equipment N 90 LF V0000 Piping Fibreglass Straight D Non-Asbestos None All Piping All С Structure Ν 400 SF Beam And Joist С N V0000 Non-Asbestos None Structure Wall All Masonry Α Υ 100 % V0000 Non-Asbestos None Wall Αll Concrete Block Α Υ 100 % V0000 Non-Asbestos None

Room #: 134

Client: Hamilton-Wentworth District School Board Site: Schools

Floor: 1

Building Name: Lake Avenue School

Room #: 134

Area (sqft): 400

Last Re-Assessment: 0000-00-00

Building Name: Lake Avenue School

PAINT										
System	Item	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard		
Wall								No		
Structure	Metal	100		%	V0013	Red on joists and beams	Pb: 0.063 %	Lead (Low)		

Client: Hamilton-Wentworth District School Board Site: Schools

Location: #5845 : Corridor Floor: 1

Survey Date: 2025-02-24

Location: #5845 : Corridor

Survey Date: 2025-02-24

Building Name: Lake Avenue School

Room #: 134

Area (sqft): 400

Last Re-Assessment: 0000-00-00

MERCURY									
Component	Quantity	Unit	Sample	Hazard					
Light Fixture	3	EA	V9500	Presumed					

Client: Hamilton-Wentworth District School Board

Location: #5845 : Corridor

Site: Schools

Floor: 1

Building Name: Lake Avenue School

Room #: 134

Area (sqft): 400

Survey Date: 2025-02-24 Last Re-Assessment: 0000-00-00

PCB										
Component	Good	Poor	Unit	Sample	Sample Description	Amount	PCB			
Light Ballasts	3		EA	V0000			No			



Component

ALL DATA REPORT

Α*

C Y

Α

A Y

A Y

Covering

V*

Υ



Client: Hamilton-Wentworth District School Board

Location: #5847 : 1982 Exterior Floor:

Site: Schools

Item

Building Name: Lake Avenue School

Room #:

100

100

Area (sqft): 0

Survey Date: 2025-02-24

System

Duct

Structure

Structure

Structure

Material

Not Insulated

Concrete (poured)

Masonry

Mortar

Last Re-Assessment: 0000-00-00

ASBESTOS												
\P*	Good	Fair	Poor	Unit	Sample	Asbestos Type	Amount	Hazard	Friable			
	100			%	V0000	Non-Asbestos		None				
	100			%	V0000	Non-Asbestos		None				

Client: Hamilton-Wentworth District School Board

Site: Schools

Building Name: Lake Avenue School

%

%

Location: #5847 : 1982 Exterior

Survey Date: 2025-02-24


Floor:

Room #:

Area (sqft): 0

Last Re-Assessment: 0000-00-00

PAINT									
System	Item	Good	Poor	Unit	Sample	Sample Description	Amount	Hazard	
Duct	Paint	18	2	SF	L0017	Brown paint on Exterior duct vent	Pb: 0.0088 %	No	

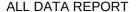





Legend:

Sample number		Units		Other	
S####	Asbestos sample collected	SF	Square feet	Α	Access
L####	Paint sample collected	LF	Linear feet	V	Visible
P####	PCB sample collected	EA	Each	AP	Air Plenum
M####	Mould sample collected	%	Percentage	F	Friable material
V####	Material is visually identified to be identical to S####	LF	Linear feet	NF	Non Friable material
V0000	Known non hazardous material			PF	Potentially Friable material
V9000	Material visually identified as a Hazardous Material			Pb	Lead
V9500	Material is presumed to be a hazardous material			Hg	Mercury
				As	Arsenic
				Cr	Chromium

Access		С
Α	Accessible to all building occupants	G
В	Accessible to maintenance and operations staff without a ladder	Fá
С	Accessible to maintenance and operations staff with a ladder. Also rarely entered, locked areas	P
D	Not normally accessible	

Visible The material is visible when standing on the floor of the room, without the removal or opening of other building components (e.g. ceiling tiles or access panels). The material is not visible to view when standing on the floor of the room and requires the

removal of a building component (e.g. ceilings tiles or access panels) to view and access. Includes rarely entered crawlspaces, attic spaces, etc. Observations will be limited to the extent visible from the access points.

The material is partially visible to view when standing on the floor of the room and requires the removal of a building component (e.g. ceiling system or access panels) to view completely and access. Includes partially viewed access points to crawlspaces, attic spaces, etc. without entering. Observations are limited to the extent visible from the access points.

Colour Coding

identification.

The material is presumed to be a hazardous material, based on visual appearance, and

Condition

Good No visible damage or deterioration

Minor, repairable damage, cracking, delamination or deterioration Fair

Irreparable damage or deterioration with exposed and missing material Poor

Air Plenum

Yes or No

The material is in a return air plenum or in a direct airstream or there is evidence of air erosion (e.g. duct for heating or cooling blowing directly on or across an ACM). This field is only completed where Air Plenum consideration is required by regulation.

The material is a hazardous material, either by analytical results or by visible

was not sampled due to limited access or the non-destructive nature of sampling.

Action

(1)	Clean up of ACM Debris	(2)	Precautions for Access Which may Disturb ACM Debris	(3)	ACM removal
(4)	Precautions for Work Which may Disturb ACM in Poor Condition	(5)	Proactive ACM removal (Minimum repair required for fair condition)	(6)	ACM repair







(7) Management program and surveillance

PART 1 GENERAL

1.1 General and Related Work

- .1 Read this Section in conjunction with all drawings and all other Sections so as to comply with the requirements of the General Conditions of the Contract.
- .2 Related work specified elsewhere:
 - .1 Section 02 82 00.01 Asbestos Abatement Type 1 Procedures
- .3 Site Conditions identifies all known hazardous building materials within the Project Area. The information provided is for general reference only. It is recommended each Contractor confirm existing conditions on site prior to tender close.
 - .1 The specification fulfils the requirements of Section 30 of the Ontario Occupational Health and Safety Act.
 - .2 The specification fulfils the requirements of the Section 10 of Ontario Regulation 278/05.
- .4 The Outline of Work identifies the location, condition and quantities of hazardous building materials to be removed as part of this project.
 - .1 It is the intent that work prescribed this Section will result in the removal of all hazardous materials as outlined and the decontamination of all surfaces or materials which may have been or become contaminated by hazardous materials either during or prior to work of this Contract.

1.2 Site Conditions

.1 Refer to the report entitled "Revised Hazardous Building Materials Assessment (Preconstruction), P02125 Washrooms and Changeroom Renovations, Lake Avenue Elementary School, 157 Lake Avenue, Hamilton, Ontario", dated February 27, 2025, prepared by Pinchin Ltd., file number 352293.002.

1.3 Outline of Work

- .1 Coordinate the following items with the Owner's Project Manager and the Construction Manager, which are to be included in the abatement contractor's scope of work, including but not limited to: electrical isolations, GFI connection, water connections, HVAC and exhaust ventilation system isolation, bin placement, schedule, disconnects, etc.
- .2 Refer to the Contract Drawings for the extent of construction work and the Work Areas. Work to be phased.
- .3 Install Hoarding Walls between Abatement Work Areas and Occupied Areas as required.
- .4 Refer to Contract Documents for phasing and schedule.

- .5 Using Type 1 procedures prescribed in the Section identified in Related Work, perform the following work:
 - .1 Remove fasteners from partitions, millwork, and other items scheduled for demolition, where they are attached to flooring with asbestos-containing vinyl floor tiles. If removal using hand-held non-powered tools is not feasible, follow Type 2 procedures outlined in O.Reg. 278/05 and use power tools equipped with an effective HEPA dust collection device.
 - .2 Remove and dispose of asbestos-containing vinyl floor tiles where scheduled to be removed.
 - .1 Include to remove vinyl floor tiles where present under millwork, partitions, plumbing fixtures/toilets, etc
 - .3 Remove and dispose of asbestos-containing vinyl floor tiles where not schedule to be removed but maybe disturbed by demolition and or new installations in Corridors 133 and 134.
- .6 Refer to Specification Sections identified in the Related Work for specified personnel protective measures for the safe handling, removal, clean-up, enclosure, or repair of hazardous materials in each phase or work area.
- .7 Protect surfaces, building fabrics and items remaining within the Abatement Work Area.
- .8 Without disturbing hazardous materials, perform removals where required, prior to abatement work.
 - .1 Maximize waste diversion by use of resale of building materials, or recycling.
- .9 Isolate the Abatement Work Area from adjoining Occupied and Non-Occupied Areas whether present at an interior or exterior location.
- .10 Maintain emergency and fire exits from Abatement Work Area, or establish alternative exits satisfactory to Provincial Fire Marshall and local authorities having jurisdiction. Maintain extra routes from occupied areas. Place emergency exit signs at locations to clearly mark exit route. Seal emergency exit doors so as not to impede use of door during emergency evacuation.
- .11 Remove, clean, store and replace at completion of work, non-operating mechanical and electrical equipment, ducts, building components, materials or items removed to accommodate asbestos removal.
- Remove and dispose of as appropriate waste, building components, materials and items contaminated by hazardous materials that cannot be effectively cleaned.
- .13 Encapsulate remaining hazardous materials at locations where removal is deemed impractical by the Abatement Consultant.
- Encapsulation will not be permitted where removal of building materials or structures scheduled for demolition will facilitate access to the asbestos materials in question.

- .15 Final clean work area to remove visible signs of asbestos and other hazardous materials, other debris or settled dust.
- Apply lock-down agent to exposed surfaces throughout the work area and to surfaces from which any hazardous materials have been removed.
 - .1 Do not apply lock-down to materials which would be damaged by its application.
- .17 Unless otherwise specified, the handling, removal, clean-up or repair of hazardous materials or surfaces contaminated with hazardous materials is to be performed following wet removal techniques.

1.4 Schedule

- .1 Provide necessary manpower, supervision, equipment and materials to maintain and complete the project on schedule.
- .2 Work Hours:
 - .1 Coordinate all work, scheduling and phasing with the Owner.
 - .2 Duration for which HVAC systems may remain shutdown to accommodate quiet hours work will vary in accordance with outside weather conditions and internal demand. Duration of quiet hours work will have to be scheduled accordingly and in consultation with the Abatement Consultant and Owner.
- .3 Provide 48 hours written notice to the Abatement Consultant of any request to work outside normal working hours. Obtain written approval before proceeding.

1.5 Definitions

- .1 Abatement Consultant: Owner's Representative providing inspection and air monitoring.
- .2 <u>Abatement Contractor:</u> Contractor or sub-contractor performing work of this section.
- .3 <u>Abatement Work Area</u>: Area where work takes place which will, or may, disturb hazardous materials.
- .4 <u>Amended Water</u>: Water with wetting agent added for the purpose of reducing surface tension to allow thorough wetting of materials.
- .5 <u>Asbestos:</u> Any of the fibrous silicates defined in Regulation 278/05 including: actinolite, amosite, anthophyllite, chrysotile, crocidolite and tremolite.
- .6 <u>Asbestos-Containing Material (ACM)</u>: Material identified under Site Conditions including any debris, overspray, fallen material and settled dust.
- .7 <u>Authorized Visitors</u>: Building Owner, Abatement Consultant, or designated representative, and persons representing regulatory agencies.

- .8 <u>Competent Worker:</u> A worker who is qualified because of knowledge, training and experience to perform the work, is familiar with Regulation 278/05 and the Occupational Health and Safety Act, and has knowledge of the potential or actual danger to health and safety in the work.
- .9 <u>Contaminated Waste</u>: Material identified under Site Conditions, including fallen material, settled dust, other debris and materials or equipment deemed to be contaminated by the Abatement Consultant.
- .10 <u>Curtained Doorway</u>: Doorway consisting of two (2) overlapping flaps of rip-proof polyethylene arranged to permit ingress and egress from one room to another while permitting minimal air movement between rooms.
- .11 <u>DOP Test</u>: A testing method used to determine the integrity of the Negative Pressure unit or vacuum using a Dispersed Oil Particulate (DOP) or Poly Alpha Olefin (PAO) HEPA filter leak test. This test is to be conducted on site where units are to be installed. Refer to the Environmental Abatement Council of Ontario (EACO) DOP/PAO Testing Guideline 2013 or ANSI/ASME N510-2007.
- .12 <u>Fitting</u>: Individual segments or pieces of a mechanical service line which may include but is not limited to the hangers, tees, elbows, joints, valves, unions, etc.
- .13 <u>Friable Material</u>: Material that when dry can be crumbled, pulverized or powdered by hand pressure and includes such material that is crumbled, pulverized or powdered.
- .14 <u>HEPA:</u> High Efficiency Particulate Aerosol filter that is at least 99.97 percent efficient in collecting a 0.3 micrometre aerosol.
- .15 <u>Lead-Containing:</u> The Ontario Ministry of Labour (MOL) has not established a lower limit for concentrations of lead in paint, below which precautions do not need to be considered during construction projects. Pinchin follows the recommendations of the Environmental Abatement Council of Canada (EACC) Lead Guideline for Construction, Renovation, Maintenance or Repair. The Guideline suggests that 0.1% (1,000 ppm) lead in paint represents a de minimis concentration of lead in paint for construction hygiene purposes, that is a concentration below which the lead content is not the limiting hazard in any disturbance of leaded paint for non-aggressive disturbance of painted finishes, (hand powered demolition, chipping, scraping, light sanding, etc.).
- .16 <u>Lead-containing</u>: Paints containing lead at a concentration of 0.009% (90 ppm) or greater.
- .17 <u>Lead Waste</u>: Waste generated from removal of lead-containing materials, or the substrate and paint finish where left intact.
- .18 <u>Milestone Inspection</u>: Inspection of the Abatement Work Area at a defined point in the abatement operation.
- .19 <u>Negative Pressure</u>: A reduced pressure within the Abatement Work Area (> 0.02 inches of water column) established by extracting air directly from Abatement Work Area and discharging it to exterior of building.

- .20 <u>Non-Friable Material</u>: Material that when dry cannot be crumbled, pulverized or powdered by hand pressure.
- .21 <u>Occupied Area</u>: Any area of the building or adjoining space outside the Abatement Work Area.
- .22 <u>Personnel:</u> All Contractor's employees, sub-contractors employees, supervisors.
- .23 PCM: Phase Contrast Microscopy.
- .24 <u>Remove:</u> Remove means remove and dispose of (as applicable type of waste) unless followed by other instruction (e.g. remove and turn over to Owner).
- .25 <u>TEM:</u> Transmission Electron Microscopy.

1.6 Regulations and Guidelines

- .1 Comply with Federal, Provincial, and local requirements, provided that in any case of conflict among those requirements or with these Specifications, the more stringent requirements shall apply. Work shall be performed under regulations in effect at the time work is performed.
- .2 Where regulations are not present, follow accepted industry standards and applicable Guideline documents.
- .3 Regulations and Guidelines include but are not limited to the following:
 - .1 Ministry of Labour Occupational Health and Safety Act Regulations for Construction Projects including Revised Statutes of Ontario 1990, Chapter 0.1 and Ontario Regulation 278/05.
 - .2 Ministry of the Environment and Climate Change Regulation for the disposal of waste, including R.R.O. 1990, Reg. 347 as amended.
 - .3 PCB Regulations, SOR 2008-273 and R.R.O. 1990, Reg 362.
 - .4 Regulation 490/09 Designated Substances.
 - .5 Environmental Abatement Council of Canada (EACC), Lead Guideline For Construction, Renovation, Maintenance or Repair, October 2014.
 - .6 Ministry of Labour, Guideline, Silica on Construction Projects, 2011.

1.7 Quality Assurance

- .1 Removal and handling of hazardous materials is to be performed by persons trained in the methods, procedures and industry practices for Abatement.
- .2 Ensure work proceeds to schedule, meeting all requirements of this Specification.

- .3 Complete work so that at no time airborne dust, visible debris, or water runoff contaminate areas outside the Abatement Work Area.
- .4 Any contamination of surrounding area (indicated by visual inspection or air monitoring) shall necessitate the clean-up of affected area, and in the same manner applicable to an Abatement Work Area at no cost to the Owner.
- .5 All work involving electrical, mechanical, carpentry, glazing, etc., shall be performed by licensed persons experienced and qualified for the work required.

1.8 Supervision

- .1 Provide on site for each work shift, a Shift Superintendent(s), who has authority regarding all aspects related to manpower, equipment and production.
- .2 At all times during work, the Shift Superintendent(s) must be on site. Failure to comply with this requirement will result in a stoppage of all work, at no cost to the Owner.
- .3 Replace supervisory personnel, with approved replacements, within three (3) working days of a written request from the Owner. Owner reserves the right to request replacement of supervisory personnel without explanation.
- .4 Do not replace supervisory personnel without written approval from the Owner.

1.9 Instruction and Training

- .1 Instruction and training must be provided by a competent person.
- .2 All workers completing Type 1, 2 or 3 asbestos abatement must be trained in compliance with Section 19 of O.Reg. 278/05.
 - .1 For Type 3 asbestos abatement, workers must be trained and certified per Section 20 of O.Reg. 278/05.

1.10 Notification

- .1 Before commencing work, notify orally and in writing, an inspector at the office of the Ontario Ministry of Labour nearest the project site, where required.
- .2 Inform all trades on site of the presence and location of hazardous materials identified in the Contract documents.
- .3 Notify the Owner or Owner's Representative, the Joint Occupational Health and Safety Committee and the Provincial Ministry of Labour, if suspected asbestos-containing materials not identified in the contract documents are discovered during the course of the work. Stop work in these areas immediately.
- .4 Notify Sanitary Landfill site as per O.Reg. 347/90 as amended.

1.11 Submittals

- .1 Submit prior to starting work:
 - .1 Provincial Workers' Compensation Board Clearance Certificate.
 - .2 Insurance certificates.
 - .3 Copy of Company Health and Safety Policy and applicable programs.
 - .4 Ministry of Labour Notice of Project form.
 - .5 Copy of Certificate of Approval for disposal of hazardous materials waste and location of landfill.
 - .6 Pre-removal damage survey of the Abatement Work Area(s), waste transport routes, and bin storage areas
- .2 Submit the following information regarding personnel prior to starting work:
 - .1 Proof in the form of a certificate that workers have been certified under the Ministry of Training, Colleges and Universities course 253W.
 - .2 Proof in the form of a certificate that supervisory personnel have attended a training course on asbestos removal or are certified as supervisors under the Ministry of Training, Colleges and Universities course 253S.
 - .3 Written statement that personnel have had instruction on hazards of exposure to hazardous materials identified within this scope, the use of respirator, protective clothing, worker and waste decontamination procedures, and all aspects of work procedures and protective measures.
 - .4 WHMIS training certificates for all personnel.
 - .5 Certificate proving that each worker on site has been fit tested for the respirator appropriate for the work being performed.
- .3 Submit the following information regarding HEPA filtered devices prior to construction of enclosure or asbestos abatement:
 - .1 Performance data on HEPA filtered vacuums including DOP tests no more than 3 months old.
 - .2 Performance data on negative air units including DOP tests which must be no more than 3 months old if the unit is vented outdoors or which must be performed on site immediately prior to initial usage and when HEPA filters are changed if the unit is vented indoors.
 - .3 DOP tests to be performed by an independent testing company.
 - .1 DOP testing company is required to submit a detailed technical report of testing protocol, including Introduction, Methodology, Results, Conclusions, and Recommendations, including results of the Air-Aerosol

- Mixing Uniformity test as per ASME N510-1989 (1995).
- .2 DOP testing company must also provide calibration certificates from an independent calibration firm or from the manufacturer of the testing equipment for both the aerosol photometer and the pressure gauge on the aerosol generator dated within 1 calendar year from the on-site testing date.
- .3 DOP testing company must also provide the National Sanitation Foundation (NSF) certification name and number of the on-site technician performing the testing.
- .4 Proof of calibration of DOP testing equipment.
- .4 Submit the following prior to isolating the work area:
 - .1 Safety Data Sheets for chemicals or material used in the course of the Abatement Project.
- .5 Submit the following upon completion of the work.
 - .1 Manifests, waybills, bills of ladings etc. as applicable for each type of waste.

1.12 Inspection

- .1 From commencement of work until completion of clean-up operations, the Abatement Consultant is empowered by the Owner to inspect for compliance with the requirements of governing authorities, adherence to specified procedures and materials, and to inspect for final cleanliness and completion.
- .2 The Abatement Consultant is empowered by the Owner to order a shutdown of work when leakage of asbestos from the controlled work area has occurred or is likely to occur.
- Any deviation from the requirements of the Specifications or governing authorities that is not approved in writing may result in a stoppage of work, at no cost to the Owner.
- .4 Additional labour or materials expended by the Contractor to rectify unsatisfactory conditions and to provide performance to the level specified shall be at no additional cost to the Owner.
- .5 Inspection and air monitoring performed as a result of Contractor's failure to perform satisfactorily regarding quality, safety, or schedule, shall be back-charged to the Contractor.
- .6 Facilitate inspection and provide access as necessary. Make good work disturbed by inspection and testing at no cost to the Owner.
- .7 Refer to the Sections identified in Related Work for specified milestone inspections which are to take place at defined points throughout the abatement operation specific to each phase or work area.
- .8 Provide 24 hours written notice to the Abatement Consultant of any request for scheduling of milestone inspections or transportation of waste through Occupied Areas.

- .9 The following Milestone Inspections may take place, at the Owner's cost, as outlined in each related specification section:
 - .1 Milestone Inspection Clean Site Preparation
 - .1 Inspection of preparations and set-up prior to contaminated work in the Abatement Work Area.
 - .2 Milestone Inspection Bulk Removal Inspection
 - .1 Inspection during asbestos removal, monitoring removal methods, site deficiencies, performing occupied air monitoring, etc.
 - .3 Milestone Inspection Visual Clearance
 - .1 Inspection of Abatement Work Area after completion of all abatement, but prior to application of lock-down agents or dismantling of enclosure.
- .10 Refer to the Sections identified in Related Work for specified milestone inspections which are to take place at defined points throughout the abatement operation specific to each phase or work area.
- Do not proceed with next phase of work until written approval of each milestone is received from the Abatement Consultant.

1.13 Air Monitoring - Asbestos

- .1 Air monitoring will be performed using Phase Contrast Microscopy (PCM) following the National Institute for Occupational Safety and Health Method 7400.
- .2 Co-operate in the collection of air samples, including providing workers to wear sample pumps for up to full-shift periods. Contractor will be responsible for the cost of testing equipment repairs or resampling resulting from the actions of the Contractor's forces.
- .3 Results of PCM samples at or exceeding 0.05 fibres per cubic centimeter of air (fibre/cc) or greater, outside an Abatement Work Area, will indicate asbestos contamination of these areas. Respond as follows:
 - .1 Suspend work within the adjoining Abatement Work Area until written authorization to resume work has been received from the Abatement Consultant.
 - .2 Isolate and clean area in the same manner applicable to the Abatement Work Area.
 - .3 Maintain work area isolation, and repeat clean-up operations until visual inspection and air monitoring results are at a level equal to that specified.
 - .4 At the discretion of the Abatement Consultant provide additional negative air units at locations specified in response to elevated fibre levels being detected in the Clean Change Room or Occupied Areas.

- .4 Results of PCM samples at or greater than 0.01 fibres per cubic centimeter of air (fibre/cc), collected within the Abatement Work Area enclosure after the site has passed a visual inspection, and an acceptable coat of lock-down agent has been applied, will indicate asbestos contamination of these areas. Respond as follows:
 - .1 Maintain work area isolation and re-clean entire work area. Then apply another acceptable coat of lock-down agent to exposed surfaces throughout the work area.
 - .2 Repeat above measures until visually inspected and air monitoring results are at a level equal to that specified.
 - .3 Alternate to items above, the Asbestos Abatement Contractor can pay for analysis of PCM samples by Transmission Electron Microscopy (TEM) at NVLAP accredited laboratory.
 - .1 Enclosure to remain sealed, with negative pressure maintained, and subject to required daily inspections until TEM results are received.
- .5 Additional labour or materials expended by the Contractor to rectify unsatisfactory conditions and to provide performance to the level specified shall be at no additional cost to the Owner.
- .6 Cost of additional inspection and sampling performed as a result of elevated fibre levels in areas outside the Abatement Work Area or from within the work area following completion of work, will be back-charged to the Contractor.

1.14 Worker Protection

- .1 Instruct workers before allowing entry to the Abatement Work Area. Instruction shall include training in use of respirators, dress, showering, entry and exiting from an Abatement Work Area, and all other aspects of work procedures and protective measures.
- .2 Workers shall not eat, drink, chew gum or tobacco, vape or smoke in the Abatement Work Area.
- .3 Workers shall be fully protected at all times when possibility of disturbance of hazardous materials exists.
- .4 Provide soap, towels and facilities for washing of hands and face, which shall be used by all personnel when leaving the Abatement Work Area.
- .5 Respiratory Protection
 - .1 Refer to each particular Section of the Specification for specified type of respiratory equipment specific to each phase or work area.
 - .2 Respirators shall be:
 - .1 Certified by the National Institute of Occupational Safety and Health (NIOSH) or other testing agency acceptable to the Ministry of Labour.

- .2 Fitted so that there is an effective seal between the respirator and the worker's face. Ensure that no person required to enter an Abatement Work Area has facial hair which affects the seal between respirator and face.
- .3 Assigned to a worker for their exclusive use.
- .4 Maintained in accordance with manufacturer's specifications.
- .5 Cleaned, disinfected and inspected by a competent person after use on each shift, or more often if required.
- .6 Repaired or have damaged or deteriorated parts replaced.
- .7 Stored in a clean and sanitary location.
- .8 Provided with new filters as necessary, according to manufacturer's instructions.
- .9 Worn by personnel who have been fit checked by qualitative or quantitative fit-testing.
- .10 Instruction on proper use of respirators must be provided by a competent person as defined by the Occupational Health and Safety Act.
- .3 Provide protective clothing, to all personnel which:
 - .1 Is made of a material that does not readily retain nor permit penetration of asbestos fibres or lead/silica dust.
 - .2 Consists of head covering and full body covering that fits snugly at the ankles, wrists and neck.
 - .3 Once coveralls are worn, treat and dispose of as contaminated waste.
 - .4 Is replaced or repaired if torn or ripped.
- .4 Use hard hats, safety footwear and other protective equipment and apparel required by applicable construction safety regulations.

1.15 Visitor Protection

- .1 Provide clean protective clothing and equipment to Authorized Visitors.
- .2 Instruct Authorized Visitors in the use of protective clothing and Abatement Work Area entry and exit procedures.
- .3 Authorized visitors are required to be fit tested on respirators, prior to entering Abatement Work Area.
 - .1 Respirator worn must be compliant with Section 13 and Table 2 of O.Reg. 278/05.

1.16 Signage

- .1 <u>Asbestos Abatement Signs:</u> Post signs at access points to the Abatement Work Area, stating at minimum, the following:
 - .1 There is an asbestos dust hazard.
 - .2 Access to the work area is restricted to persons wearing protective clothing and equipment.

- .2 <u>Lead Abatement Signs</u>: Post signs at access points to the Abatement Work Area, stating at minimum, the following:
 - .1 There is a lead dust, fume or mist hazard.
 - .2 Access to the work area is restricted to authorized persons.
 - .3 Respirators must be worn in the work area.
- .3 <u>Vehicles, Bins and Asbestos Waste Containers:</u> Post signs on both sides of every vehicle used for the transportation of asbestos waste and on every asbestos waste container. Signs must display thereon in large, easily legible letters that contrast in colour with the background the word "CAUTION" in letters not less than ten centimetres in height and the words:
 - .1 CONTAINS ASBESTOS FIBRES
 - .2 Avoid Creating Dust and Spillage
 - .3 Asbestos May be Harmful To Your Health
 - .4 Wear Approved Protective Equipment.
- .4 Place placards in accordance with Transportation of Dangerous Goods Act.

1.17 Waste and Material Handling

- .1 Waste bins must be placed on grade or in receiving.
- .2 All bins for hazardous materials must be covered and locked when waste transfer is not being performed.
- .3 Ensure redundant non-ACM, rubble, debris, etc. removed during contaminated work are treated, packaged, transported and disposed of as appropriate waste.
- .4 Clean, wash and apply Post Removal Sealant to metal waste prior to removal from Abatement Work Area. Recycle metals.
- .5 Clean, wash and apply Post Removal Sealant to non-porous materials prior to disposal as clean waste. Obtain prior written approval from the Abatement Consultant for each individual type of material.
- .6 Clean and wash equipment prior to removal from Abatement Work Area if removed prior to completion.
- .7 Place all equipment, tools and unused materials that cannot be cleaned in Abatement Waste Containers.
- .8 As work progresses, and at regular intervals, transport the sealed and labelled waste containers from the Abatement Work Area to waste bin.

- .9 Place items in bins according to waste classification. Place asbestos waste, lead waste, metals, non-asbestos waste, etc. in separate bins.
- .10 Removal of waste containers and decontaminated tools and materials from the Abatement Work Area shall be performed as follows:
 - .1 Remove any visible contamination from the surface of non-porous or cleanable waste being removed from the Abatement Work Area. If the item can be cleaned, remove it from the site as clean waste.
 - .2 Place waste or item in Waste Container and seal closed.
 - .3 Wet wipe outside of Waste Container.
 - .4 Within Decontamination Facility, Transfer Room or at the perimeter of the Abatement Work Area, place in second Waste Container. Seal closed.
 - .5 Remove waste containers and transport to appropriate bin.
- .11 Transport waste and materials via the predetermined routes and exits. Arrange waste transfer route with Owner. Use a closed, covered cart to transport through Occupied Areas.
- .12 Provide workers transporting waste with means to access full personal protective equipment and all tools required to properly clean up spilled material in the case of a rupture of a Waste Container.
- .13 Pick-up and drop off of garbage bin shall be at pre-approved times, and must not interfere with the Owners operations.
- .14 Transport hazardous waste to landfill or waste transfer station licensed by the provincial Ministry of the Environment.
- .15 Cooperate with the provincial Ministry of the Environment inspectors and immediately carry out instructions for remedial work at dump to maintain environment, at no additional cost to the Owner.

1.18 Re-establishment of Objects and Systems

- .1 Re-establish objects and items relocated by the Contractor's workforce to facilitate work.
- .2 Re-establish electrical, communication, HVAC and other services previously disconnected or otherwise isolated to accommodate work by this Section.
- .3 Make good at completion of work, all damage not identified in pre-removal survey.

PART 2 PRODUCTS AND FACILITIES

2.1 Materials and Equipment

- .1 Refer to the Sections identified in Related Work for specified materials, equipment or facilities specific to each phase or work area.
- .2 Materials and equipment must be in good condition and free of debris and fibrous materials. Disposable items must be of new materials only.
- .3 <u>Airless Sprayer:</u> AC powered pressure washer that allows wetting agent to mix with water, uses no air or compressed air, and has a nozzle to regulate power and pressure.
- .4 <u>Amended Water:</u> Water with wetting agent added for purpose of reducing surface tension to allow thorough wetting of materials.
- .5 <u>Asbestos Waste Container:</u> A container acceptable to disposal site, Ministry of the Environment, and Ministry of Labour, comprised of the following:
 - .1 Dust tight.
 - .2 Suitable for the type of waste.
 - .3 Impervious to asbestos.
 - .4 Identified as asbestos waste.
- .6 <u>Discharge Ducting</u>: Polyethylene Tubing. Reinforced with wire. Diameter to equal negative pressure machine discharge. Not to be longer than required, or so long that negative pressure is compromised.
- .7 <u>HEPA Filtered Negative Pressure Machine</u>: Portable air handling system which extracts air directly from the Abatement Work Area and discharges the air to the exterior of the building. Equipped as follows:
 - .1 Prefilter and HEPA filter. Air must pass HEPA filter before discharge.
 - .2 Pressure differential gauge to monitor filter loading.
 - .3 Auto shut off and warning system for HEPA filter failure.
 - .4 Separate hold down clamps to retain HEPA filter in place during change of prefilter.
- .8 <u>HEPA Vacuum</u>: Vacuum with necessary fittings, tools and attachments. Discharged air must pass through a HEPA filter.
- .9 <u>Hose:</u> Leak-proof, minimum busting strength of 500 PSI or greater if required, abrasion resistant covering, reinforcing, and machined-brass couplings. Maintained and tested. Hose to be temperature resistant if it is to carry domestic hot water.
- .10 <u>Lead Waste Container:</u> An impermeable container acceptable to disposal site and Ministry of the Environment, that is:

.1 Dust tight.

- .2 Suitable for the type of waste.
- .3 Evaluated for leachable lead content, and disposed of in accordance with applicable regulations.
 - .1 Where lead waste exceeds 5.0 mg/L of lead in the TCLP analysis, label as lead waste and dispose of as leachate toxic hazardous waste.
 - .2 Where lead waste is below 5.0 mg/L of lead in the TCLP analysis, disposed of as construction waste.
- .11 <u>Polyethylene Sheeting</u>: 6 mil (0.15 mm) minimum thickness unless otherwise specified, in sheet size to minimize joints.: 6 mil (0.15 mm) minimum thickness unless otherwise specified, in sheet size to minimize joints.
- .12 <u>Post Removal Sealant (or Lockdown):</u> Sealant that when applied to surfaces serves the function of trapping residual asbestos fibres or other dust. Product must have flame spread and smoke development ratings both less than 50. Product shall leave no stain when dry. Post Removal Sealant shall be compatible with replacement insulation or fireproofing where required and capable of withstanding service temperature of substrate. Apply to manufacturer's instructions.
- .13 <u>Protective Clothing</u>: Disposable coveralls complete with head covering and full body covering that fits snugly at the ankles, wrists and neck.
- .14 <u>Rip-Proof Polyethylene Sheeting</u>: 8 mil (0.20 mm) fabric made up from 5 mil (0.13 mm) weave and two (2) layers of 1.5 mil (0.05 mm) poly laminate or approved equal. In sheet size to minimize on-site seams and overlaps.
- .15 <u>Sprayer:</u> Garden type portable manual sprayer or water hose with spray attachment if suitable.
- .16 <u>Tape:</u> Duct tape or tape suitable for sealing polyethylene to surfaces under both dry and wet conditions in the presence of Amended Water.
- .17 <u>Wetting Agent</u>: Non-sudsing surfactant added to water to reduce surface tension and increase wetting ability.

PART 3 EXECUTION

.1 Refer to the Sections identified in Related Work for specified procedures for work area preparation, maintenance, site dismantlement, application of lock-down agent and all other procedures for the safe handling, removal and clean-up of hazardous materials specific to each phase or work area.

END OF SECTION

\PIN-HAM-FS02\job\352203.000 HAMILTON-WENT, Various2025Pr, HAZ, CONS\0352293.002 HWDSB, Lake Ave, GymWRReno, HAZ, ASSMT\Deliverables\Specs\352293.002 02 81 00 General Provisions Lake Ave HWDSB Feb 27 2025.docx

PART 1 GENERAL

1.1 General and Related Work

- .1 Read this Section in conjunction with all drawings and all other Sections so as to comply with the requirements of the General Conditions of the Contract.
- .2 Requirements specified elsewhere:
 - 1 Section 02 81 00 Hazardous Materials General Provisions

1.2 Outline of Work

- .1 Refer to Section 02 81 00 Hazardous Materials General Provisions for the Outline of Work.
- .2 The intent of this Section is to provide safe work practices and procedures to govern the handling, removal, clean-up and disposal of asbestos-containing materials following Type 1 or Low Risk procedures, and Pinchin and Owner specific requirements.

1.3 Personal Protection

- .1 Protect all personnel at all times when possibility of disturbance of ACM exists.
 - .1 Provide non-powered half-face respirators with P100 high efficiency (HEPA) cartridge filters when requested by personnel.
 - .2 When requested by personnel, provide protective clothing.
- .2 Provide protective clothing, to all personnel entering the Abatement Work Area.
- .3 Wear hard hats, safety shoes and other personal protective equipment required by applicable construction safety regulations.

1.4 Inspections

- .1 Refer to Section 02 81 00 General Provisions.
- .2 The following Milestone Inspections are to be scheduled:
 - .1 Milestone Inspection Clean Site Preparation
 - .2 Milestone Inspection Bulk Removal Inspection
 - .3 Milestone Inspection Visual Clearance

PART 2 PRODUCTS AND FACILITIES

.1 Refer to Section 02 81 00.

PART 3 EXECUTION

3.1 Site Preparation

- .1 Remove stored or non-fixed items from the Abatement Work Area including but not limited to equipment, furniture, waste etc. Store in area provided by Owner.
- .2 Moving of equipment, tools, supplies, and stored materials that can be performed without disturbing ACM will be performed by others.
- .3 Remove visible dust and friable material from all surfaces in the work area including those to be worked on, using HEPA Vacuums or wet wiping.
- .4 Install polyethylene drop sheets below areas of work.
- .5 Install polyethylene sheeting on openings in walls and floors (as required) and seal.

- .6 Install signage in clearly visible locations and in sufficient numbers to adequately warn of an asbestos dust hazard.
- .7 Isolate, at panel, and disconnect existing power supply to Abatement Work Area. Power supply to remaining areas of building must not be disrupted during work of this section.
 - .1 Lock-out/tag-out power at electrical panels.
 - .2 Mark/tag any items within or passing through the Abatement Work Area that are to remain live including but not limited to cable, conduit, wire, fixtures, equipment panels, etc.
- .8 Provide power from ground fault interrupt circuits.
- .9 Shut down HVAC systems serving the Abatement Work Area.
 - .1 Install polyethylene sheeting over openings in ducts and diffusers and seal.
 - .2 HVAC to remaining areas of building must not be disrupted during work of this section.
 - .3 System shall remain inoperative until completion of work, unless ducts can be effectively capped.
 - .4 Perform work at scheduled times after shutting down HVAC systems affecting the Abatement Work Area.
- .10 Provide amended water for wetting ACM, and adequate method of wetting (garden sprayers, airless sprayers, etc).
- .11 Without disturbing asbestos-containing materials, remove and dispose of non-hazardous materials as clean waste prior to asbestos removal work, where possible.

3.2 Maintenance of Abatement Work Area

- .1 Inspect polyethylene sheeting and ensure it is effectively sealed and taped. Repair damage and remedy defects immediately.
- .2 Inspect electrical panels and ensure locks and tags are on panels prior to entering the Abatement Work Area.
- .3 Maintain Abatement Work Area in tidy condition.
- .4 Remove any standing water on polyethylene/floor at the end of every shift.
- .5 Turn off water supply to any hoses and reduce pressure in hose, prior to leaving the Abatement Work Area at end of shift.

3.3 Asbestos Removal - General

- .1 Do not use powered tools or non-hand held tools.
- .2 Do not use compressed air to clean or remove dust or debris.
- Do not break, cut, drill, abrade, grind, sand or vibrate ACM if it cannot be wetted. Type 2 procedures would be required if the material cannot be wetted due to hazard or damage.
- .4 Wet ACM prior to work and keep ACM wet throughout the removal process.
- .5 Frequently and at regular intervals during the work, clean up dust and waste using HEPA vacuums and/or wet sweeping or mopping.
- .6 Frequently and at regular intervals, place all waste in asbestos waste containers.
- .7 Immediately upon completion of work, clean area with HEPA vacuum and/or wet sweeping or mopping.

3.4 Asbestos Removal - Vinyl Asbestos Tile

- .1 Wedge a heavy duty scraper in seam of two adjoining tiles and gradually force edge of one tile up and away from floor. Do not break off pieces of tile, but continue to force balance of tile up.
- .2 Place tile, without breaking into smaller pieces, into Asbestos Waste Container.
- .3 Force scraper through tightly adhered areas by striking scraper handle with a hammer.
- .4 Heat tile thoroughly with a hot air gun until heat penetrates through tile and softens adhesive in areas where scraper will not remove tile.
- .5 Deposit scrapings into asbestos waste disposal bag.
- .6 HEPA vacuum floor on completion of work in area.

3.5 Abatement Work Area Dismantling

- .1 Wash or HEPA vacuum equipment and tools used in contaminated Abatement Work Area to remove all asbestos contamination, or place in Asbestos Waste Containers prior to being removed from Abatement Work Area.
- .2 Place tools and equipment used in contaminated work site but not cleaned in polyethylene bags prior to removal from Abatement Work Area.
- .3 Clean polyethylene sheeting and drop sheets which with HEPA vacuum or wet cleaning methods at completion of work.
- .4 Wet drop sheets and polyethylene sheeting.
- .5 Carefully roll polyethylene sheeting and drop sheets toward the centre. As polyethylene is rolled away, immediately remove visible debris beneath with a HEPA vacuum.
- .6 Remove remaining polyethylene sheeting and tape.
- .7 Place polyethylene sheeting, drop sheets, tape, disposal clothing and other contaminated waste in asbestos waste containers, wet wipe and place in second asbestos waste container.

3.6 Waste and Material Handling

.1 Refer to Section 02 81 00.

END OF SECTION

\\PIN-HAM-FS02\job\352000s\0352293.000 HAMILTON-WENT, Various2025Pr, HAZ, CONS\0352293.002 HWDSB, Lake Ave, GymWRReno, HAZ, ASSMT\Deliverables\Specs\352293.002 02 82 00.01 Type 1 Precautions Lake Ave HWDSB Feb 27 2025.docx

1. Definitions

- 1. The following Section of this Specification are of the abbreviated type and include incomplete sentences. Definite and indefinite articles have often been omitted and sentences are written in the form of direct instructions to the Contractor without using the phrase `the Contractor shall.' Standard specifications and other quality references inserted govern materials and workmanship without using phrases `conform with,' `conformity therewith,' etc. Omitted words and phrases to be supplied in the same manner as they are when a note appears on the Drawings.
- 2. The Specifications are separated into Sections for reference convenience only. Such separation must in no instance make Owner or his Consultants arbiter to establish subcontract limits between Contractor and Subcontractor.
- 3. Provide all items, articles, materials, operations or methods listed, mentioned or scheduled on Drawings and/or in Specifications, including all labour, materials, equipment, tools, services, and incidentals necessary and required to complete the work. Responsibility for breakdown into and extension of subcontracts, including co-ordination of same, rests entirely with the Contractor.
- 4. Standard Specifications referred to are editions in force at Tender Closing Date.

2. Terminology

- 1. Consultants are the team of Architects, Engineers and other experts commissioned by the Owner, directly or indirectly, to execute design, contract documents and supervision for the project, including any of their agents or employees.
- 2. Prime Consultant is the Architect.
- 3. Contractor is the Firm or Corporation who, having signed the Agreement, has the sole legal responsibility to carry out the work shown or described in the Contract Documents for the Owner, whether contractually assigned to a Subcontractor or supplier, or not.

3. Minimum Standards

- Unless otherwise specified, work and material to conform or exceed the minimum standards set out in the editions of the Canadian Government Specification Board, Canadian Standards Associations, the Ontario Building Code, Underwriters' Laboratories of Canada, the Canadian Electrical Code, the Local Building Code in force, whichever is applicable.
- 2. Copies of Standard Specifications referred to in this Specification to be kept on the site.
- 3. The use of the name (or its abbreviation) of any of the following bodies, accompanied by the reference number of a specification of that body to mean that the entire specification of the body to apply as noted:

AISC: American Institute of Steel Construction;

ASHRAE: American Society of Heating, Refrigerating and Air Conditioning Engineers;

ASTM: American Society for Testing Materials;

CEC: Canadian Electric Code;

CGSB: Canadian Government Specification Board; CISC: Canadian Institute of Steel Construction; CRCA: Canadian Roofing Contractors' Association;

CSA: Canadian Standards Association;

OBC: Ontario Building Code;

ULC: Underwriters' Laboratories of Canada;

CLA: Canadian Lumbermen's Association.

4. Cooperation

1. Each trade to co-operate with the trades of adjacent or affected work. Supply in good time requirements affecting adjacent and underlying work in writing and items to be set or built in. Similarly, heed requirements and build-in items provided by other trades.

- 2. Take necessary precautions to protect work of other trades from contamination, marring or other damage due to application or installation processes, methods and activities.
- 3. General Contractor and each trade to co-operate with Contractors which may be assigned or selected by the Owner to perform work under Cash Allowances. Owner reserves the right to assign non-unionized labour to perform work under Cash Allowances, at Owners discretion.
- 4. Cooperate with and assist in coordinating work by Owner's own forces or other contractors engaged by the Owner, in the interest of the school.

5. Coordination

- 1. Co-ordinate the work of all trades in such a manner that each trade co-operates with the trade of adjacent work.
- Organize weekly job site meetings and send out notices stating time and place to Consultants, subcontractors, Suppliers and all others whose presence is required at the meetings.
- 3. Take note of all persons attending these meetings and submit to Consultants and Owner, Minutes of these Meetings showing any major decisions made and instructions or information required.
- 4. Co-ordinate the Work in this Contract with the work of others awarded work under Cash Allowances.

6. Building Dimensions and Co-ordination

- 1. Ensure that all necessary job dimensions are taken, and all trades are coordinated for the proper execution of the work. Assume complete responsibility for the accuracy and completeness of such dimensions, and for co-ordination.
- 2. Verify that all work, as it proceeds, is executed in accordance with dimensions and positions indicated which maintain levels and clearances to adjacent work, as set out by requirements of the drawings, and ensure that work installed in error is rectified before construction resumes.
- Check and verify all dimensions referring to the work and the interfacing of all services.
 Verify all dimensions with the trade concerned when pertaining to the work of other trades.
 Be responsible to see that Subcontractors for various trades co-operate for the proper performance of the Work.
- 4. Avoid scaling directly from the drawings. If there is ambiguity or lack of information, immediately inform the Consultant. Be responsible for any change through the disregarding of this clause.
- 5. All details and measurements of any work which is to fit or to conform with work installed shall be taken at the building.
- 6. Advise Consultant of discrepancies and if there are omissions on drawings, particularly reflected ceiling plans and jointing patterns for paving, ceramic tile, or carpet tile layouts, which affect aesthetics, or which interfere with services, equipment or surfaces. DO NOT PROCEED without direction from the Consultant.
- 7. Ensure that each Subcontractor communicates requirements for site conditions and surfaces necessary for the execution of the Subcontractor's work, and that he provides setting drawings, templates and all other information necessary for the location and installation of material, holes, sleeves, insets, anchors, accessories, fastenings, connections and access panels. Inform other Subcontractors whose work is affected by these requirements and preparatory work.
- 8. Prepare interference drawings to properly co-ordinate the work where necessitated. Refer to Section 01340.

7. Use of Premises Before Substantial Performance

1. The Owner shall have the right to enter and occupy the building, in whole or in part, for the purpose of placing fittings and equipment, or for other use, before completion of the Contract if, in the opinion of the Consultant, such entry and occupancy does not prevent or interfere with the Contractor in the performance of the Contract. Such entry shall in no way be considered as an acceptance of the Work in whole, or in part, nor shall it imply acknowledgment that terms of the Agreement are fulfilled.

8. Layout of Work

- 1. Layout work with respect to the work of all trades. Arrange mechanical and electrical work such as piping, ducts, conduits, panels, equipment and the like to suit the architectural and structural details.
- 2. Alterations necessary due to conflict and interference between trades, to be executed at no cost to the Owner unless notification is given in writing before Tender Closing Date.

9. By-Laws and Regulations

- 1. Nothing contained in the Drawings and Specifications are to be so construed as to be knowingly in conflict with any law, by-law or regulation of municipal, provincial or other authorities having jurisdiction.
- Perform work in conformity with such laws, by-laws and regulations and make any
 necessary changes or deviations from the Drawings and Specifications subsequently
 required as directed and at no cost to the Owner unless notification is given in writing
 before Tender Closing Date.
- 3. Furnish inspection certificates and/or permits as may be applicable as evidence, that installed work conforms with laws, by-laws, and regulations of authorities having jurisdiction.

10. Protection

- 1. Take necessary precautions and provide and install required coverings to protect material, work and finishes from contamination, damage, the elements, water and frost.
- 2. Make good any damage or replace damaged materials, as directed. Repairs to be made by the trade having originally installed or fabricated the damaged material, finish or item. Protect electrical equipment from water and the elements.
- 3. Protect adjacent private and public property from damage and contamination.
- 4. Protect curbs and sidewalks from damage from trucking by means of boards and the like. Repair, or pay or repair of damage to existing roads and sidewalks.
- 5. Mark glass after glazing in an acceptable manner and leave in place until final clean-up.
- 6. Protect floor finishes from construction traffic and transport of construction materials and equipment by means of 6 mm plywood panels.

11. Delivery, Handling and Storage of Materials

- 1. No storage available within the school for materials. Contractor to make necessary arrangements for storage containers as needed. Storage container location to be approved by the Owner prior to commencing project. Coordinate location of storage container/staging area with school prior to placement and protect all existing surfaces including turf, asphalt. The Contractor is fully responsible for security, or any storage containers, fencing, equipment or material stored on school premises. The Owner will not be held liable for missing or damaged items.
- 2. All deliveries to the school premises must be scheduled to arrive when no students are outside. This includes avoiding times when students are arriving, departing, or during outdoor activities.
- 3. Any maneuvering of vehicles or equipment within or around the school premises must be conducted while students are in class. This excludes maneuvering during breaks, lunch periods, or any other times when students might be outside.
- 4. All site maneuvering activities must be accompanied by a flag person to ensure the safety of students and staff.
- 5. Store materials which will be damaged by weather in suitable dry accommodation. Provide heat, as required, to maintain temperatures recommended by material manufacturer.
- Store highly combustible or volatile materials separately from other materials, and under no circumstances, within the building. Protect against open flame and other fire hazards. Limit volume of supply on the site to minimum required for one day's operations.
- 7. Handle and store material so as to prevent damage to material, structure and finishes. Avoid undue loading stresses in materials or overloading of floors.
- 8. Do not store materials in building or utilize it for construction purposes in any manner which would exceed design loading on any building element. Temporarily support or strengthen parts of the structure subjected to excessive loads during construction.
- 9. Do not store material and equipment detrimental to finished surfaces within areas of the building where finishing has commenced or has been completed. No storage will be available within the school. Contractor to make necessary arrangements exterior to the school in storage containers as needed. Coordinate locations with school prior to placement and protect all existing surfaces.
- 10. Deliver package material in original, and Storage of unopened and undamaged containers with manufacturer's labels and seals intact.

12. Debris

1. Assign clean-up duties to a crew with own Foremen which will be of sufficient size to prevent accumulation of debris and dirt in any part of the structure or on the site.

- 2. Remove Construction Debris daily and dispose of this debris in a legal manner so as to avoid causing hazards to occupants and visitors on site.
- 3. Under no circumstances should debris, rubbish or trash be burned or buried on the site.
 - Do not dispose of any waste in the Owner's facilities unless Owner authorized. Under no circumstances shall the Contractor use the school's garbage disposal containers including those in the classrooms and interior spaces of the school.
 - Perform a scan of the ground areas adjacent to the work area by use of metal detector/magnetic sweeper daily. Any construction debris is to be removed from the grounds on a daily basis.
 - Pathways used to access exterior waste bins for demolition should take precautions to ensure routes are protected and cleared of any debris.

13. Cutting, Fitting and Patching

- 1. Required cutting to be done by General Contractor. Patching and painting of work to be executed by the General Contractor.
- 2. All sub-trades are to notify the General Contractors bidding as to the extent of the cutting, patching, and painting of their respective trades.
- 3. Drilling, cutting, fitting and patching necessary due to failure to deliver items to be built-in time, or installation in wrong location to be executed, as directed, at no cost to the Owner.
- 4. Give written notification prior to commencement of drilling and cutting of load bearing structural members and finished surfaces.
- 5. Cut holes with smooth, true, clean edges, after they are approved by applicable trade. Size holes and openings for hot water and steam pipes, so as to allow for expansion and contraction of such pipes.

14. Fastenings

- 1. Supply all fastenings, anchors and accessories required for fabrication and erection or work.
- 2. Metal fastenings to be of the same material as the metal component they are anchoring, or of a metal which will not set up an electrolysis action which would cause damage to the fastening or metal component under moist conditions.
- 3. Exposed metal fastenings and accessories to be of the same texture, color, and finish as base metal on which they occur. Keep to a minimum; evenly space and lay out.
- 4. Fastenings to be permanent, of such a type and size and installed in such a manner to provide positive anchorage of the unit to be secured. Wood plugs are not acceptable. Install anchors at required spacing to provide required load bearing or shear capacity.
- 5. Power actuated fastenings are not to be used without prior written approval for specific use.

15. Surplus Materials

- 1. Surplus materials specifically so specified, to remain property of the Owner and be neatly stockpiled or stored, as directed.
- 2. All other surplus materials to become property of the Contractor; to be removed from the site and legally disposed of.

16. Documents Required and General Duties

1. At Commencement of Contract

- .1 The Owner has paid for the cost of the Building Permit. Mechanical Subcontractor will pay the cost of other Fees related to the Work Specified under Mechanical Scope. Electrical Subcontractor will pay the cost of all permits and fees related to the Work specified under Electrical Scope.
- .2 The General Contractor is to pay all other fees and refundable deposits if Applicable

2. **During Construction**

- .1 Organize Job Meetings in accordance with Section 01200.
- .2 Supply Monthly Progress Reports and Construction Schedule in accordance with Section 01200.
- .3 Confirm that payments are being made to subcontractors and suppliers by submission of receipts with the second and subsequent Progress Payment Application. No payment will be made for unincorporated material on the site, unless Bill of Sale in proper format is provided.

3. Upon Completion

- 1.Upon completion of work before the Final Certificate of Payment is issued, the following to be observed, executed and submitted:
 - .1 All deficiencies to have been completed in a satisfactory manner.
 - .2 All final clean-up to have been executed, as specified in Section 01710.
 - .3 Finishing Hardware, Inspection and Verification.
 - .4 Organize a Final Inspection tour at which to be present:
 - the Owner's authorized representative:
 - the Architectural, Structural, Mechanical and Electrical Consultants, and their supervisory personnel, if any;
 - the Contractor and his superintendent.
 - .5 Where the above procedure is impossible or where any deficiencies remain outstanding, the Owner's representative and the Consultant concerned, to inspect and accept the affected work and/or material upon notification by the Contractor, that all deficiencies involving this Consultant have been made good.
 - .6 A complete release of all liens arising out of this Contract, other than his own. If a subcontractor or supplier refuses to furnish a release of such a lien, furnish a bond satisfactory to the Owner to indemnify him against any claim under such a lien.
 - .7 Clearance Certificates from the Workplace Safety and Insurance Board, for the

General Contractor and all Subcontractors.

- .8 All reference records, as specified, under Section 01720.
- .9 Certificate of Inspection from Mechanical and Electrical Engineers.
- .10 Copies of all Lists of Deficiencies with each Deficiency verified when complete by only this project's job Superintendent. The Final List of Deficiencies to be signed, completed by all concerned, if accepted.
- .11 Statement of Completion from General Contractor.
- .12 Final adjustment of all Allowances.
- .13 H.E.P.C. Inspection Certificate and all other Inspection Certificates required by Provincial, Municipal and other authorities having jurisdiction.
- .14 Balancing Reports.
- .15 As-Built Drawings. –Digital pdf files and AutoCAD v2018 or higher.
- .16 A softcopy of Operation and Maintenance Manuals. A digital copy (pdf file) of all closeout documents.

17. Progress Reports

- Submit to the Architect, Monthly Progress Reports consisting of a concise narrative and a
 marked-up summary schedule showing physical percentage complete by item and in
 total. These progress calculations must agree with the Progress Payment Claims.
- 2. Keep permanent written daily records on the site on the progress of work. Record to be open to inspection at reasonable times and copies to be furnished upon request. Records to show notes of commencement and completion of different trades and parts of work; daily high and low temperatures and other weather particulars; number of men engaged on the site (including sub-trades) broken down in groups for each type of construction work, and particulars about excavation and shoring; erection and removal of form work; pouring and curing of concrete; floor finishing; placing and compaction of backfill, masonry work; roofing.
- 3. Daily progress to give particulars on commencement and completion of each trade or part of work; form work erections and removal; concrete pouring and curing; floor finishing; masonry work; roofing; waterproofing; finishing trades, tests and inspection and the like.

18. Inspection and Testing

1. The contractor is responsible to provide his own quality control in order to meet or exceed the requirements of specified standards, codes, design criteria and referenced documents.

End of Section

Meeting and Progress Records

1. Project Meetings for Coordination

- Following the pre-construction meeting/construction phase kick-off meeting, arrange for site meetings every 2 weeks as appropriate to the stage of construction, for project coordination. Such meetings shall fall at the same time each week the meeting is scheduled. Prior to substantial performance, meetings shall be scheduled for every week in an effort to effectively complete all obligations under the contract in a timely manner.
- General contractor's site supervisor and project manager as well as other responsible representatives of the Contractor's and Subcontractor's office and field forces and suppliers shall be obliged to attend.
- 3. Inform the Owner, Consultant, and those others whose attendance is obligatory, of the date of each meeting, in sufficient time to ensure their attendance.
- 4. Provide physical space for meetings within the construction office, prepare an agenda, chair and record the minutes of each meeting. Relevant information must be made available to all concerned, in order that problems to be discussed may be expeditiously resolved. Identify "action by: ______".
- 5. Within three days after each meeting, distribute digital copies of the minutes to each invited person, regardless of attendance.

2. Pre-construction Meeting

1. Within 5 days after award of Contract, request a meeting of parties in contract to discuss and resolve administrative procedures and responsibilities.

3. Project Meetings for Progress of Work

- 1. Conduct progress meetings in accordance with the schedule and/or decisions made at Pre-construction meeting.
- 2. Inform the Owner, Consultant, project consultants, Subcontractors and suppliers and those whose attendance is obligatory, of the date of the meeting, in sufficient time to ensure their attendance.
- 3. Include in the agenda the following:
 - .1 Review, approval of minutes of previous meeting.
 - .2 Review of Work progress since previous meeting.
 - .3 Field observations, problems, conflicts.
 - .4 Problems which impede construction schedule.
 - .5 Review of off-site fabrication delivery schedules.
 - .6 Corrective measures and procedures to regain projected schedule.
 - .7 Revisions to construction schedule.
 - .8 Progress during the preceding work period.
 - .9 Look ahead for the succeeding two-week work period.

Meeting and Progress Records

- .10 Review submittal schedules: expedite as required.
- .11 Maintenance of quality standards.
- .12 Pending changes and substitutions.
- .13 Review proposed changes for effect on construction schedule and on completion date.
- .14 Other business

4. Progress Records

- 1. Maintain a permanent written record on the site of the progress of the work using standard OGCA form. This record shall be available to the Consultant at the site, and a copy shall be furnished to same on request. The record shall contain:
 - .1 Daily weather conditions, including maximum and minimum temperatures.
 - .2 Dates of the commencement and completion of stage or portion of the work of each trade in each area of the project.
 - .3 Conditions encountered during excavation.
 - .4 Dates of erection and removal of formwork, in each area of the project.
 - .5 Dates of pouring the concrete in each area of the project, with quantity and particulars of the concrete.
 - .6 Work force on project daily per trade.
 - .7 Visits to site by personnel of Consultant, Jurisdictional Authorities and testing companies.

End of Section

1. General

- 1. Submit to the Architect and the Owner, for review, shop drawings, product data and samples specified.
- 2. Until the submission is reviewed, work involving relevant products must not proceed.

2. Shop Drawings

- 1. Drawings to be originals prepared by Contractor, Subcontractor, Supplier or Distributor, which illustrate the appropriate portion of work; showing fabrication, layout, setting or erection details as specified in appropriate Sections.
- 2. Identify details by reference to sheet and detail numbers shown on Contract Drawings.
- 3. Maximum sheet size 24" x 36" as a PDF.
- 4. General Contractor shall provide and maintain an up-to-date shop drawing tracking log, which shall be reviewed at each construction meeting.

3. Project Data

- 1. Certain specification Sections specify that manufacturer's standard schematic drawings, catalogue sheets, diagrams schedules, performance charts, illustrations and other standard descriptive data will be accepted in lieu of shop drawings.
- 2. Above will only be accepted if they conform to following:
 - .1 Delete information which is not applicable to project.
 - .2 Supplement standard information to provide additional information applicable to project.
 - .3 Show dimensions and clearances required.
 - .4 Show performance characteristics and capacities.
 - .5 Show wiring diagrams (when requested) and controls.

4. Coordination of Submissions

- 1. Review shop drawings, product data and samples prior to submission.
- 2. Verify:
 - .1 Field measurements.
 - .2 Field construction criteria.
 - .3 Catalogue numbers and similar data.
- 3. Coordinate each submission with requirement of work and Contract documents. Individual shop drawings will not be reviewed until all related drawings are available.
- 4. Contractor's responsibility for errors and omissions in submission is not relieved by Architect's review of submittals.

- Contractor's responsibility for deviations in submission from requirements of Contract documents is not relieved by Architect's review of submission, unless Architect gives written acceptance of specified deviations.
- 6. Notify Architect, in writing at time of submission, of deviations from requirements of Contract documents.
- 7. After Architect's review, distribute copies.

5. Submission Requirements

- 1. Schedule submissions at least fourteen (14) days before dates that reviewed submissions will be required to be returned.
- 2. Submit a digital copy (PDF) of shop drawings, product data to Architect and Owner for review.
- 3. Accompany submissions with transmittal letter, in duplicate, containing:
 - .1 Date.
 - .2 Project title and number.
 - .3 Contractor's name and address.
 - .4 Number of each shop drawing, product data and sample submitted.
 - .5 Other pertinent data.
- 4. Submissions must include:
 - .1 Date and revision dates.
 - .2 Project title and number.
 - .3 Name of:
 - .1 Contractor.
 - .2 Subcontractor.
 - .3 Supplier.
 - .4 Manufacturer.
 - .5 Separate detailer when pertinent.
- 5. Identification of product or material.
 - .1 Relation to adjacent structure or materials.
 - .2 Field dimensions, clearly identified as such.
 - .3 Specification Section number.
 - .4 Applicable standards, such as CSA or CGSB numbers.
 - .5 Contractor's stamp, initialled or signed, certifying review of submission, verification of field measurements and compliance with Contract documents.
- 6. Interference Drawings
 - .1 Prepare interference drawings for all work in confined space ie: ceiling space.

End of Section

1. Access

1. Provide and maintain adequate service roads to project site to provide safe and convenient access for deliveries.

2. Storage Sheds

- 1. Provide adequate weather-tight sheds with raised floors, for storage of materials, tools and equipment. Coordinate location with Owner and obtain approval.
- 2. The contractors and/or subcontractors are not permitted to use school spaces/areas for storage at any time.
- 3. Storage shed to be within fast fence compound staging area to prevent vandalism. Staging area to be confirmed with Owner and Consultant prior to erecting area.

3. Sanitary Facilities

- 1. Provide portable toilets and other washroom facilities as required. Coordinate location with Owner and obtain approval. Keep area and premises in sanitary condition.
- 2. The contractors and/or subcontractors are not permitted to use school sanitary facilities at any time.
- 3. Provide portable toilets in the approved staging area and coordinate with the Owner for the location. Keep them clean and stocked, and lock them when not in use and only allow access when contractors are on-site. Keep area and premises in sanitary condition.

4. Parking

- 1. The contractors and/or subcontractors are responsible for coordinating parking with the local municipality.
- The contractors and/or subcontractor are not permitted to use the school parking lots during the months of September to June. The school parking lots can be used for construction during the months of July and August. Coordinate use of spaces with Owner and obtain approval.

5. Site Enclosures

1. Erect temporary site enclosures, hoarding, using prefabricated lock fence system. Fencing shall be mechanically fastened to the ground using secure spikes on the construction side of the fence. Alternatively, construction fencing shall be mechanically fastened to the vertical t-bar piled into the ground. The ground shall be repaired to its original condition matching adjacent surfaces once the fence is no longer required and removed off site. Exterior fencing shall include visual barrier using geotextile fastened to the fence. Access into this fenced area shall be controlled by the general contractor. Maintain fence at all times for the duration of the project.

- 2. Interior hoarding walls shall be erected at all locations where existing occupied spaces are in the vicinity and adjacent to the construction area. All interior hoarding walls shall be constructed using stud framing and drywall. Alternatively, good-one-side plywood can be used. All hoarding walls shall include a properly latching and lockable man door complete with locking handset/lever or orbit hardware. Access through this door shall be controlled by the general contractor. Maintain hoarding walls at all times for the duration of the project.
- 3. Size and location of enclosure to suit area of construction.

6. Enclosure of Structure

- 1. Provide temporary weather-tight enclosures protection for exterior openings until permanently enclosed.
- 2. Erect enclosures to allow access for installation of materials and working inside enclosures.
- 3. Design enclosures to withstand wind pressure.
- 4. Erect dust barriers to prevent dust migration to non-renovated areas. Provide boot dust mats at each interior connection to occupied areas from the construction entrances/exits. If contractor is not able to prevent dust migration to non-renovated areas, the contractor shall provide negative air units and maintain for the duration of the project until such time where dust migration can be prevented.

7. Power supply

1. Electrical power is available in existing building and will be provided at no charge for construction purpose.

8. Water Supply

1. Water is available in existing building and will be provided at no charge for construction purpose.

9. Scaffolding

- 1. Construct and maintain scaffolding in rigid, secure and safe manner.
- 2. Erect scaffolding independent of walls. Remove promptly when no longer required.
- 3. Scaffolding to be designed by a professional Engineer when required under the Occupational Health and Safety act.

10. Heat and Ventilating

1. Not applicable.

1. Construction Safety Measures

- 1. Observe and enforce construction safety measures required by the National Building Code; the O.B.C.; The Provincial Government; Workplace Safety & Insurance Board; and Municipal authorities.
- 2. In particular, the Occupational Health and Safety Act (O. Reg. 213/91), the regulations of the Ontario Ministry of Labour and Ontario Electrical Safety Code shall be strictly enforced.
- 3. Contractor shall ensure that copies of all applicable construction safety regulations, codes and standards are available on the job-site throughout the period of construction. All workers are to be informed that these documents are available for reference at any time.
- 4. The Contractor shall be considered as the "Constructor" in consideration of the rights and responsibilities for all construction safety requirements, procedures, facilities and inspection of all work performed by the Contractor, Subcontractors/Sub-trades and other Contractors engaged on this project.
- 5. In the event of a conflict between any of the provisions of the above authorities the most stringent provisions are to be applied.

2. Safety Data Sheet

- Safety Data Sheets (SDS) must be available at the job-site for any product listed on the Hazardous Ingredients List prior to being used, installed or applied inside of the building.
- 2. A Safety Data Sheet is to be submitted to the Architect for any product which is known to create, or suspected of creating, a health hazard or discomfort during construction or upon commissioning of the project including, but not limited to, the following:
 - .1 adhesives
 - .2 solvents
 - .3 sealants, (caulking, vapour seals, etc.)
 - .4 sprayed-on fireproofing
 - .5 resilient flooring
 - .6 carpet, paint, varnish or other coatings
 - .7 exposed membrane waterproofing
 - .8 special coatings, (terrazo sealants, chafing coatings, etc.)
 - .9 solder, brazing and welding and other filler metal
 - .10 other products whose particles or vapours may become air borne after installation.
 - .11 any other product as directed by the Consultant.
- 3. Comply with WHMIS regulation, Workplace Hazardous Material Information System.

3. Fire Safety Requirements

1. Comply with requirements for Building Construction, the Ontario Building Code, the Ontario Fire Code, the requirements of Local Fire Authorities and of the requirements of the Office of the Fire Marshal.

4. Overloading

1. Ensure no part of Work is subjected to a load which will endanger its safety or will cause permanent deformation.

5. Falsework

1. Design and construct falsework in accordance with the CSA S269.1

6. Scaffolding

- 1. Design and construct scaffolding in accordance with CSA Z797.
- 2. Scaffolding to be designed by a Professional Engineer when required under the Occupational Health and Safety Act.

7. Materials Specifically Excluded

- 1. Asbestos and/or asbestos-containing products are not permitted. Submit Safety Data Sheets for any product suspected of containing asbestos if so requested by Consultant. Examples of some materials requiring close scrutiny and/or confirmation include:
 - .1 Transite drainage pipe whether buried or above grade not permitted.
 - .2 Composite floor tile containing asbestos not permitted.
 - .3 Lay-in ceiling tiles containing asbestos not permitted.
 - .4 Insulation and/or jacketing for pies, ducts, motors, pumps, etc. not permitted if any asbestos is present.
- 2. Solder for all piping is to be lead-free.
 - .1 "Lead Free" shall mean solder which contains less than 0.030% of lead when dissolved in fluoroboric and nitric acids and tested by inductively coupled argon plasma atomic emission spectroscopy. "Steelbond 281" and "Silverbrite" are acceptable solder products.
 - .2 The mechanical contractor shall provide an affidavit signed by the Principal of the company, on company letterhead, that all of the solder used on the project was either one of the two acceptable products or that the solder used (identified by brand name) meets or exceeds the testing criteria.
 - .3 The Owner shall undertake random testing of the soldered joints. Should testing prove that the solder used was not as specified, the Owner shall take action against the contractor to the full extent of the law.
- 3. All paint and finish coatings are to be lead and mercury-free. Submit Material Safety Data Sheets confirming that these products are free of all lead and/or mercury compounds.

PART 1 - GENERAL

1.1 Related Work

- 1. These specifications apply to all 16 divisions of the project specification. It is the responsibility of the contractor to apply these provisions wherever practical within specification limits to all products and services used on this project.
- 2. It is recognized that currently specified materials and methods may conflict with the basic intention of this section. Where reasonable alternate materials and methods exist that are not specified here, and that do not compromise quality or create additional cost for the owner, notify the Architect of such alternate materials or methods. Do not proceed to use alternate materials or methods to those specified without the express approval of the Architect.
- 3. Elsewhere, apply the provisions of this section to all work. Exceptions can only be made when signed off by the Architect. Suitability of all products used is the responsibility of the contractor.

1.2 Compliance Specifications

1. The contractor must comply with all applicable health, safety and environmental regulations.

1.3 Beyond Compliance Specifications

- 1. These specifications apply in addition to all applicable health, safety and environmental compliance regulations. They are incorporated here to reflect the Owner's intention to develop a specification which maximizes environmentally "friendly" materials and methods wherever possible within current technical and budget limitations.
- Beyond compliance specifications recognize that performance well beyond the minimum regulatory standard is often desirable, possible and affordable, often with no cost or low cost options. It also recognizes that application methods or protocols may be as important as the material specified. Therefore these specifications cover both material and methods.
- 3. The primary goal of beyond compliance specification is to reduce the use of products or methods which have negative health and environmental impacts both during and after construction. These considerations may include full life cycle impacts, associated with raw materials, manufacturing, transport, deconstruction and their eventual fate.
- 4. These specifications will specifically address primary categories of readily identifiable products, ingredients and methods.
- 5. These provisions apply to both indoor and outdoor applications equally.

1.4 Exceptions

These specifications recognize that not all substitutes are equal and therefore
exceptions can be made based on substantive evidence of necessary and superior
performance. Special considerations may be given to restricted substances when
secondary provisions are made such as sealed in place (contained) applications. All
such exceptions must be approved in writing by the Architect.

PART 2 - MATERIALS

2.1 Products or Substances to be Avoided or Limited in Use

1. No product containing the following substances may be used on this project when an equivalent product without or with a lower concentration of this substance is suitable and available. All products containing substances which are known to cause health effects including but not limited to cancer, mutagenic, neurological, or behavioral effects should be avoided if suitable substitutes not containing or containing lower concentrations are available. This provision shall be limited to information contained on Safety Data Sheets, therefore SDS sheets must be reviewed for all products for which such sheets are required. Applications for exceptions must be accompanied by related SDS and product application and performance sheets, clearly showing a need for the exception.

2.2 Volatile Organic Compounds

 No product containing volatile organic compounds (in over simplified terms volatile petro chemical or similar plant derived solvents) may be used on this project when a suitable non VOC or failing that a low VOC substitute is available. Manufacturers may refer to the U.S. EPA definition of VOC's for guidance or alternatively use the low molecular weight organic compound descriptor.

Example: Paints, Coatings, Primer, Adhesives, Chalks, Firestops, etc.

2. Waterborne equivalents are available for most of the solvent borne products used in construction and in most cases would be the preferred alternative. Waterborne products may in some instances have high VOC contents, therefore the fact that a product is waterborne does not automatically make it acceptable.

2.3 Chlorinated Substances

1. Poly Vinyl Chloride (vinyl) and other chlorinated products should be avoided if suitable substitutes are available.

2.4 Plasticizers

1. Plasticisers which offgass (low molecular weight) should be avoided.

2.5 Man Made Mineral Fibres

1. Products containing mineral fibres which can be emitted or abraded should be avoided.

Examples: duct liner, mineral fibre ceiling tiles, etc.

2.6 Radiation

1. Products or methods which result in the lowest emission of Electro Magnetic Fields are preferred.

2.7 Biocides

 Products containing biocides (pesticides, miticides, mildeweides, fungicides, rodenticides, etc.) are not to be used if suitable alternatives are available. Highly stable, low human toxicity biocides such as Portercept may be acceptable substitutes. Biocide formulas which break down, emit powders of offgass should be avoided.

2.8 Heavy Metals

1. Heavy metals such as lead, cadmium, mercury etc. should be avoided.

2.9 Aluminum

1. Raw aluminum should be avoided, anodized or factory painted aluminum is acceptable. This is particularly applicable to surfaces which people can touch.

2.10 Ozone Depleting Substances

 Products which contain or which use Ozone Depleting Substances such as Bromide, Chlorofluorocarbons (CFC) or Hydrofluorocarbons (HFC) etc. should be avoided if suitable substitutes are available.

2.11 Greenhouse Gasses

1. Products which contain, use or generate Greenhouse gasses such as CO2 should be avoided if suitable substitutes are available.

2.12 Bituminous (tar) Products

1. Products containing tar compounds should not be used if suitable substitutes are available.

2.13 Chemical Compounds

1. Products containing the following chemical compounds should not be used if suitable substitutes are available: Neoprene, Latex, Butyl, ABS, Formaldehyde.

Health and Environmental Specifications

Section 01570 Page 4 of 4

2.14 Adhesives

1. Adhesives containing solvents or other non preferred ingredients should be avoided if suitable substitutes are available, including systems designs which do not need adhesives or can use mechanical etc. fastening alternatives

2.15 Composite Products

1. Some composite products contain adhesives such as formaldehyde which are not preferred, and some composites such as Fibre Reinforced Plastics are not practical for recycling. These products should be avoided if suitable substitutes are available.

2.16 Cleaners and Solvents

 Products, equipment, and methods which require the use of cleaners and solvents are not preferred if suitable substitutes are available. Examples of preferred products would include No Wax floors, or primerless caulks and adhesives, or products not requiring caulks and adhesives.

End of Section

1. General

- 1. Conduct cleaning and disposal operations to comply with local ordinances and antipollution laws.
- 2. Store volatile waste in covered metal containers and remove from premises daily.
- 3. Prevent accumulation of waste, which create hazardous conditions.
- 4. Provide adequate ventilation during use of volatile or noxious substances.
- 5. At no time shall waste be stored inside the school building. All waste and waste containers must be separated from general public and school occupants using properly secured and locking construction hoarding.

2. Materials

- 1. Use only cleaning materials recommended by manufacturer of surface to be cleaned, and as recommended by cleaning material manufacturer.
- 2. Provide on-site construction specific dump containers for collection of waste materials, and rubbish. The school waste bins, and garbage collection shall not be used to dispose of construction related waste materials, debris and/or rubbish.

3. Cleaning During Construction

- 1. Maintain project grounds, and public properties free from accumulations of waste materials and rubbish.
- 2. Remove waste materials, and rubbish from site.
- 3. Vacuum clean interior building areas when ready to receive finish painting and continue vacuum cleaning on an as-needed basis until building is ready for substantial completion or occupancy.
- 4. Schedule cleaning operations so that resulting dust and other contaminants will not fall on wet, newly painted surfaces.

4. Final Cleaning

- At completion of Work, remove waste materials, rubbish, tools, equipment, machinery, and surplus materials, and clean all surfaces and leave project clean and ready for occupancy.
- 2. Employ experienced professional cleaners, for final cleaning.
- 3. In preparation for Substantial Performance or Fitness for Occupancy status, whichever occurs first, conduct final inspection of interior and exterior surfaces and of concealed spaces.

- 4. Remove grease, dust, dirt, stains, labels, fingerprints, and other foreign materials from all interior and exterior finished surfaces; polish resilient and ceramic surfaces so designated to shine finish. Vacuum carpet.
- 5. Clean and polish glass and mirrors.
- 6. Repair, patch and touch-up marred surfaces to specified finish and to match new adjacent surfaces.
- 7. Broom-clean, magnet roll, and pressure wash all concrete and asphalt paved surfaces; rake clean other surfaces of grounds.
- 8. Clean exposed ductwork and structure.
- 9. Replace filters.
- 10. Clean bulbs and lamps and replace those burned out.
- 11. Clean diffusers and grilles.
- 12. Clean sinks, faucets, and water closets and controls.
- 13. Maintain cleaning until project, or portion thereof, is occupied by Owner.

End of Section

1. Requirements Included

- 1. Record documents, samples, and specifications.
- 2. Equipment and systems.
- 3. Product data, materials and finishes, and related information.

2. Quality Assurance

1. Prepare instructions and data by personnel experienced in maintenance and operation of described products.

3. Format

- 1. Organize data in the form of an instructional manual.
- 2. Correlate data into related consistent groupings.
- 3. Cover: Identify each section with type or printed title "Project Record Documents", list title of Project, identify subject matter of contents.
- 4. Arrange content in folders under Section numbers and sequence of Table of Contents.
- 5. Provide separate folder for each separate product and system, with typed description of product and major component parts of equipment.

4. Contents, Each Volume

- 1. Table of Contents: Provide title of project; names, addresses, and telephone numbers of Consultant and Contractor with name of responsible parties; schedule of products and systems, indexed to content of the volume.
- 2. For each Product or System: list names, addresses and telephone numbers of subcontractors and suppliers, including local source of supplies and replacement parts.
- 3. Product Data: mark sheet to clearly identify specific products and component parts, and data applicable to installation; delete inapplicable information.
- 4. Drawings: supplement product data to illustrate relations of component parts of equipment and systems, to show control and flow diagrams.
- 5. Typed Text: as required to supplement product data. Provide logical sequence of instructions for each procedure, incorporating manufacturer's instructions.

5. Submission

 Submit for review a digital pdf file of completed closeout documents in final form 15 days prior to substantial performance. For equipment put into use with Owner's permission during construction, submit Operating and Maintenance Manuals within 10 days after start-

- up. For items of Work delayed materially beyond date of Substantial Performance, provide updated submittal within ten days after acceptance, listing date of acceptance as start of warranty period.
- 2. Consultant comments will be returned, and the contractor is to revise the content of documents as required prior to final submittal.
- 3. Submit one (1) digital copy of revised volumes of data in final form within ten days after final inspection.
- 4. For contract drawings (architectural, landscaping, structural, mechanical, electrical), transfer neatly as-built notations onto a digital set and submit to consultant.
- 5. Prepare digital pdf file for submission on USB of completed closeout documents.

6. Record Documents and Samples

- 1. In addition to requirements in General Conditions, maintain at the site for Owner one record copy of:
 - .1 Contract Drawings.
 - .2 Specifications.
 - .3 Addenda
 - .4 Change Orders and other modifications to the Contract.
 - .5 Reviewed shop drawings, product data and samples.
 - .6 Field test records.
 - .7 Inspection certificates.
 - .8 Manufacturer's certificates.
- 2. Store Record Documents and Samples in Field Office apart from documents used for construction. Provide files, racks, and secure storage.
- 3. Label and file in accordance with Section number listings in List of Contents of this Project Manual. Label each document "Project Record" in neat, large, printed letters.
- 4. Maintain Record Documents in a clean, dry, and legible condition. Do not use Record Documents for construction purposes.
- 5. Keep Record Documents and samples available for inspection by Consultant.

7. Recording As-Built Conditions

- The consultant will provide electronic copies of project drawings in PDF format. Make one
 (1) hardcopy of the project drawings for the purpose of recording as-built conditions. Mark
 and record changes on an on-going basis as construction proceeds. Near the end of the
 construction period transfer all marks to the supplied electronic documents and
 submit for consultant review as project record as-built documents.
- 2. Refer to drawings/specifications for additional mechanical and electrical requirements.
- 3. Record information concurrently with construction progress. Do not conceal work until required information is recorded.
- 4. Contract Drawings and shop drawings: legibly mark each item to record actual construction, including:
 - .1 Measure depths of elements of foundation in relation to finish first floor datum.
 - .2 Measured horizontal and vertical locations of underground utilities and appurtenances, referenced to permanent surface improvements.
 - .3 Measured locations of internal utilities and appurtenances, referenced to visible and accessible features of construction.
 - .4 Field changes of dimension and detail.
 - .5 Changes made by change orders.
 - .6 Details not on original Contract Drawings.
 - .7 References to related shop drawings and modifications.
- 5. Specifications: legibly mark each item to record actual construction, including:
 - .1 Manufacturer, trade name, and catalog number of each project actually installed particularly optional items and substitute items.
 - .2 Changes made by Addenda and Change Orders.
- 6. Other Documents: maintain manufacturer's certifications, inspection certifications, field test records, required by individual specifications sections.

8. Digital As-Built Drawings

- 1. Retain the services of a CAD drafting company acceptable to the consultant to prepare digital CAD As-Built documents for all Architectural and Engineering drawings.
- After the consultant has found the Redlined As-Built drawings to be acceptable, transfer to digital file all information recorded on As-Built drawings. Layering of information as per consultant's instructions.

9. Equipment and Systems

- Each Item of Equipment and Each System: include description of unit or system, and component parts. Give function, normal operation characteristics, and limiting conditions. Include performance curves, with engineering data and tests, and complete nomenclature and commercial number of replaceable parts.
- 2. Panelboard Circuit Directories: provide electrical service characteristics, controls, and communications.

- 3. Include installed colour coded wiring diagrams.
- 4. Operating Procedures: include start-up, break-in, and routine normal operating instructions and sequences. Include regulation, control, stopping, shutdown, and emergency instruction. Include summer, winter, and any special operating instructions.
- 5. Maintain Requirements: include routine procedures and guide for troubleshooting; disassembly, repair and reassemble instructions; and alignment, adjusting, balancing, and checking instructions.
- 6. Provide servicing and lubrication schedule, and list of lubricants required.
- 7. Include manufacturer's printed operation and maintenance instructions.
- 8. Include sequence of operation by controls manufacturer.
- 9. Provide original manufacturer's parts lists, illustrations, assembly drawings, and diagrams required for maintenance.
- 10. Provide installed control diagrams by controls manufacturer.
- 11. Provide Contractor's co-ordination drawings, with installed colour coded piping diagrams.
- 12. Provide charts of valve tag numbers, with location and function of each valve, keyed to flow and control diagrams.
- 13. Provide a list of the original manufacturer's spare parts, current prices, and recommended quantities to be maintained in storage.
- 14. Include test balancing reports as specified in mechanical specifications.
- 15. Additional Requirements: As specified in individual specification sections.

10. Materials and Finishes

- 1. Building Products, Applied Materials, and Finishes: include product data, with catalog number, size, composition, and colour and texture designations. Provide information for reordering custom manufactured products.
- 2. Instructions for cleaning agents and methods, precautions against detrimental agents and methods, and recommended schedule for cleaning and maintenance.
- 3. Moisture-protection and Weather-exposed Products: include manufacturer's recommendations for cleaning agents and methods, precautions against detrimental agents and methods, and recommend schedule for cleaning and maintenance.
- 4. Additional Requirements: as specified in individual specifications sections.

11. Guarantees, Warranties and Bonds

- 1. Separate each warranty or bond keyed to the List of Contents listing.
- List subcontractor, supplier, and manufacturer, with name, address, and telephone number
 of responsible principal. Use Guarantee/Warranty Form as provided in Section 01721
 whenever standard preprinted trade or manufacturer's Guarantee/Warranty forms are not
 available.
- 3. Obtain warranties and bonds, executed in duplicate by subcontractors, suppliers, and manufacturers, within ten days after completion of the applicable item of work.
- 4. Except for items put into use with Owner's permission, leave date of beginning of time of warranty until the Date of Substantial Performance is determined.
- 5. Verify that documents are in proper form, contain full information, and are notarized.
- 6. Co-execute submittals when required.
- 7. Retain warranties and bonds until time specified for submittal.

End of Section

Sample Guarantee Warranty Form

1. Notes

- 1. To be made out on the letterhead of Guarantor or Warrantor which usually is a Subcontractor.
- 2. This format is to be used only when standard preprinted trade or manufacturer's forms are not available. Preprinted forms are to include all elements of information shown on this sample or as a minimum.
- 3. Comply with Requirements for Guarantee/Warranty as specified in <u>Section 01720</u>, <u>Article 10</u>.

To: Hamilton-Wentworth District School Board 20 Education Court Hamilton, ON L9A 0B9

Date:	
SECTION	
TITLE	
	GUARANTEE/WARRANTY TO:
OWNER	Hamilton-Wentworth District School Board
PROJECT	Lake Avenue ES Washrooms and Changerooms Renovations Project No. P02185
ARCHITECT	AMRA J Architects Inc.
REFERENCE	(to specifications or drawings)
TIME	Period of Guarantee/Warranty: years
GUARANTEE/ WARRANTY	Starting Date: Substantial Performance as certified by Architect
	Date:
(Description of G	uarantee/Warranty)

Sample Guarantee Warranty Form

Upon written notification from the Owner or the Consultant that the above work is defective any repair or replacement work required shall be to the Consultant's satisfaction at no cost to the Owner.

This guarantee shall not apply to defects caused by the work of others, maltreatment of materials, negligence or Acts of God.

SUBCONTRACTOR		 Date	
Authorized Signing Officer:	(Name Printed)		
	Title		
Name of Firm:			
Address:			
Telephone Number			
CONTRACTOR	Oi-mark mark	Dete	
Authorized Signing Officer:	Signature	Date	
Officer.	(Name Printed)		
	Title		
Name of Firm:			SEAL
Address:			
Telephone Number			
	End of Section		

1. Maintenance Manual

- 1. On completion of project, submit to the Owner one (1) digital copy of Operations Data and Maintenance Manual in English, made up as follows:
 - 1.1. Enclose title sheet, labeled "Operation Data and Maintenance Manual", project name, date and list of contents.
 - 1.2. Organize content folders into applicable sections of work to parallel project specification break-down. Mark each section by labeled folder similar to the following example:

Ш	Name
	00000 Title Page and Table Contents
	00001 Vendor Contact Forms
	00002 Warranty Forms
	202050 Demolition
	☐ 04200 Masonry
	06100 Rough Carpentry
	07270 Fire Stopping Smoke Seals Sealant
	□ 09000 Finishes
	09111 Metal Stud Systems
	09250 Gypsum Board
	09600 Flooring and Rubber Base
	09700 Epoxy Flooring
	09900 Painting
	10165 Toilet Partitions
	10800 Washroom Accessories

- 1.3. The digital copy of all documents in the operations and manuals must be provided on a USB, format to be PDF.
- 2. Include the following information, plus data specified.
 - .1 Maintenance instructions for finished surface and materials.
 - .2 Copy of hardware and paint schedules.
 - .3 Description, operation and maintenance instructions for equipment and systems, including complete list of equipment and parts list. Indicate nameplate information such as make, size, capacity, serial number.
 - .4 Names, addresses and phone numbers of sub-contractors and suppliers.
 - .5 Guarantees, Warranties and bonds showing:
 - .1 Name and address of project.
 - .2 Guarantee commencement date (date of Final Certificate of Completion).
 - .3 Duration of guarantee.
 - .4 Clear indication of what is being guaranteed and what remedial action will be taken under guarantee.
 - .5 Signature and seal of Contractor.
 - .6 Additional material used in project listed under various Sections showing name of manufacturer and source of supply.
- 3. Neatly type lists and notes. Use clear drawings, diagrams or manufacturers' literature.

Operations and Maintenance Data

- 4. Include in the Manuals a complete set of final shop drawings indicating corrections and changes made during fabrication and installation.
- 5. Include in the manuals a complete set of final as-built red line drawings. Include each drawing sheet and indicate on the title block "As-Build Drawing"

End of Section

1. General

1. **Bonds:** Refer to RFT Document for bonding requirements at time of tender submission and throughout the duration of the construction period.

2. Standard Warranty

1. Refer to Supplementary General Conditions and to Standard Contract Document CCDC No. 2, 2020 for warranty requirements and conditions for the standard warranty which is required for the work of this contract.

3. Extended Warranties

- 1. Refer to individual specification sections for requirements of extended warranties required for particular sections or items of work.
- 2. Extended warranties are required to be issued by manufacturers, fabricators, suppliers and/or installers, sometimes jointly, due to their unique position in the construction process and their ability to guarantee a particular section of work. Refer to individual requirements of extended warranties requested.
- 3. Unless specifically noted otherwise, all extended warranties shall commence on the date of Substantial Performance of the Work as certified by the Consultant.
- 4. All Extended Warranties shall be listed separately and included as a separate section in the operations and maintenance manuals provided to the Owner at project close out. Each Extended Warranty document shall include the vendor's contact information, date of warranty commencement and expiry as well as listing the specific product with extended warranty. This document shall clearly indicate if the warranty includes or excludes labour.
- 5. Listed below is a summary of extended warranties required for individual Sections. This list, if inconsistent with the specified requirements of individual extended warranties, shall be deemed correct with respect to the length of extended warranties. Extended warranties required shall include, but not be limited to, the following:

Extended warranties (total warranty period listed, including entire building warranty)
Sealants (Section 07 92 00)
5 years
Painting (Section 09 91 00)
2 years

End of Section

Appendix XX – Construction School Specific Information Sheet Sample

In addition to the terms and conditions of the Contract Documents, the Contractor shall follow the protocols of the Construction Site Specific Information Sheet, sample provided below. A completed version of this document, with site specific content, will be provided to the Contractor at the pre-construction meeting.



1. School Information:

School Name: Lake Ave Elementary School

Bell Times

Morning (School Entry): 0:00 AM
Afternoon (School Dismissal): 0:00 PM
Aftercare Program Dismissal: 6:00 PM

Caretaking Phone Number: 000-000-0000 *After-Hours Emergency Number: 905-667-3079

**Caretaking Hours

September to June 6:00 AM - 10:00 PM December Holiday Break 6:00 AM - 2:00 PM March Break 6:00 AM - 2:00 PM July to August 6:00 AM - 2:00 PM

Saturday / Sunday CLOSED

Account Code: HP0000 Security Panel Code: 0000

2. School Entry for afterhours, school holidays or closures:

Please follow these steps upon entry to the building outside of caretaker hours and on school holidays or closures:

- 1. Call API Alarm Inc. at 1-877-787-5237 and notify them in advance of the day(s) and time(s) that access to the building will be required. They will require the HP code noted above.
- 2. Disarm the security panel when arriving.
- 3. Arm the security panel when leaving.
- 4. Call API to verify that the building is armed and secure.

^{*}Please call the After-Hours Emergency Number noted above if issues arise outside of Caretaking Hours. These would include unanticipated interruption of services, issues with building or room access, fire alarm or security concerns, etc.

^{**}Caretaker hours are not guaranteed. Please confirm with the HWDSB project supervisor prior to any work taking place, and then on a weekly basis throughout the duration of the project.



Failure to follow this procedure outside of caretaker hours and on school holidays or closures will result in an automatic dispatch of a security guard to the building to verify who has entered/exited the building. Security costs associated with the dispatch of a security guard for failing to follow the procedure will be expensed to the contractor responsible for the incident.

3. Protocol for Work Impacting Fire Alarm System or Devices

The contractor is to follow this procedure when the fire alarm system is impacted.

A. References and Definitions:

Fire Alarm Control and Testing Service Provider: Hamilton Fire Control

Fire Alarm and Security System Monitoring Service Provider: API Alarm Inc.

Fire Watch: An hourly patrol of areas that are not protected/monitored by the fire alarm system. These include but are not limited to, a disconnected device, a covered device, a bypassed device, or device in trouble. The general contractor is responsible for fire watch in all construction areas. Caretaking staff are responsible for fire watch in all other areas of the school. Fire watch is to be recorded in a Fire Watch Log.

Fire Watch Log: The general contractor is to document and maintain a written log confirming fire watch has been conducted hourly. This log is to remain on site for the duration of the project. This written log is maintained separate from the caretaking fire watch log. The caretaking log is digitally recorded within the Boards asset management system (eBase).

- B. Mandatory Pre-Construction Site Meeting with Hamilton Fire Control
 - 1. Contractor to request a meeting prior to mobilization with Michael Fleet from Hamilton Fire Control (HFC), the project supervisor from HWDSB, the facility operation supervisor from HWDSB and the head caretaker to review any work that will affect the fire alarm system. This can be coordinated by the project supervisor upon request.

Contact: Michael Fleet - Hamilton Fire Control

Phone: (905) 527-7042

Email: michael@hamiltonfirecontrol.ca

- 2. Contractor to minute the meeting and submit to the project supervisor and Michael Fleet from HFC for review within 48 hours of the site-walk-through.
- C. Mandatory Construction Protocol if the Fire Alarm System is Impacted



- 1. Contractor to follow procedures discussed and documented from the pre-construction site meeting with Hamilton Fire Control.
- If devices are impacted during occupied hours:
 - Per the Fire Safety Plan, contractor to notify API that they'll be on Fire Watch (in the area of the impacted devices only). API will not take any action; the notification is for information purposes only.
 - Contractor to either take the device offline or protect/cover it. Fire watch (in the area of the
 impacted device only) is required in either of these scenarios. If the alarm goes off during work,
 all occupants, including contractors, are to evacuate the building and the fire department will be
 dispatched.

If hot work is taking place, prior to the above-noted steps:

- Contractors are required to advise HWDSB at least 24 hours before any hot work is scheduled to take place.
- The contractor is required to provide a hot work permit to HWDSB at the same time.
- 3. If devices are impacted outside of occupied hours, and the contractor is the only party in the building:
 - The same protocol above is to be followed.
- 4. If the system or specific devices will not be operational while the school is completely vacant (i.e. overnight or on a weekend when no Work is taking place):
 - No action required.

The system is not to be bypassed (device(s) or full system). The system is NOT to be put on test. The <u>only</u> time the system will be put on test and the school will be on Fire Watch is if the system is being tested.

In the event a fire alarm device is activated, all occupants of the school, including contractors, must evacuate the school. The fire department will be dispatched. The contractor will be responsible for all fire department costs resulting from construction.

- 4. Please follow these steps for planning any service (electrical, gas, water) shutdowns:
 - A. Internal Localized System/Service Shutdowns:



- 1. Localized shutdowns <u>require minimum 3 days' notice</u> to HWDSB project supervisor for coordination with the school facility and staff.
- 2. Shutdowns must be completed outside of school bell times/operational hours which vary by facility and must be scheduled for evenings after 6:00 PM, weekends or board holidays.
- 3. If a shutdown will impact the security system, the contractor shall contact API Alarm Inc. at 1-877-787-5237 and notify them in advance of the day(s) and time(s) of the shutdown.
- 4. If a shutdown impacts the fire alarm system, the contractor shall follow the Fire Alarm Bypass Protocol, section 4 above.
- 5. If required, the contractor is to coordinate with Board vendor/s to be on site to ensure boilers, roof top units, heat pumps, etc. are functioning properly after service disruption has concluded.
 - Chamberlain Building Services Inc info@chbs.ca, 905-664-1914 or
 - Union Boiler Company Limited info@unionboiler.com, 905-528-7977
- Process will vary based on services shutdown and ability to localize shutdown.
- B. Complete School System/Service Shutdowns:
 - 1. Complete building shutdowns require minimum 5 days' notice to HWDSB project supervisor.
 - 2. Shutdowns must be completed outside of school bell times/operational hours which vary by facility and must be scheduled for evenings after 6:00 PM, weekends or board holidays.
 - 3. Contractor to contact API Alarm Inc. at 1-877-787-5237 and notify them in advance of the day(s) and time(s) of shutdown.
 - 4. During the shutdown, the contractor is responsible for following Fire Alarm Bypass Protocol, section 4 above.
 - 5. The contractor is to coordinate with Board vendor/s to be on site to ensure boilers, roof top units, heat pumps, etc. are functioning properly after service disruption has concluded.
 - Chamberlain Building Services Inc info@chbs.ca, 905-664-1914
 - Union Boiler Company Limited info@unionboiler.com, 905-528-7977
 - 6. HWDSB project supervisor will coordinate with other HWDSB departments to ensure all systems (IIT, security, communications) are up and running after service disruption has concluded.
 - 7. If required, HWDSB project supervisor will coordinate with City of Hamilton staff if site has shared facilities such as recreation centre, community centre, pool or library, etc.
 - 8. Process will vary based on service shutdown.
- C. Heating and Cooling System Shutdowns:



- 1. Heating and cooling system shutdowns require minimum 5 days' notice to HWDSB project supervisor
- 2. Shutdowns must be completed outside of school bell times/operational hours which vary by facility and must be scheduled for evenings after 6:00 PM, weekends or board holidays.
- 3. The contractor is to coordinate with Board vendor/s to be on site to ensure boilers, roof top units, heat pumps, etc. are functioning properly after service disruption has concluded.
 - Chamberlain Building Services Inc info@chbs.ca, 905-664-1914
 - Union Boiler Company Limited info@unionboiler.com, 905-528-7977
- 4. If the boiler system is drained, the contractor upon refilling the system, is responsible for coordinating Board approved chemical treatment vendor to treat water.
 - Aquarian Chemicals Inc info@aquarianchemicals.com, 905-825-3711
- 5. Process will vary based on services shutdown and ability to localize shutdown.
- D. Asbestos Abatement and Designated Substance Related Work:
 - 1. Designated substance related work requires minimum 5 days' notice to HWDSB project supervisor.
 - 2. Designated substance related work in occupied areas must be completed outside of school bell times/operational hours which vary by facility and must be scheduled for evenings after 6:00 PM, weekends or board holidays.

PART 1 - GENERAL

1.1. SUMMARY

- 1.1.1. Section Includes: Provide selective removal, including but not limited to following:
 - 1.1.1.1. Change rooms washrooms and showers area
 - 1.1.1.2. Ceilings, floorings
 - 1.1.1.3. Create new entrances and access to the new washrooms and change rooms, storage
 - 1.1.1.4. Abatement as required to facilitate work.
 - 1.1.1.5. Items for Salvage: change room benches and hooks as noted on drawings

1.2. REFERENCES

- 1.2.1. Review "Designated Substance Report" and take appropriate precautions.
- 1.2.2. Definitions:
 - 1.2.2.1. Hand Demolition: Systematic demolition of structures by workers using hand-held tools.
 - 1.2.2.2. Mechanical Demolition: Systematic demolition of structures using powered equipment.
 - 1.2.2.3. Systematic Demolition: Methodical dismantling of structure piece by piece, usually carried out in reverse order of construction.
 - 1.2.2.4. Hazardous Materials: dangerous substances, dangerous goods, hazardous commodities and hazardous products, may include but not limited to: poisons, corrosive agents, flammable substances, ammunition, explosives, radioactive substances, or other material that can endanger human health or well being or environment if handled improperly.

1.3. ADMINISTRATIVE REQUIREMENTS

1.3.1. Review Specification for work included under this Section and determine complete understanding of requirements and responsibilities relative to work included, storage and handling of materials, inspection of construction to be demolished, methods to be used, sequence and quality control, Project staffing, restrictions due to environmental protection requirements and other matters affecting demolition, to permit compliance with intent of this Section.

1.3.2. Scheduling:

- 1.3.2.1. Where practicable, remove or neutralize hazardous or toxic materials before demolition begins.
- 1.3.2.2. Phase selective demolition to be coordinated with Owner's on-going occupancy of the school.

1.4. QUALITY ASSURANCE

- 1.4.1. Comply with National Building Code, Part 8, Construction Safety Measures at Construction and Demolition Sites.
- 1.4.2. Do work in accordance with CSA S350 and comply with pertinent codes, regulations and insurance carriers providing coverage for this work.
- 1.4.3. Execute the work in strict accordance with The Occupational Health and Safety Act and Regulations for Construction Projects, latest addition. Keep copy of the Act at the place of the Work at all times.
- 1.4.4. Restrictions: Restrict demolition activities to hours in accordance with Section 01 10 00 Project Administrative Requirements.

1.5. SITE CONDITIONS

- 1.5.1. Demolition performed on this Project in school areas adjacent to occupied areas. Every part of the demolition work must be carefully planned, scheduled, and coordinated with the Owner Protect Manager, including:
 - 1.5.1.1. Hours of operation
 - 1.5.1.2. Dust control, infection prevention and control.
 - 1.5.1.3. Disruption to existing mechanical or electrical services, fire alarm, sprinkler, communications systems.
 - 1.5.1.4. Noise control.
 - 1.5.1.5. Protection to existing building
 - 1.5.1.6. Access to the work area including procedures for movement and removal of materials.

PART 2 - PRODUCTS

2.1. MATERIALS

2.1.1. Description:

- 2.1.1.1. Regulatory Requirements:
 - 2.1.1.1.1. Conform to The Occupational Health and Safety Act and Regulation for Construction Projects
 - 2.1.1.1.2. Conform to OBC, especially Division C, Part 1, Article 1.2.2.3 as applicable.
 - 2.1.1.1.3. Conform to Fire Code, Regulation under Fire Marshal Act especially Part 8.
- 2.1.2. Materials and Products Removed From Existing Building
 - 2.1.2.1. Refer to drawings for existing items that are designated to be carefully removed and reinstalled or relocated.
 - 2.1.2.2. Refer to drawings for existing items that are to be carefully removed and handed over to the Owner.
 - 2.1.2.3. Materials resulting from demolition and not required to be retained shall be removed promptly from site in accordance with requirements of authorities having jurisdiction and in safe manner to minimize danger at site and during disposal.
 - 2.1.2.4. Materials that are to be removed from the site and can be reused should be sent to the appropriate facility.

PART 3 - EXECUTION

3.1. EXAMINATION

- 3.1.1. Review audit of hazardous materials and designated substances of existing construction provided by Owner.
- 3.1.2. Consultant does not guarantee that existing conditions are the same as those indicated in Construction Documents.
- 3.1.3. Preliminary Survey:
 - 3.1.3.1. Before commencing demolition operations, examine building to determine type of construction, condition of structure and site conditions. Assess strength and stability of damaged or deteriorated structures.

- 3.1.3.2. Assess potential effect of removal of any part or parts on remainder of structure before such part(s) are removed.
- 3.1.3.3. Investigate for presence of hazardous materials not identified in the construction documents.
- 3.1.3.4. Prepare a complete photographic record of all finishes and equipment to remain. Note any damages, missing items, breaches in fire rated construction, potential hazardous materials, conditions that are different from what is shown in the Construction Documents, and any other items of concern that could impact the construction. Submit report of existing conditions before start of demolition operations, for each work area.

3.1.4. Existing Services:

- 3.1.4.1. When unanticipated mechanical, electrical, or structural elements are encountered, investigate and measure the nature and extent of the element.
- 3.1.4.2. Identify all services and systems exposed as part of the demolition.
- 3.1.4.3. Verify services are cut off and properly capped before commencing associated or effected demolition.
- 3.1.4.4. Provide and maintain temporary fire alarm and fire protection services required during demolition to satisfaction of authorities having jurisdiction, fire departments and Owner's Project Manager.
- 3.1.4.5. Verify prior to commencement work of this Section that disconnection and capping of electrical and mechanical services have been carried out.
- 3.1.4.6. Verify that dust control hoardings have been completed, inspected and accepted before proceeding.

3.2. PREPARATION

3.2.1. Protection of In-Place Conditions:

- 3.2.1.1. Post suitable warning signs outside of work area for protection of staff and public. Supervise entrance to work area to prevent entrance by unauthorized persons. If requested, provide lockable doors to prevent public entering danger zone.
- 3.2.1.2. Post warning signs on electrical lines and equipment which must remain energized to serve other portions of the building during period of demolition.
- 3.2.1.3. Provide fire extinguishers acceptable to fire prevention authorities in locations and of type suitable to enable personnel to deal with fire occurring during progress of work.
- 3.2.1.4. Provide suitable protection to existing lockers, doors, walls and finishes to remain. This includes a sealed 6 mil poly cover to prevent dust getting into equipment and fixtures.

3.2.2. Environmental Protection:

- 3.2.2.1. Prevent extraneous materials from contaminating air beyond application area, by providing temporary enclosures during demolition work.
- 3.2.2.2. Removal of all demolition materials shall be in sealed containers. Removal of transite panels from work area shall be in approved sealed bags.

3.2.3. Protection to Existing Services:

- 3.2.3.1. Provide protection required to enable existing building services, systems and equipment to remain in continuous and normal operations.
- 3.2.3.2. Demolition shall be carried out in a manner to ensure the minimum of disruption to Owner, and other contractors working in the building.

3.3. DEMOLITION — GENERAL

- 3.3.1. Execute work in conformance to Owner's Standards. Notify Owner's Project Manager before disrupting building access or services.
- 3.3.2. Carry out demolition in accordance with CSA S350-M. Demolish structure and remove materials from site. Use hand tools only. Adhere to manufacturer's recommendations in use of hand held tools while conforming to the Occupational Health and Safety Act requirements.
- 3.3.3. Do not demolish spray or trowel-applied friable materials, materials suspected of containing PCBs or other hazardous materials. Where such materials are encountered notify Owner's Project Manager immediately. Do not proceed until instructions have been received from Consultant.
- 3.3.4. Remove mechanical and electrical items indicated to be removed. Remove all abandoned services, communication lines, electrical wiring, plumbing, and ductwork.
- 3.3.5. The use of pneumatic or electrical jack hammers is not permitted.
- 3.3.6. Report any existing conditions uncovered by the demolition work that require remediation. This includes:
 - 3.3.6.1. Damaged or unsafe services.
 - 3.3.6.2. Unsupported services, structural members or missing hangers.
 - 3.3.6.3. Incomplete insulation, vapour retarder or air barrier.
 - Incomplete or unacceptable fire separation, missing seals, fire dampers, fireproofing or firestopping.
- 3.3.7. Minimize noise. Avoid use of noisy equipment. Proposed methods for demolition to be reviewed at the pre-construction meetings ahead of the work in each work area.
- 3.3.8. Firestopping and Smoke Seal: In event work of this Section impacts on integrity of fire separations, ensure trade performing firestopping is notified.
- 3.3.9. Demolition for new services:
 - 3.3.9.1. Cut openings through existing walls, partitions, roofs and floors. Establish exact location of steel reinforcing and conduits in existing concrete slabs or walls before cutting. Locate using non destructive, non ionizing radio frequency locators, magnetic scanning or X-ray. Scanning procedures and proposed methods and equipment to be reviewed with Owner's Project Manager before proceeding. Be responsible for damage to existing steel reinforcing and be liable for structural failure.
 - 3.3.9.2. Neatly cut openings and holes plumb, square and true to dimensions required. Use cutting methods least likely to damage remaining or adjoining construction. Use hand tools or small power tools designed for sawing or grinding, not hammering and chopping, to minimize disturbance of adjacent surfaces. Temporarily cover openings to remain.
 - 3.3.9.3. Openings to allow passage of ducts shall be closed tight to perimeters of duct at all locations where fire dampers are required.
- 3.3.10. Where items are to be removed from existing structure or surfaces that are to remain in place, remove those items complete with hangers, brackets and other readily removable supports and fastenings:
- 3.3.11. Building Services:
 - 3.3.11.1. Arrange with Owner's Project Manager to disconnect or interrupt existing building services. Cut-off and cap existing building services under Owner's supervision.
 - 3.3.11.2. Coordinate with Mechanical and Electrical respectively for removal, relocation and reinstallation of mechanical and electrical items.
 - 3.3.11.3. Prevent demolition debris from entering building drains.

3.3.12. Relocation of Salvaged Items:

3.3.12.1. Carefully remove, store, protect and re-install where applicable existing materials and equipment noted on Drawings to be retained and relocated. Relocate items to be retained and store them in areas directed by Consultant. In addition to items indicated on Drawings, Owner still reserves the right to retain any items or materials.

3.4. REMOVAL OF CEILINGS

- 3.4.1. Remove existing ceilings as shown in drawings. Acoustical ceiling panels and electrical light fixtures to be recycled rather than disposed as waste, as much as possible.
- 3.4.2. Support structure for ceiling systems including hangers and framing used for support of light fixtures shall be removed.
- 3.4.3. Carefully remove exit signs, speakers and other ceiling mounted fixtures.
- 3.4.4. Provide temporary support as required for sprinklers, fire alarm bells, smoke and heat detectors, and HVAC ductwork.
- 3.4.5. Take precautions to adequately support structure, provide bracing required for safety and execution of the work. Coordinate with structural requirements.

3.5. REMOVAL OF RESILIENT FLOOR FINISHES

- 3.5.1. Remove vinyl composite tile where shown. Strip all adhesive, underlayment or other cleavage membranes.
- 3.5.2. Remove resilient base.
- 3.5.3. Coordinate surface preparation of concrete slab with flooring trades in Division 09. Leave substrate flush, smooth and level suitable for new floor finish.

3.6. REMOVAL OF CERAMIC AND QUARRY TILE (walls and floors)

- 3.6.1. Remove mortar setting bed.
- 3.6.2. Strip all adhesive, underlayment or other cleavage membranes.
- 3.6.3. Leave substrate suitable for new finishes.

3.7. REMOVAL OF FLOORING

3.7.1. Remove terrazzo including base, raised pad at urinals and setting bed complete to concrete slab.

3.8. EXISTING SLAB PREPARATION

- 3.8.1. Remove existing floor finishes and bases as noted above.
- 3.8.2. At existing locations where flooring and base, has been removed, where concrete curbs, bases, steps and pads have been removed, grind and patch existing concrete slabs as required and clean slab and base surfaces, remove ridges, bumps, adhesives and other matter detrimental to bond of levelling coat, new finish application or underlayment. Surfaces shall be smooth, level and free of gouges; prepare for levelling coat and/or new finish application specified in respective Sections or underlayment.
- 3.8.3. At existing locations designated to receive new flooring, remove paint, old adhesives, and hard applied finishes by grinding or other approved means, as required to accommodate new flooring. Prepare for flooring application. Coordinate requirements with Work specified in flooring Sections.
- 3.8.4. At existing locations where slabs have been contaminated with oil, grease, resins or other such material not compatible with subsequent applied underlayment or flooring, remove contaminants by blast tracking or prepare existing surfaces by other approved means.

3.8.5. Rinse subfloor and vacuum clean.

3.9. CUTTING AND PATCHING

- 3.9.1. Obtain Consultant's approval before cutting, boring or sleeving load-bearing members.
- 3.9.2. Cut and patch as required to make work fit.
- 3.9.3. Make cuts with clean, true, smooth edges.
- 3.9.4. Where new work connects with existing and where existing work is altered, cut, patch and make good to match existing work.
- 3.9.5. Patch openings created where mechanical and electrical services are removed in existing building.
- 3.9.6. Use specialists in affected materials to execute cutting, fitting and remedial work.
- 3.9.7. Make good surfaces exposed or disturbed by work with material and finish to match existing adjoining surfaces.

3.10. CLEANING

3.10.1. Waste Management:

- 3.10.1.1. Clear away dirt, rubbish and loose litter resulting from work of this Section, minimum daily. Keep dust to a minimum. When necessary and practical demolition works shall be sprayed periodically with water to reduce dust. Wet down debris from time to time to control dust.
- 3.10.1.2. Selling or burning of materials on site is not permitted.
- 3.10.1.3. Conform to requirements of authorities having jurisdiction regarding disposal of waste materials.
- 3.10.1.4. Materials prohibited from municipality waste management facilities shall be removed from site and dispose of at recycling companies specializing in recyclable materials.

END OF SECTION

PART 1 - GENERAL

1.1. SUMMARY

- 1.1.1. Section Includes: Work requirements for flooring restoration including but not limited to following:
 - 1.1.1.1. Repair existing concrete floors where walls and flooring has been removed.
 - 1.1.1.2. Chipping and breaking out all deteriorated, spalled and delaminated concrete, defective cold joints, and the subsequent filling of voids, cracks and holes in concrete floor slabs.
 - 1.1.1.3. Concrete levelling underlayment.

1.2. ADMINISTRATIVE REQUIREMENTS

- 1.2.1. Coordination:
 - 1.2.1.1. Coordinate with trades responsible for concrete mix design including type of cement, water cement ratio, aggregates and placement technique.
 - 1.2.1.2. Ensure that concrete supplied for slabs contains no admixtures that would be incompatible with concrete leveller, topping, fillers, or adhesives proposed for use by this Section or flooring trades.
- 1.2.2. Pre-Installation Meetings:
 - 1.2.2.1. Prior to commencement of work, arrange for Project site meeting of all parties associated with work of this Section in accordance with project meetings specified in Section 01 10 00 Project Administrative Requirements.
 - 1.2.2.2. Include Contractor, Installers performing work of this Section, subcontractors installing finishes over these products (if applicable).
 - 1.2.2.3. Review Specification for work included under this Section and determine complete understanding of requirements and responsibilities relative to work included, storage and handling of materials, materials to be used, installation of materials, sequence and quality control, Project staffing, restrictions on areas of placement and other matters affecting construction.

1.3. SUBMITTALS

- 1.3.1. Submittals in accordance with Submittal Procedures specified in Section 01 10 00 Project Administrative Requirements.
- 1.3.2. Product Data:
 - 1.3.2.1. Submit manufacturer's Product data, performance criteria, application instructions, and other documentation for each material specified in this Section proposed for use, including:
 - 1.3.2.1.1. Liquid curing/sealing and curing/hardener.
 - 1.3.2.1.2. Joint sealant and primer.
 - 1.3.2.1.3. Leveller.
 - 1.3.2.2. Safety: Provide WHMIS Material Safety Data Sheets.

1.4. QUALITY ASSURANCE

- 1.4.1. Perform Work in accordance with ACI 302.1
- 1.4.2. Installers Qualifications:

- 1.4.2.1. Provide work of this Section executed by competent installers with minimum 5 years experience in the application of Products, systems and assemblies specified and with approval and training of the Product manufacturers.
- 1.4.2.2. Submit letter signed by manufacturer naming the installers and certifying that they have been trained in the application and safety measures for the products of this Section, and have 5 years experience.
- 1.4.2.3. Submit name and qualifications for the on-site lead supervisor who will be in full time attendance on site and directing the work of this Section.

1.4.3. Mock-Ups:

- 1.4.3.1. Provide site mock-up for concrete finishes indicating methods and materials, and procedures proposed to achieve concrete finishes and to comply with following requirements, using materials indicated for completed work:
 - 1.4.3.1.1. Build mock-ups in location and of size as directed by Consultant.
 - 1.4.3.1.2. Obtain Consultant's acceptance of mock-ups before continuing construction;
 - 1.4.3.1.3. Mock-up to be used throughout construction period and used as standard of acceptance for subsequent concrete refurbishing work.
 - 1.4.3.1.4. Mock-up may form part of permanent structure when accepted by Consultant. Repair or replace unacceptable mock-ups at no additional cost to Owner.

1.5. DELIVERY, STORAGE AND HANDLING

- 1.5.1. Storage and Handling Requirements: Store materials on site in manner to prevent damage. Protect materials from inclement weather. Comply with CSA A23.1, Clause 7.1.
- 1.5.2. Deliver materials in manufacturer's packaging including application instructions.

1.6. SITE CONDITIONS

- 1.6.1. Temporary Lighting: Minimum 1-200 W light source, placed 2.5 m (8') above floor surface, for each 40 m2 (430 sq ft) floor being finished.
- 1.6.2. Electrical power: Provide sufficient electrical power to operate equipment normally used during construction
- 1.6.3. Make work area water tight protected against rain and detrimental weather conditions.
- 1.6.4. Temperature: Maintain minimum 10 degrees C ambient temperature for 7 days before installation and minimum 48 hours after completion of work and maintain relative humidity maximum 40% during same period.

PART 2 - PRODUCTS

2.1. JOINT SEALERS

- 2.1.1. For exposed locations: 2 component, chemically reactive polyurethane or polysulfide modified sealant over premoulded joint filler; self-levelling, grey colour. Acceptable products:
 - 2.1.1.1. "Mapeflex P2 SL" by Mapei Corporation
 - 2.1.1.2. "Sikaflex 2C/SL" by Sika Canada Inc..
- 2.1.2. For slabs to receive architectural flooring finish: mix 1 part cement 2 parts sand 1 part additive. Additive: "Albitol" by Sika Canada Inc.
- 2.1.3. For expansion joints:
 - 2.1.3.1. "Mapeflex P2 SL/NS" by Mapei Corporation

- 2.1.3.2. "Sikaflex 2C NS/SL" polyurethane sealant by Sika Canada Inc.
- 2.1.4. For control joints which will not receive a resinous flooring finish:
 - 2.1.4.1. "Mapeflex Joint Filler PO 95/100" by Mapei Corporation
 - 2.1.4.2. "Sikafloor 524 EZ Polyurea" by Sika Canada Inc.
- 2.1.5. For isolation joints:
 - 2.1.5.1. "Mapeflex P2 SL" by Mapei Corporation
 - 2.1.5.2. "Sikaflex 2C SL" polyurethane sealant by Sika Canada Inc.

2.2. PATCHING AND CRACK REPAIR

- 2.2.1. Crack filler: Provide 1 of following:
 - 2.2.1.1. "Planiseal VS Fast" by Mapei
 - 2.2.1.2. "Lextile Patch" by Flextile Ltd

2.3. SELF LEVELING UNDERLAYMENT

- 2.3.1. Self-levelling, polymer-modified Portland cement based compound mixed with either a latex additive or water only depending on substrate conditions and Product instructions.
 - 2.3.1.1. Primer: As recommended by the manufacturer, if required.
 - 2.3.1.2. Compressive strength at 28 days: 38 MPa (5500 psi), to ASTM C109/C109M, or 36.5 MPa (5300 psi) tested to ASTM C1708.
 - 2.3.1.3. Acceptable products:
 - 2.3.1.3.1. "Flex-Flo" up to 12 mm (15/32") or "Flex-Flo Plus" up to 50 mm (2") by Flextile Ltd.,
 - 2.3.1.3.2. "NXT Level Plus" up to 50 mm (2") or "NXT Level" up to 76 mm (3/4") by Laticrete International, Inc.,
 - 2.3.1.3.3. "Ardex K-15" up to 40 mm (1-1/2") by Ardex Canada, Inc.,
 - 2.3.1.3.4. "UltraPlan 1 Plus with primer" up to 38 mm (1-1/2") or "UltraPlan M20 Plus with primer" up to 50 mm (2") by Mapei Corporation
 - 2.3.1.3.5. "Sikafloor Level-25" where resinous flooring or tiles to be installed, or "Sikafloor Level-125" where resilient flooring to be installed.
 - 2.3.1.4. Water:clean, potable.
 - 2.3.1.5. Mechanically mix in accordance with manufacturer's printed instructions.

PART 3 - EXECUTION

3.1. EXAMINATION

3.1.1. Verification of Conditions:

- 3.1.1.1. Verify that the surface conditions are smooth, sound, dry, and free from conditions that will adversely affect execution, permanence, or quality of the work of this section and in accordance with manufacturer's printed instructions. Refer to Section 09 05 61 Common Work Results for Flooring Preparation
- 3.1.1.2. Ensure substrates are structurally sound, solid, stable, level, plumb and true to a tolerance in plane of 6 mm in 3 m (1/4" in 10' 0") in accordance with ANSI A108/A118/A136.1 specification requirements. Ensure substrates are clean and free of dust, oil, grease, paint,

tar, wax, curing agent, primer, sealer, form release agent or any deleterious substance and debris which may prevent or reduce adhesion.

3.1.2. Evaluation and Assessment: Commencement of work implies acceptance of previously completed work.

3.2. PREPARATION

- 3.2.1.1. Mechanically sand, shot blast or scarify substrate to ICRI CSP-3 as required to completely remove paint, loosely bonded topping, loose particles and contaminants. Surface etching or contaminant removal by chemical means is not permitted. When sanding or scarifying surfaces that may contain silica sand, wear an approved dust mask.
- 3.2.1.2. Review setting out point with Consultant for each location, verify patterns and edge condition.
- 3.2.1.3. Cover and protect work of other sections and property from damage and dust.
- 3.2.1.4. Containment: Close and seal floor openings. Install dams at edges of floor area to receive treatment as necessary to contain self-leveling underlayment while in plastic state.
- 3.2.1.5. Use a digital level device to determine elevations on a 1200 mm x 1200 mm (4 x 4 foot) grid to establish and set self-adhering pegs at heights to indicate installation depths and top surface of underlayment application.
- 3.2.1.6. Erect barriers to prevent entry and presence of personnel not performing work of this section during application of topping or grout.
- 3.2.1.7. Joint Preparation:
 - 3.2.1.7.1. Expansion and Isolation Joints: Mark and saw cut after self-leveling application.
 - 3.2.1.7.2. Static (Non-Moving) Saw Cuts and Control Joints: to be patched or filled with joint sealer to Section 03 35 00 Concrete Finishing.
 - 3.2.1.7.3. Dynamic (Active) Cracks: Notify Consultant.
- 3.2.1.8. Cleaning: Broom clean and vacuum surfaces to pick up dust and debris.

3.3. CRACK FILLER TREATMENT

- 3.3.1. After existing flooring has been removed, examine concrete floor surfaces and repair cracks.
- 3.3.2. Using a diamond concrete cutting blade overcut the crack width to obtain a sound, clean edge. Clean cracks or joints with compressed air and/or vacuum with a dustless collection system. Follow ACI RAP Bulletin 2, "Crack Repair by Gravity Feed with Resin".
- 3.3.3. Mix components in accordance with manufacturer's recommendations
- 3.3.4. Fill joint with to full depth of crack and flush with concrete surface. Ensure that all voids and pinholes are filled/sealed.

3.4. LEVELLING UNDERLAYMENT

- 3.4.1. Priming:
 - 3.4.1.1. Maintain ambient conditions as specified, with adequate ventilation during and following primer application to promote faster drying.
 - 3.4.1.2. Prepare and apply primer in accordance with manufacturer's written instructions.
- 3.4.2. Embedded cable systems such as electric radiant heating, static dissipative wires, or hearing loop wire:
 - 3.4.2.1. Install cable or wire prior to priming; attach securely to substrate along the entire length of the cable or wire every 150 mm (6 inches).

- 3.4.2.2. Self-Leveller Thickness: Ensure minimum of 12 mm (½ inch) over highest point of embedded cable or wire.
- 3.4.3. Pump or pour self levellers onto substrate within single lift thickness limit recommended by manufacturer.
- 3.4.4. Immediately following placement, lightly smooth the surface and pour lines
- 3.4.5. Provide levelling bed to achieve Floor Flatness value as described in this Section, to ASTM E1155.
- 3.4.6. Feathered edge: Steel trowel the edge after initial set but before it is completely hard.
- 3.4.7. Provide minimum 1.6 mm (1/16") levelling bed to surfaces to receive waterproofing and/or tiling uncoupling membrane, in accordance with manufacturer's instructions. Refer to Sectio 09 30 00 Tiling.
- 3.4.8. Provide ramped levelling bed beneath finish flooring adjacent to ceramic tile, for minimum 600 mm (24") strip, to achieve flush finished surfaces at finished flooring transition.
- 3.4.9. Apply leveller with care to ensure that no laps, voids, or other marks or irregularities are visible, and with an appearance of uniform level and texture, within limitations of materials and areas concerned.
- 3.4.10. Make clean true junctions with no visible overlap between adjoining applications of topping.
- 3.4.11. Do not cover or bridge expansion joints or control joints. Provide 3 mm (1/8") wide movement joints over concrete slab control joints.

END OF SECTION

PART 1 - GENERAL

1.1. SUMMARY

- 1.1.1. Section Includes: Work requirements for flooring restoration including but not limited to following:
 - 1.1.1.1. Repair existing masonry units where indicated in the drawings

1.2. REFERENCES

- 1.2.1. Abbreviations and Acronyms:
 - 1.2.1.1. OMCA: Ontario Masonry Contractors' Association; www.canadamasonrycentre.com.
- 1.2.2. Reference Standards:
 - 1.2.2.1. ASTM C270-24 Standard Specification for Mortar for Unit Masonry
 - 1.2.2.2. CAN/CSA-A179-14 (R2024) Mortar and grout for unit masonry
 - 1.2.2.3. CSA A3000:23 Cementitious materials compendium

1.3. ADMINISTRATIVE REQUIREMENTS

- 1.3.1. Pre-Installation Meetings:
 - 1.3.1.1. Prior to commencement of work, arrange for Project site meeting of all parties associated with work of this Section in accordance with project meetings specified in Section 01 10 00 Project Administrative Requirements.
 - 1.3.1.2. Include Contractor, Installers performing work of this Section, subcontractors installing finishes over these products (if applicable).
 - 1.3.1.3. Review Specification for work included under this Section and determine complete understanding of requirements and responsibilities relative to work included, storage and handling of materials, materials to be used, installation of materials, sequence and quality control, Project staffing, restrictions on areas of placement and other matters affecting construction.

1.4. SUBMITTALS

- 1.4.1. Submittals in accordance with Submittal Procedures specified in Section 01 10 00 Project Administrative Requirements.
- 1.4.2. Product Data:
 - 1.4.2.1. Submit manufacturer's Product data. Include product characteristics and performance criteria.
 - 1.4.2.2. Safety: Provide WHMIS Safety Data Sheets.

1.5. QUALITY ASSURANCE

- 1.5.1. Provide work of this Section executed by competent installers with minimum 5 years experience in the application of Products, systems and assemblies specified and with approval and training of the Product manufacturers.
- 1.5.2. Membership in good standing in OMCA.

1.6. DELIVERY, STORAGE AND HANDLING

- 1.6.1. Storage and Handling Requirements:
 - 1.6.1.1. Handle, stack and store masonry units to avoid chipping, protect against staining and moisture entry.

1.6.1.2. Do not store or locate materials, plant and equipment in areas which will obstruct access to work by others.

1.7. SITE CONDITIONS

- 1.7.1. Ambient Conditions:
 - 1.7.1.1. Provide uniformly distributed and continuous heating. Prevent stratification and cold spots.
 - 1.7.1.2. Maintain masonry continuously at minimum 4 deg C (39 deg F) during placement and for 48 hours after placement.
 - 1.7.1.3. Employ protection and heating methods which will prevent evaporation of moisture from masonry during curing.

PART 2 - PRODUCTS

2.1. MATERIALS

- 2.1.1. Replacement Concrete Masonry Unit (CMU): To match existing concrete block in all respects, modular size, with special shapes and sizes as detailed.
 - 2.1.1.1. Acceptable Products: "Carbon Cure®" by Brampton Brick Limited, Permacon, or "Autoclave Block" by Day & Campbell Limited or "Carbo Cure" by Richvale
- 2.1.2. Ensure exposed surfaces are free of cracks, chips or other blemishes and broken corners. Include required sash blocks for control joints, solid block where noted and concrete block lintels over openings in concrete block walls unless steel lintels are shown.
- 2.1.3. Cement:
 - 2.1.3.1. Portland cement: to CAN/CSA-A3000, Type GU General use hydraulic cement (Type 10). For exposed mortar, maintain uniformity of cement manufacturer and batch for colour uniformity.
 - 2.1.3.2. Masonry cement: to CAN/CSA-A3000 and CAN/CSA A179, Type N for non load bearing and and Type S for load bearing.
- 2.1.4. Hydrated lime: to CAN/CSA A179, Type S.
- 2.1.5. Sand: Clean, sharp, washed and conforming in all respects to requirements of CAN/CSA-A179.
- 2.1.6. Course aggregate to CAN/CSA A179.
- 2.1.7. Water for Mortar Mixing: Potable, free from any deleterious substances.
- 2.1.8. Mortar for Unit Masonry: Comply with ASTM C270, Proportion Specification, for job-mixed mortar; and ASTM C1142 for ready-mixed mortar.
- 2.1.9. Control Joints (Movement Joints) Filler: PVC control joint filler purpose designed for concrete masonry unit construction.
 - 2.1.9.1. Durometer hardness between of 85 +/- 5 tested to ASTM D2240 of sizes and shapes required.
 - 2.1.9.2. Acceptable products:
 - 2.1.9.2.1. "VS Series PVC Control Joint" by Blok-Lok Limited.
 - 2.1.9.2.2. "PVC Control Joint" by Masonpro Inc.
 - 2.1.9.2.3. "PVC Control Joint" by Wire-Bond.

PART 3 - EXECUTION

3.1. PREPARATION

- 3.1.1. Surface Preparation: prepare surface in accordance with manufacturer's written recommendations.
- 3.1.2. Thoroughly clean surfaces by scrubbing to remove dirt, dust, and wax. Use stripper in accordance with manufacturer's printed instructions.
 - 3.1.2.1. Remove dirty solution with wet vacuum or mop.
 - 3.1.2.2. Rinse with clean water and allow to dry thoroughly.
- 3.1.3. Establish and protect lines, levels, and coursing.
- 3.1.4. Protect adjacent materials from damage and disfiguration.

3.2. GENERAL REQUIREMENTS

3.2.1. Workmanship:

- 3.2.1.1. Build masonry plumb, level, and true to line, with vertical joints in proper alignment. Do masonry work in accordance with CSA S304, CSA A370 and CSA A371.
- 3.2.1.2. Do masonry mortar and grout work in accordance with CSA A179 except where otherwise specified.
- 3.2.1.3. Layout coursing and bond to achieve correct coursing heights, and continuity of bond above and below openings, with minimum of cutting.
- 3.2.2. Remove and replace existing masonry units that are loose, chipped, broken, stained, or otherwise damaged. Install new CMU to match existing; install in fresh mortar or grout, pointed to eliminate evidence of replacement.
- 3.2.3. Pointing: During the tooling of joints, enlarge voids and holes and completely fill with mortar. Point-up joints, including corners, openings, and adjacent construction, to provide a neat, uniform appearance. Prepare joints for application of paint.

3.3. LAYING MASONRY UNITS

- 3.3.1. Install products in accordance with product manufacturer's written requirements.
- 3.3.2. Provide control joints between new and existing concrete unit masonry. Do not tooth new CMU walls into existing block walls.
- 3.3.3. Coursing Design: To match existing. When new work is not attached to existing construction, half running bond for concrete masonry units with vertical joint in each course centered on units in courses above and below.
- 3.3.4. Lay walls to comply with specified construction tolerances, with courses accurately spaced and coordinated with existing construction.
- 3.3.5. Locate bearings and piers as Indicated on drawings. Provide solid masonry units at bearings. Grout under bearing plates installed on masonry with non-shrink grout.
- 3.3.6. Extend masonry and partitions to deck, slab or structural members, except where otherwise noted in the drawings. Incorporate both lateral support and deflection space at termination of walls as required.
- 3.3.7. Lay masonry in full bed of mortar, properly jointed with other work. Buttering corners of joints, and deep or excessive furrowing of mortar joints are not permitted.
- 3.3.8. Fully bond intersections, and external corners.
- 3.3.9. Tool with non-staining pointing tool to provide smooth, compressed, uniformly formed joints:
 - 3.3.9.1. Concave for concrete unit masonry exposed to view.
 - 3.3.9.2. For concrete unit masonry concealed from view:

- 3.3.9.2.1. Strike flush joints concealed in walls and joints in walls to receive plaster, stucco, tile, insulation, resilient bases, or other applied material except paint or similar thin finish coating. Ensure that no mortar protrudes from joints on wall surfaces to receive materials and coatings.
- 3.3.10. Maintain mortar joint thickness of 9 mm (3/8"), unless otherwise specified or indicated on drawings. Not to exceed 12 mm (1/2").
- 3.3.11. Form control joints in concrete masonry as follows:
 - 3.3.11.1. Fit bond-breaker strips into hollow contour in ends of block units on one side of control joint. Fill the resultant core with grout and rake joints in exposed faces.
 - 3.3.11.2. Install temporary foam plastic filler in head joints and remove when unit masonry is complete.

3.4. INSTALLATION OF TUCK POINTING MORTAR

- 3.4.1. Repointing and Tuckpointing: Repoint defective joints as follows:
 - 3.4.1.1. Cut back joints 13 mm (1/2") taking care not to damage units. Remove dust and loose materials by brushing or by water jet. If water jet is used, allow excess water to drain before repointing.
 - 3.4.1.2. Repoint with same mix and colour as original.
 - 3.4.1.3. Pack mortar tightly in thin layers and tool joint to match non-defective joints.
- 3.4.2. Immediately prior to application of mortar, dampen joints to be tuck pointed. Prior to application of pointing mortar, allow masonry units to absorb surface water.
- 3.4.3. Tightly pack mortar into joints in thin layers, approximately 6 mm (1/4") thick maximum.
- 3.4.4. Allow layer to become "thumbprint hard" before applying next layer.
- 3.4.5. Pack final layer flush with surfaces of masonry units. When mortar becomes "thumbprint hard", tool joints.

3.5. REPLACEMENT OF MASONRY UNITS

- 3.5.1. Cut out mortar joints surrounding masonry units to be removed and replaced as follows:
 - 3.5.1.1. Units removed may be broken and removed, providing surrounding units to remain are not damaged.
 - 3.5.1.2. Once units are removed, carefully chisel out old mortar and remove dust and debris.
 - 3.5.1.3. If units are located in exterior wythe of a cavity or veneer wall, exercise care to prevent debris falling into cavity.
- 3.5.2. Dampen surfaces of surrounding units before new units are placed as follows:
 - 3.5.2.1. Allow existing masonry to absorb surface moisture prior to starting installation of new replacement units.
 - 3.5.2.2. Butter contact surfaces of existing masonry and new replacement masonry units with mortar.
 - 3.5.2.3. Centre replacement masonry units in opening and press into position.
 - 3.5.2.4. Remove excess mortar with a trowel.
 - 3.5.2.5. Point around replacement masonry units to ensure full head and bed joints.
 - 3.5.2.6. When mortar becomes "thumbprint hard", tool joints.

3.6. CLEANING

- 3.6.1. In-Progress Cleaning: Clean unit masonry as work progresses by dry brushing to remove mortar fins and smears prior to tooling joints.
- 3.6.2. Stain Prevention: Prevent grout, mortar, and soil from staining the face of masonry to be left exposed or painted. Immediately remove grout, mortar, and soil that come in contact with such masonry.
- 3.6.3. Protect masonry and adjacent work from damage from cleaning work.
- 3.6.4. Clean masonry in strict accordance with masonry manufacturer's printed instructions and referenced standards. Remove masonry and install new masonry if masonry is damaged by cleaning work.
- 3.6.5. Soak wall with clean water and flush off loose dirt and mortar.

END OF SECTION

PART 1 - GENERAL

1.1. SUMMARY

- 1.1.1. Section Includes: Provide masonry units including but not limited to following:
 - 1.1.1.1. Concrete block masonry with sequestered carbon dioxide.
- 1.1.2. Products installed but not supplied under this section:
 - 1.1.2.1. Loose steel lintels.
 - 1.1.2.2. Hollow metal door frames
- 1.1.3. Ambient Conditions:
 - 1.1.3.1. Provide uniformly distributed and continuous heating. Prevent stratification and cold spots.
 - 1.1.3.2. Maintain masonry continuously at minimum 4 deg C (39 deg F) during placement and for 48 hours after placement.
 - 1.1.3.3. Employ protection and heating methods which will prevent evaporation of moisture from masonry during curing.

PART 2 - PRODUCTS

2.1. PERFORMANCE/DESIGN CRITERIA

- 2.1.1. Provide only stainless steel reinforcement for exterior envelope walls.
- 2.1.2. Conform to requirements of CSA S304.1 for determination of loads acting on connectors and design requirements and to CSA A370 and CSA A371 for construction requirements, except where more stringent requirements are noted and/or indicated on Drawings and specified herein.
- 2.1.3. Obtain each masonry unit from 1 manufacturer. Provide units of uniform texture and colour for each kind required.
- 2.1.4. General: Do not use admixtures, including pigments, air-entraining agents, accelerators, retarders, water-repellent agents, antifreeze compounds, or other admixtures, unless otherwise indicated.
- 2.1.5. Do not use calcium chloride in mortar or grout.
- 2.1.6. Add cold-weather admixture (if used) at the same rate for all mortar, regardless of weather conditions, in order to ensure that mortar color is consistent.

2.2. MATERIALS

- 2.2.1. Brick: to match existing.
- 2.2.2. Brick ties: "FERO Thermal Tie™ Slotted Rap-Tie® Masonry Connector" by Fero; www.ferocorp.com
- 2.2.3. Concrete Blocks: Normal and lightweight units, metric modular units with low carbon footprint conforming to CSA A165.1,
 - 2.2.3.1. Normal Type(s) Hollow Units: H/15/A/O
 - 2.2.3.2. Full Solid Units: SF/15/A/O
 - 2.2.3.3. Semi-Solid Units: SS/15/A/O
 - 2.2.3.4. Lightweight Type(s) Hollow Units: Type H/15/C/O, Full Solid Units: Type SF/15/C/O and Semi-Solid Units: Type SS/15/C/O.
 - 2.2.3.5. Provide bullnose corner block for all exposed corners.

- 2.2.3.6. Acceptable Products: "Carbon Cure®" by Brampton Brick Limited, or "Autoclave Block" by Day & Campbell Limited or "Carbo Cure" by Richvale.
- 2.2.4. Lateral Support and Anchorage for Masonry Walls: In accordance with CSA S304.1 and as specified and supplied as part of work of Section 05 50 00.
- 2.2.5. Cement:
 - 2.2.5.1. Portland cement: to CAN/CSA-A3000, Type GU General use hydraulic cement (Type 10). For exposed mortar, maintain uniformity of cement manufacturer and batch for colour uniformity.
 - 2.2.5.2. Masonry cement: to CAN/CSA-A3000 and CAN/CSA A179, Type N and Type S.
- 2.2.6. Hydrated lime: to CAN/CSA A179, Type S.
- 2.2.7. Sand: Clean, sharp, washed and conforming in all respects to requirements of CAN/CSA-A179.
- 2.2.8. Course aggregate to CAN/CSA A179.
- 2.2.9. Water for Mortar Mixing: Potable, free from any deleterious substances.
- 2.2.10. Water Repellent Admixture: For exterior CMU with water repellent admixture:
 - 2.2.10.1. Integral liquid or dry polymer admixture for mortar added during mixing or at the factory, compatible with integral water repellent admixture used in concrete masonry units.
 - 2.2.10.2. Performance Requirements:
 - 2.2.10.2.1. Water Permeance: Capable of achieving a Class E Rating when evaluated using ASTM E514.
 - 2.2.10.3. Acceptable manufacturers and products:
 - 2.2.10.3.1. "Dry Block" by GCP Applied Technologies.
 - 2.2.10.3.2. Spec Mix
 - 2.2.10.3.3. "RainBloc® for Mortar Admixture", by ACM Chemistries Inc.
 - 2.2.10.3.4. Substitutions in accordance with Section 01 25 00 Substitution Procedures.

2.3. MORTAR TYPES

- 2.3.1. Mortar for Unit Masonry: Comply with ASTM C270, Proportion Specification, for job-mixed mortar; and ASTM C1142 for ready-mixed mortar.
- 2.3.2. Mortar Types:
 - 2.3.2.1. Loadbearing: Type S based on property specifications.
 - 2.3.2.2. Non-loadbearing: Type N based on property specifications.

2.4. MORTAR MIXING

- 2.4.1. Use pre-blended, pre-coloured mortar prepackaged under controlled factory conditions. Ingredients batching limitations to be within 1% accuracy.
- 2.4.2. Colour of mortar shall be:
 - 2.4.2.1. Concrete masonry units: Natural gray colour.
 - 2.4.2.2. Brick: Colour matched to existing.
- 2.4.3. Mix mortar ingredients in accordance with CAN/CSA A179 in quantities needed for immediate use.
- 2.4.4. Maintain sand uniformly damp immediately before mixing process.

- 2.4.5. Add mortar colour and admixtures in accordance with product manufacturer's instructions. Provide uniformity of mix and colouration.
- 2.4.6. Do not use anti-freeze compounds including calcium chloride or chloride based compounds.
- 2.4.7. Do not add air entraining admixture to mortar mix.
- 2.4.8. Use a batch type mixer in accordance with CAN/CSA A179.
- 2.4.9. Re-temper mortar only within two hours of mixing, when water is lost by evaporation.
- 2.4.10. Use mortar within 2 hours after mixing at temperatures of 32°C or higher, or 2-1/2 hours at temperatures under 10°C.

2.5. GROUT TYPES

- 2.5.1. Grout shall comply with CSA A179. Use grout of consistency indicated or, if not otherwise indicated, of consistency (fine or coarse) at time of placement that will completely fill spaces intended to receive grout
 - Use fine grout in grout spaces less than 2 inches in horizontal dimension, unless otherwise indicated.
 - 2.5.1.2. Use coarse grout in grout spaces 2 inches or more in least horizontal dimension, unless otherwise indicated.

2.5.2. Bond Beams:

2.5.2.1. Grout mix 10 to 12.5 MPa strength at twenty-eight (28) days; 200-250 mm slump; or premixed type in accordance with CAN/CSA-A23.1 or mixed in accordance with CAN/CSA A179 fine grout.

2.5.3. Lintels:

2.5.3.1. Grout mix 10 to 12.5 MPa strength at twenty-eight (28) days; 200-250 mm slump; or premixed type in accordance with CAN/CSA-A23.1 or mixed in accordance with CAN/CSA A179 fine grout.

2.5.4. Block Filler:

- 2.5.4.1. Dry pack grout to consist of 1 part Portland Cement, 1-1/2 parts sand, 2 parts 9 mm (3/8") pea gravel with only sufficient water to dampen mixture.
- 2.5.4.2. Measure and mix block filler in accordance with CAN/CSA-A179; mix filler to consistency in accordance with manufacturer's recommendations; do not mix different types of grout in same mixer used for mixing of mortar unless mixer is thoroughly cleaned. Use and place grout in its final position within 2-1/2 hours of mixing it. Discard grout not used within 2-1/2 hours. Use coarse grout where required, in spaces 50 mm (2") or more in least horizontal dimension. Use fine grout in spaces less than 50 mm (2") in horizontal dimension.
- 2.5.5. Grout for hollow metal frames:
 - 2.5.5.1. Fine grout to CSA A179.
 - 2.5.5.2. Minimum compressive strength of 15 MPa.

2.6. GROUT MIXING

- 2.6.1. Mix batched and delivered grout in accordance with CAN/CSA-A23.1 transit mixed.
- 2.6.2. Mix grout ingredients in quantities needed for immediate use in accordance with CAN/CSA A179 fine grout.
- 2.6.3. Add admixtures in accordance with product manufacturer's instructions; mix uniformly. Do not use calcium chloride or chloride based admixtures.

PART 3 - EXECUTION

3.1. EXAMINATION

- 3.1.1. Verification of Conditions: Verify actual site dimensions and location of adjacent materials prior to commencing work. Notify Consultant via email of any conditions which would be detrimental to the installation.
- 3.1.2. Evaluation and Assessment: Commencement of work implies acceptance of previously completed work.

3.2. PREPARATION

- 3.2.1. Protection of In-Place Conditions:
 - 3.2.1.1. Provide temporary bracing for masonry work during erection to prevent damage due to winds or other lateral loads until permanent structure provides adequate bracing.
 - 3.2.1.2. Cold Weather Protection:
 - 3.2.1.2.1. During cold weather, provide temporary enclosures and coverings in order to protect masonry work and to allow laying of masonry during inclement weather.
 - 3.2.1.2.2. Provide temporary sheltering of freshly built masonry work, during installation and not less than 96 hours after erection to ensure required ambient temperatures.
 - 3.2.1.2.3. Provide temporary wind bracing for newly laid masonry walls.
 - 3.2.1.2.4. Completely cover open tops of freshly built walls each night with waterproof tarpaulins or plastic sheet coverings. Apply coverings to tops and faces of walls during rain or snow or upon stoppage of work.
 - 3.2.1.3. Cold Weather Masonry: Provide temporary heated enclosures in accordance with Section 01 50 00 if necessary to maintain:
 - 3.2.1.3.1. Product manufacturer's recommended temperatures for following, before, during and after installation until full cure: Ambient air, substrate, stored Products, installed Products.
 - 3.2.1.3.2. Conform to CSA A371 for Cold Weather Requirements, which applies to mixing, enclosure, placing and curing of masonry materials.
 - 3.2.1.3.3. Cementitious materials storage in accordance with CAN/CSA-A3000.
 - 3.2.1.3.4. Aggregate materials storage in accordance with CSA A23.1.
 - 3.2.1.4. Conform to CSA A371 for temporary wind bracing for masonry during construction. Provide temporary bracing for masonry work during erection to prevent damage due to winds or other lateral loads until permanent structure provides adequate bracing.
 - 3.2.1.5. Protect masonry units and mortar ingredients before use from rain, snow, ice and freezing in accordance with requirements of CSA A371.
- 3.2.2. Surface Preparation for new masonry work:
 - 3.2.2.1. Apply bituminous paint to steel buried in masonry.
 - 3.2.2.2. When ambient air temperature is at or below 4 deg C (39 deg F), preheat
 - 3.2.2.2.1. Masonry units to 15 deg C (59 deg F).
 - 3.2.2.2.2. Cement and aggregate to 15 deg C (59 deg F).
 - 3.2.2.2.3. Water to minimum 10 deg C (50 deg F), maximum 15 deg C (59 deg F).

- 3.2.2.2.4. Mixers, reinforcement and ties to 15 deg C (59 deg F).
- 3.2.2.3. Just prior to installing masonry remove snow, surface frost and ice from surfaces masonry is to be constructed against.
- 3.2.2.4. Do not mix in water until cement and aggregate have been combined.
- 3.2.2.5. Do not allow frozen lumps, ice or snow to contaminate mortar mix.
- 3.2.2.6. Maintain mortar continuously at minimum 10 deg C (50 deg F) during mixture.
- 3.2.2.7. Do not provide chemicals, additives or other contaminants to mortar mixture without review by Consultant.
- 3.2.2.8. Wet exposed masonry surfaces minimum once every 24 hours for 14 Days to minimize and retard surface evaporation. Do not allow surface freezing.

3.3. INSTALLATION

- 3.3.1. Provide scaffolding required to complete work of this Section. Provide scaffolding independently supported from floor or ground.
- 3.3.2. Conform to the OHSA; erect scaffolding adequate for proper execution of work, maintain and remove on completion. Lay masonry from scaffolds erected on same side as face work. Do not support scaffolding from finished building surfaces.
- 3.3.3. Conform to CSA S304.1 and CSA A371 for masonry work.
- 3.3.4. Do masonry mortar and grout work in accordance with CAN/CSA-A179 and CSA A371 except where specified otherwise.
- 3.3.5. Execute masonry work under continuous supervision and direction of a competent foreman.
- 3.3.6. Lay and set masonry units using experienced tradesmen.
- 3.3.7. Do not erect more than 1500 mm (5') in height of any wall in any 1 Working Day and do not raise any part of wall more than 600 mm (24") above remainder at any time.
- 3.3.8. Do not tooth at wall terminations. Rake back 1/2 unit length where stop-off occurs in horizontal run of masonry.
- 3.3.9. Lay up units true to line with accurately spaced courses. Keep bond plumb throughout. Provide corners and reveals plumb and true. Provide horizontal and vertical joints of uniform thickness in straight lines. Keep exposed faces free from stains, chips and cracks. Keep tolerance in plane 3 mm in 2400 mm (1/8" in 8').
- 3.3.10. Provide running bond unless indicated otherwise.
- 3.3.11. Avoid overplumbing and pounding of masonry corners and jambs after setting position. After mortar has set, if adjustment is required, remove mortar and replace with new mortar.
- 3.3.12. Install masonry wall base anchors in masonry foundation walls to line up with voids in masonry walls above as indicated on Drawings. Solidly fill voids between anchors and masonry with mortar.
- 3.3.13. Dampproof Coursing of Exterior Walls:
 - 3.3.13.1. Install dampproof course where indicated on Drawings. If not fully indicated, install in locations as follows and as specified hereafter:
 - 3.3.13.1.1. Below second exterior block masonry course and fourth exterior brick course above new grade line.
 - 3.3.13.1.2. Over exterior lintels and shelf angles.
 - 3.3.13.1.3. Below first masonry course of inner wythe at floors on grade. Extend dampproof coursing through full thickness of inner wythe.

- 3.3.13.1.4. Wherever roofs or other exterior, horizontal surfaces intersect masonry walls, immediately above roof flashing or horizontal surface flashing and seal to roof or other flashing or vapour barrier.
- 3.3.13.2. At shelf angles install flashing through exterior wythe up and over shelf angle, horizontally through insulation turning up wall and terminate at and adhere to air/vapour barrier as specified herein.
- 3.3.13.3. In non-cavity wall install flashing through full thickness of wall to provide dampproofing in accordance with manufacturer's recommendations.
- 3.3.13.4. Where brick is laid against concrete without air/vapour membrane with less than 25 mm (1") clear space separating them, apply 2 coats dampproofing to concrete.
- 3.3.13.5. Install flashings to provide continuous waterproofing flashing in wall except where such courses occur over openings in walls extend them past opening minimum of 200 mm (8") and turn up minimum 150 mm (6") at each end to create waterproof dam to prevent water draining into cavity. End dam where flashings terminate at an opening.

3.3.14. Laying Concrete Block:

- 3.3.14.1. Do not wet concrete block before laying. Lay first course of block work in full beds of mortar with joints of uniform thickness. Provide 100% solid blocks at following locations:
 - 3.3.14.1.1. top course of interior block walls and block back-up wythes.
 - 3.3.14.1.2. at sills of openings e.g. windows, louvres, etc.
 - 3.3.14.1.3. top course of block below beams, joists and lintels bearing on walls.
 - 3.3.14.1.4. at top of parapet walls.
- 3.3.14.2. Provide square end blocks at jambs of openings.
- 3.3.14.3. Provide concrete masonry units with face shells and end joints fully filled with mortar. Do not slush mortar into joints.
- 3.3.14.4. Provide damming and grout fill to vertical concrete block wall cavities at control joints.
- 3.3.14.5. Extend block partitions, both fire rated and non-fire rated, up to within 25 mm (1") of underside of structure above unless otherwise indicated, to allow for structural deflection.
- 3.3.14.6. Where gypsum board is applied directly to block walls, level walls to 3 mm in 3000 mm (1/8" in 10').

3.3.15. Brick:

- 3.3.15.1. Install shelf angles and spacers supplied as part of work of Section 05 50 00. Provide compressible filler below shelf angles.
- 3.3.15.2. Provide brick veneer tight to cavity compartmentalization.
- 3.3.15.3. Wet brick with absorption rate of over 20 g/minute when tested in accordance with CAN/CSA-A82 before laying.
- 3.3.15.4. Lay brick in level courses in full beds of mortar with vertical joints flushed up solid. Lay brick by shove joint method, with joints of uniform thickness.
- 3.3.15.5. Lay face brick in running bond to match existing. Evenly distribute variation in colour preferably working from 3 random pallets simultaneously.

3.3.16. Concrete Block Lintels:

3.3.16.1. Unless indicated otherwise on Structural Drawings, provide concrete block lintels over openings in masonry walls. Refer to Mechanical and Electrical Drawings for location of

- ducts and equipment mounted in or projecting through masonry walls. Refer to Structural Drawings for Lintel Schedules.
- 3.3.16.2. Unless otherwise noted in Door [and Frame] Schedule, set precast U-shaped reinforced block lintels for full thickness of wall plus minimum 200 mm (8") bearing. Provide reinforcement as indicated on Structural Drawings.
- 3.3.16.3. Fill lintels with concrete and leave shoring in place for minimum 10 Days before removal.
- 3.3.16.4. Set concrete blocks over lintel unit in a full mortar bedding.

3.3.17. Lateral Support Angles:

- 3.3.17.1. Install lateral support angles to underside of structure, at 2000 mm (6' 6") oc, for lateral stability of interior masonry walls.
- 3.3.17.2. Install lateral supports at either horizontal or vertical intervals spaced at not more than:
 - 3.3.17.2.1. 20 x wall thickness for solid wall of solid units.
 - 3.3.17.2.2. 18 x wall thickness for solid wall of hollow units.
 - 3.3.17.2.3. 36 x wall thickness for partitions.

3.3.18. Joint Tooling:

- 3.3.18.1. Provide joints in masonry, firmly pointed, compacted and tooled.
- 3.3.18.2. Exterior Masonry Joint Tooling:
 - 3.3.18.2.1. Brick: Concave joints:
 - 3.3.18.2.1.1. Horizontal: Rake back joints 9 mm (3/8").
 - 3.3.18.2.1.2. Vertical: Rake back joints 9 mm (3/8").
 - 3.3.18.2.2. Concrete Block:
 - 3.3.18.2.2.1. Exposed: Concave joints.
 - 3.3.18.2.2.2. Concealed: Flush joints.
 - 3.3.18.2.2.3. Parged: Rake back joints 13 mm (1/2").
- 3.3.18.3. Interior Masonry Joint Tooling:
 - 3.3.18.3.1. Concrete Block:
 - 3.3.18.3.1.1. Exposed: Concave joints.
 - 3.3.18.3.1.2. Concealed: Flush joints.

3.3.19. Built-In Work:

- 3.3.19.1. Solidly build items of hollow metal work and miscellaneous metal work, including but not limited to grilles, hose cabinets, electrical panels into masonry work, and ensure they are set square and true in walls and partitions.
- 3.3.19.2. Cut for and build into masonry, anchors, sleeves, inserts, reglets, piping, conduit, outlet boxes, metal flashings and leave chases, slots or openings required for fixing of work of other Sections. Build chases into masonry walls; do not cut.

3.4. CLEANING

3.4.1. Obtain cleaning materials in accordance with manufacturer's instructions and brick manufacturer's written instructions for cleaning and verify cleaning procedures outlined in CSA A371 with manufacturers. Follow brick manufacturer's written instructions for cleaning masonry. Test sample

- area, 10 m² (100 sq ft), to judge effectiveness of cleaning procedures and obtain Consultant's review with no objections recorded.
- 3.4.2. Keep wall clean and free of mortar stains during laying. Allow mortar droppings which adhere to wall to dry out but not set. Then rub with small piece of masonry followed by brushing to remove all traces. On completion of masonry construction, after mortar is thoroughly set and cured, clean masonry thoroughly.
- 3.4.3. Protect windows, trim and metal from cleaning agents.
- 3.4.4. Remove mortar with wood paddles and scrapers before wetting. Saturate masonry with clean water and flush off loose mortar and dirt. Clean blockwork using water, scrubbing brushes and wood paddles only.
- 3.4.5. Clean masonry to be left exposed, using procedures as outlined herein and, where this is inadequate, try following recommendations outlined in BIA's Technical Note No. 20, June 2006.
- 3.4.6. Particular care should be taken when cleaning lighter coloured clay bricks even with non-acid based cleaning solutions. Dark red or brown residue resulting from cleaning operations when allowed to run down face of brick could streak and discolour exterior facing. Protect lighter coloured Products by masking them from run off or by taking measures recommended by brick manufacturers.
- 3.4.7. Should these methods prove inadequate consult masonry manufacturer before undertaking unusual cleaning procedures and obtain Consultant's prior consent.
- 3.4.8. Clean adjacent surfaces completely, which have been soiled or otherwise marred.

3.5. PROTECTION

- 3.5.1. Protect masonry from absorbing water from precipitation and condensation.
- 3.5.2. Keep masonry materials and Products completely free from frost, snow and ice.
- 3.5.3. Protect masonry with protective coverings continuously from placement to 10 Days after placement.

END OF SECTION

PART 1 - GENERAL

1.1. SUMMARY

1.1.1. Section Includes:

- 1.1.1.1. Provide firestopping and smoke seals at penetrations and at joints in fire rated assemblies.
- 1.1.1.2. Make repairs to existing fire rated assemblies as necessary.

1.2. ADMINISTRATIVE REQUIREMENTS

1.2.1. Coordination:

- 1.2.1.1. Coordinate construction of openings and penetrating items to ensure that throughpenetration fire-stop systems are installed according to specified requirements.
- 1.2.1.2. Coordinate sizing of sleeves, openings, core-drilled holes, or cut openings to accommodate through-penetration fire-stop systems.
- 1.2.1.3. Do not cover up through-penetration fire-stop system installations that will become concealed behind other construction until manufacturer's representative and building inspector, if required by Authorities Having Jurisdiction, have examined each installation.

1.2.2. Preinstallation Meetings:

1.2.2.1. Arrange preinstallation meeting 1 week prior to commencing work with all parties associated with trade as designated in Contract Documents or as requested by Consultant. Presided over by Contractor include Consultant who may attend, Subcontractor performing work of this trade, Owner's representative, testing company's representative and consultants of applicable discipline.

1.3. SUBMITTALS

1.3.1. Product Data:

1.3.1.1. Submit manufacturers' specifications and technical data for each material including compositions, limitations, documentation conforming ULC and/or cUL firestop system proposed for this Project and manufacturers' installation instructions.

1.4. QUALITY ASSURANCE

1.4.1. Ensure firestopping systems conform to requirements of CAN/ULC-S115 tested assemblies that provide fire rating as shown.

1.5. SITE CONDITIONS

1.5.1. Ambient Conditions:

- 1.5.1.1. Comply with manufacturer's recommended requirements for temperature, relative humidity, moisture content and presence of any sealer or release agents on substrate during application and curing of materials. Ensure surfaces are dry and frost free.
- 1.5.1.2. Maintain minimum temperature of 5 deg C (40 deg F) for minimum period of 1 week before application, during application and until application is fully cured.
- 1.5.1.3. Ventilate areas in which firestopping is being applied. Protect water-soluble material from wetting until fully cured.

PART 2 - PRODUCTS

2.1. FIRE RESISTIVE JOINT PRODUCTS

- 2.1.1. For pipe penetrations in vertical assemblies, horizontal assemblies and smoke barrier:
 - 2.1.1.1. 3M Fire Barrier Sealant FD 150+: Single-part, acrylic latex sealant. No-sag, low-shrinkage, low VOC.
 - 2.1.1.2. Fire Resistance: For use in 1, 2, 3 or 4-hour fire-rated systems.
 - 2.1.1.3. Compression/Extension Recovery: Up to +/- 19 percent of original joint width.
 - 2.1.1.4. Meets optional L rating requirements.
 - 2.1.1.5. STC rating of 56 when tested in STC 56-rated wall assembly.
- 2.1.2. For filling voids in concrete gypsum, metal, plastic, wood and insulation:
 - 2.1.2.1. 3M Fire Barrier Water Tight Sealant 3000 WT: intumescent silicone firestop sealant.
 - 2.1.2.2. Fire Resistance: For use in 1, 2 or 3 hour fire rated systems.
 - 2.1.2.3. Meets UL Water Leakage Test, W Rating Class 1 requirements.
 - 2.1.2.4. STC-Rating of 53 when tested in STC-53-rated wall assembly.
- 2.1.3. For horizontal floor openings:
 - 2.1.3.1. 3M Fire Barrier Water Tight Sealant 1003 SL: Single-part, self-leveling elastomeric silicone sealant. Sag-resistant, low VOC.
 - 2.1.3.2. Fire Resistance: For use in 1, 2, 3 or 4 hour fire rated systems.
 - 2.1.3.3. Meets UL Water Leakage Test, W Rating Class 1 requirements.
 - 2.1.3.4. Compression/Extension Recovery: Up to +/- 15 percent of original joint width.
 - 2.1.3.5. STC-Rating of 56 when tested in STC-56-rated wall assembly.
- 2.1.4. For mechanical, electrical and plumbing pipe, conduit, communication cabling, and telephone wiring in vertical and horizontal assemblies:
 - 2.1.4.1. 3M Fire Barrier Sealant 2000 NS: Silicone Sealant: Single-part, elastomeric silicone sealant. Sag-resistant, low VOC.
 - 2.1.4.2. Fire Resistance: For use in 1, 2, 3 or 4-hour fire rated systems.
 - 2.1.4.3. Compression/Extension Recovery: Up to +/- 13 percent of original joint width.
- 2.1.5. For pipes, cables, cable tray, blank opening and other penetrations along with mineral wool or other fire-rated assembly products in vertical assemblies, horizontal assemblies and smoke barrier:
 - 2.1.5.1. 3M Fire Barrier Moldable Putty+: one-part, 100 percent solids intumescent firestop
 - 2.1.5.2. Fire Resistance: For use in 1, 2, or 3-hour fire rated systems
 - 2.1.5.3. For sealing large or complex openings such as cable bundles, cable trays and conduit banks:
 - 2.1.5.4. 3M Fire Barrier 2001 Silicone RTV Foam, Two-part, liquid-silicone elastomer foam
 - 2.1.5.5. Fire Resistance: For use in 1, 2, or 3-hour fire rated systems
- 2.1.6. For use at head-of-wall, wall-to-wall, floor-to-floor, bottom-of-wall, floor-to-wall and perimeter joints:
 - 2.1.6.1. 3M FireDam Spray 200, Water-based, paintable, low VOC, freeze/thaw resistant spray applied fire resistive product. Applied with conventional airless spray equipment:
 - 2.1.6.2. Fire Resistance: For use in 1, 2, 3 or 4-hour fire rated systems.
 - 2.1.6.3. Compression/Extension Recovery: Up to +/- 50 percent of joint width.
 - 2.1.6.4. STC-Rating of 56 when tested in STC 56-rated wall assembly.

PART 3 - EXECUTION

3.1. EXAMINATION

3.1.1. Verification of Conditions:

- 3.1.1.1. Verify actual site dimensions and location of adjacent materials prior to commencing work. Notify Consultant in writing of any conditions which would be detrimental to the installation.
- 3.1.1.2. Verify openings, dimensions and surfaces conform to fire and smoke seal assembly.
- 3.1.1.3. Examine sizes of penetrating service, percentage fill and sleeve or opening sizes with exact annular space calculations, anticipated movement and conditions necessary to establish correct type, thickness and installation of back-up materials and seals.
- 3.1.1.4. Since firestop systems do not re-establish structural integrity of load bearing partitions/ assemblies, or support live loads and traffic, consult structural engineer prior to penetrating any load bearing assembly.
- 3.1.2. Evaluation and Assessment: Commencement of work implies acceptance of previously completed work

3.2. PREPARATION

3.2.1. Surface Preparation:

- 3.2.1.1. Provide primer or surface conditioner if required by Product manufacturer. Prime surfaces in accordance with manufacturer's directions.
- 3.2.1.2. Remove combustible material and loose material detrimental to bond from edges of penetration. Clean, prime or otherwise prepare substrate material to manufacturer's recommendation.
- 3.2.1.3. Remove insulation from insulated pipe and duct where such pipes or ducts penetrate a fire separation unless ULC certified assembly permits such insulation to remain within assembly, or where mechanical trades have installed special fire rated insulated sleeves. Ensure continuity of thermal and vapour barriers where such are removed, altered or replaced, to satisfaction of Mechanical and Electrical and Consultant.
- 3.2.1.4. Alternatively, ensure pipe and duct insulation and wrappings occurring within openings to receive firestopping and smoke seals under this Section are installed prior to work of this Section and insulation and wrappings within fire seals are ULC listed components of system to be installed under this Section, unless ULC certified assembly permits such other insulation and wrappings to remain within assembly. Coordinate work of this Section with Mechanical and Electrical.
- 3.2.1.5. Clean bonding surfaces to remove deleterious substances including dust, paint, rust, oil, grease, moisture, frost and other foreign matter which may otherwise impair effective bonding.

3.3. INSTALLATION

- 3.3.1. Install in strict accordance with manufacturer's detailed installation instructions and procedures.
- 3.3.2. Install so that openings are completely filled and material is securely adhered.
- 3.3.3. Where firestopping surface will be exposed to view, finish to a smooth, uniform surface flush with adjacent surfaces.
- 3.3.4. After installation is complete, remove combustible forming materials and accessories that are not part of the listed system.

- 3.3.5. Repair or replace defective installations in accordance with manufacturer's recommendations, listed systems details and applicable code requirements.
- 3.3.6. At each through penetration or fire-resistive joint system, attach identification labels on both sides in location where label will be visible to anyone seeking to remove penetrating items or firestopping.
- 3.3.7. Clean firestop materials off surfaces adjacent to openings as work progresses, using methods and cleaning materials approved in writing by firestop system manufacturer and which will not damage the surfaces being cleaned.
- 3.3.8. Notify Authority Having Jurisdiction when firestopping installation is ready for inspection; obtain advance approval of anticipated inspection dates and phasing, if any, required to allow subsequent construction to proceed.
- 3.3.9. Do not cover firestopping with other construction until approval of authority having jurisdiction has been received.

END OF SECTION

PART 1 - GENERAL

1.1. SUMMARY

- 1.1.1. This Section includes:
 - 1.1.1.1. Hollow metal doors
 - 1.1.1.2. Metal frames.
- 1.1.2. Related Sections: Following description of work is included for reference only and shall not be presumed complete:
 - 1.1.2.1. Installation of snap-in clips and frames in gypsum board partitions: Section 09 22 16 Non-Structural Metal Framing.

1.2. ADMINISTRATIVE REQUIREMENTS

- 1.2.1. Coordination:
 - 1.2.1.1. Cooperate fully with door hardware distributor's representative during preparation of shop drawings and execution of shop fabrication. Be responsible to provide adequate reinforcing, clearances, for door hardware specified and for accurate installation of door and door hardware on site.
- 1.2.2. Preinstallation Meetings:
 - 1.2.2.1. The following minimum items shall be reviewed at the pre-installation meeting:
 - 1.2.2.1.1. Verify project requirements.
 - 1.2.2.1.2. Review installation conditions under which work is to be performed including possible site concerns.
 - 1.2.2.1.3. Inspection of surfaces to receive the work.
 - 1.2.2.1.4. Coordination requirements with other subtrades.
 - 1.2.2.2. Key personnel shall attend the pre-installation meeting including but not limited to:
 - 1.2.2.2.1. Steel door and frame installer subtrade personnel.
 - 1.2.2.2.2. Related work subtrade personnel.

1.3. ACTION SUBMITTALS

- 1.3.1. Product Data Sheets:
 - 1.3.1.1. Submit manufacturer's product data sheets for products to be used in the work of this section. Manufacturer's product data sheets shall include:
 - 1.3.1.1.1. Material and product physical properties and characteristics including size.
 - 1.3.1.1.2. Performance criteria.
 - 1.3.1.1.3. Limitations of products.
- 1.3.2. Shop Drawings:
 - 1.3.2.1. Indicate door location using numbering system per door and frame schedule.
 - 1.3.2.2. Include size, and hand of each door, elevation of each door type; beveling of door edges, construction type core and edge construction not covered in product data.
 - 1.3.2.3. Indicate dimensions and locations of cut-outs including requirements for louver openings.
 - 1.3.2.4. Provide details of door hardware locations, anchorage and fastening methods.

1.4. DELIVERY, STORAGE, AND HANDLING

- 1.4.1. Comply with CSDMA, Guide Specification For Installation and Storage of Hollow Metal Doors and Frames.
- 1.4.2. Inspect materials thoroughly upon receipt and report immediately any discrepancies, deficiencies and damages incurred during shipment on carriers' bill of lading and report immediately, in writing, to Supplier and Consultant.
- 1.4.3. Store materials properly on planks, in a dry area, out of water and covered to protect from damage from adverse weather conditions. Remove wet packaging immediately.
- 1.4.4. Remove wrappings or coverings from doors upon receipt at the Project Site, and store in a vertical position, spaced with blocking to permit air circulation between them.

1.5. WARRANTY

1.5.1. Manufacturer Warranty: Warrant work manufactured from ASTM A653/A653M, A40 galvannealed steel, touched up only with zinc-rich rust inhibitive primer where coating was removed during its manufacture for period of 10 years against defects and/or deficiencies in accordance with General Conditions of the Contract. Promptly correct any defects or deficiencies which become apparent within warranty period, to satisfaction of Consultant. Defects include but are not limited to; rust perforation when stored, installed and finish painted in accordance with manufacturer's written instructions.

PART 2 - PRODUCTS

2.1. MANUFACTURERS

- 2.1.1. Steel door and frames manufacturer list: Products of the following manufacturers are acceptable subject to conformance to requirements of drawings, schedules and specifications:
 - 2.1.1.1. Baron Steel Doors & Frames; www.baronmetal.com
 - 2.1.1.2. Ceco Door: www.cecodoor.com
 - 2.1.1.3. Daybar Industries Limited; www.daybar.com
 - 2.1.1.4. Fleming Door Products Ltd.; www.flemingdoor.com
 - 2.1.1.5. Gensteel Doors, Inc.; www.gensteeldoors.com
 - 2.1.1.6. Shanahan's Limited Partnership; www.shanahans.com

2.1.2. Basis of Design:

2.1.2.1. This Specification is based on "Imperial/Versador" by Ceco Door. Comparable Products from manufacturers listed herein will be accepted provided they meet requirements of this Specification.

2.2. PERFORMANCE/DESIGN CRITERIA

- 2.2.1. Ensure Product is manufactured by a firm experienced in design and production of standard and custom commercial metal door and frame assemblies.
- 2.2.2. Cycle Test Acceptance Criteria: Ensure door and frame assembly is testing in accordance with ANSI/SDI A250.4 for "High Usage" and is certified as Level "A" (1,000,000 cycles).
- 2.2.3. Twist Test Acceptance Criteria: Maximum permanent deflection not to exceed 3 mm (1/8") under a maximum 136 kg (300 lb) load, total deflection not to exceed 32 mm (1-1/4") when tested in accordance with ANSI/SDI A250.4. Ensure tests are conducted by an independent nationally recognized accredited laboratory.

2.3. MATERIALS

2.3.1. Steel:

- 2.3.1.1. Fabricated from tensioned levelled steel to ASTM A924/A924M-18, galvanized to ASTM A653/A653M, Commercial Steel CS, Type B.
- 2.3.1.2. Steel shall be free of scale, pitting, coil breaks, surface blemishes, buckles, waves, and other defects.
- 2.3.1.3. Minimum sheet thickness; coated sheet steel complying with ASTM A653/A653M in accordance with Appendix 1: Steel Thicknesses and gauges of CSDMA "Recommended Specifications for Commercial Steel Door and Frame Products".
- 2.3.1.4. Galvanneal coating finish, designation ZF120 (A40).

2.3.2. Door Core Materials:

2.3.2.1. Honeycomb:

- 2.3.2.1.1. Structural small cell, 25 mm maximum Kraft paper 'honeycomb', sanded to required thickness.
- 2.3.2.1.2. Minimum weight of 36.3 kg per ream.
- 2.3.2.1.3. Minimum density of 16.5 kg/m².

2.3.2.2. Steel stiffeners:

- 2.3.2.2.1. Continuous vertical formed steel sections, 0.813 mm minimum thickness, spaced not more than 150 mm apart, welded at 150 mm on center maximum to each face sheet.
- 2.3.2.2.2. Fill voids with minimum density of 24 kg/m3 fibreglass insulation conforming to with ASTM C665.
- 2.3.3. Primer: Rust inhibitive for touch-up.
- 2.3.4. Door Silencers (Bumpers): Single stud rubber/neoprene type.
- 2.3.5. Fasteners for Stops: Cadmium plated steel, counter sunk flat or oval head sheet metal Phillips screws.
- 2.3.6. Mortar Guard Boxes: Minimum 0.8 mm thick (22 ga) steel.
- 2.3.7. Frame Anchors:
 - 2.3.7.1. Floor Anchors: Minimum 3 mm (1/8") thick adjustable floor anchors with 2 holes for bolting to floor.

2.3.7.2. Wall Anchors:

- 2.3.7.2.1. Masonry T-strap Type Wall Anchors: Minimum 1.2 mm thick (18 ga) steel
- 2.3.7.2.2. Existing Masonry/Concrete Wall Type Anchors: Minimum 0.912 mm thick (20 ga) steel.
- 2.3.7.2.3. Masonry Stirrup-strap Type 50 mm x 250 mm (2" x 10"): Minimum 1.519 mm thick (16 ga) steel.
- 2.3.7.2.4. Steel Stud Type: Minimum 0.912 mm thick (20 ga) steel.
- 2.3.7.2.5. Steel Stud Tension and Associated Wall Type: Minimum 0.912 mm thick (20 ga) steel.

2.4. FABRICATION

2.4.1. Welding: Carry out welding in accordance with CSA W59.

- 2.4.2. Grind exposed welds smooth and flush. Fill open joints, seams and depressions with filler or by continuous brazing or welding. Grind smooth to true sharp arises and profiles and sand down to smooth, true, uniform finish.
- 2.4.3. Hardware Requirements: Blank, mortise, reinforce, drill and tap doors and frames to receive mortised templated hardware. Check hardware list for requirements.
- 2.4.4. Frames General:
 - 2.4.4.1. Fabricate frames for doors to profiles indicated.
 - 2.4.4.2. Ensure door frames are welded type construction. Knock-down frames are not permitted.
 - 2.4.4.3. Reinforce frame as required for surface mounted hardware.
 - 2.4.4.4. Protect mortise cut outs with mortar guard boxes. Omit for gypsum board applications.
 - 2.4.4.5. Where frames occur in masonry provide strip strap, T-strap or wire type anchors. Where frames occur in gypsum board provide stud type anchors.
 - 2.4.4.6. Locate each wall anchor immediately above or below each hinge reinforcement on hinge jamb and directly opposite on strike jamb. Provide 2 anchors for rebate opening heights up to and including 1500 mm (5') and 1 additional anchor for each additional 760 mm (30") of height or fraction thereof, except as indicated below. For frames in previously placed concrete, masonry or structural steel provide anchors located not more than 150 mm (6") from top and bottom of each jamb and intermediate anchors at 660 mm (26") on centre maximum.
 - 2.4.4.7. Where floor finishes allow, fabricate frames to extend 38 mm (1-1/2") below finished floor level. Where frames are to terminate at finished floor level, provide plates for anchorage to slabs.
 - 2.4.4.8. Prepare each door opening for single stud door silencers: 3 for single door openings placed opposite hinges.
 - 2.4.4.9. Provide 0.912 mm thick (20 ga) steel snap-in or welded-in "Z" type stud anchors for door frames installed in steel stud gypsum board partitions. Ensure snap-in clips are supplied to Section 09 21 16.
 - 2.4.4.10. Factory apply touch-up primer to areas where zinc coating has been removed during fabrication
- 2.4.5. Hollow Metal Door Frames:
 - 2.4.5.1. Steel:: Minimum 1.519 mm thick (16 ga) steel.
 - 2.4.5.2. Reinforcements:
 - 2.4.5.2.1. Lock and Strike Reinforcements: Minimum 1.519 mm thick (16 ga) steel.
 - 2.4.5.2.2. Hinge Reinforcements: Minimum 3.4 mm thick (10 ga) steel.
 - 2.4.5.2.3. Flush Bolt Reinforcement: Minimum 1.519 mm thick (16 ga) steel.
 - 2.4.5.2.4. Reinforcement for Surface Applied Hardware: Minimum 1.2 mm thick (18 ga) steel.
 - 2.4.5.2.5. Concealed Door Closer or Holder Reinforcements: Minimum 2.6 mm thick (12 ga) steel.
 - 2.4.5.2.6. Top and Bottom End Channels: Minimum 1.2 mm thick (18 ga) steel.
 - 2.4.5.3. Jamb Shipping Bars: Minimum 0.912 mm thick (20 ga) steel.
 - 2.4.5.4. Mitre corners of frames. Cut frame mitres accurately and weld continuously on returns and inside of frame faces.

- 2.4.5.5. When required due to site access or due to shipping limitations, fabricate frame Product for large openings in sections, with splice joints for field assembly. Provide alignment plates or angles at each joint, fabricated of same metal thickness as frame. Indicate joints for field assembly on Shop Drawings.
- 2.4.5.6. Accurately cope and securely weld butt joints of mullions, transom bars, centre rails and sills. Grind welded joints to a smooth, uniform finish.
- 2.4.5.7. Securely attach floor anchors to inside of each jamb profile.
- 2.4.5.8. Weld in 2 temporary jamb shipping bars at each frame to maintain alignment during shipment.

2.4.6. Doors - General:

- 2.4.6.1. Fabricate doors to be swing type flush with 1 continuous face free from joints, tool markings and abrasions and with provisions for glass and/or louvre openings as indicated on Door Schedule and Drawings.
- 2.4.6.2. Coordinate louvre openings with Mechanical and Consultant.
- 2.4.6.3. For hollow metal doors, ensure longitudinal edges have continuously welded seams, filled and sanded flush full height of door.
- 2.4.6.4. Fabricate doors with top and bottom inverted recessed spot welded channels.
- 2.4.6.5. Reinforce, blank, drill and tap doors for mortised, templated hardware.
- 2.4.6.6. Reinforce doors for surface mounted hardware.
- 2.4.6.7. Undercut 19 mm (3/4") for air intake at washrooms.
- 2.4.6.8. Factory prepare holes 13 mm (1/2") diameter and larger. Factory prepare holes less than 13 mm (1/2") when required for function of device for knob, lever, cylinder, turn pieces or when these holes overlap function holes.

2.4.7. Interior Hollow Metal Doors:

- 2.4.7.1. Face Sheets: 1.519 mm thick (16 ga) minimum galvannealed steel sheet.
- 2.4.7.2. Vertical Stiffeners: 0.912 mm thick (20 ga) minimum unprimed steel sheet.
- 2.4.7.3. Glazing Stops: 1.519 mm thick (16 ga) minimum unprimed steel sheet, formed, drilled and countersunk for fastenings.
- 2.4.7.4. Fabricate each face sheet for exterior door using a sheet steel laminated under pressure to polyurethane core. Ensure core completely fills inside hollow of door.
- 2.4.7.5. Fabricate each face sheet for interior door using a sheet steel laminated under pressure to honeycomb core.
- 2.4.7.6. Reinforce, stiffen and sound deaden doors with core laminated to inside faces of panels. Ensure core completely fills inside hollow of door.

2.4.8. Fabrication Tolerances:

2.4.8.1. Frames:

- 2.4.8.1.1. Width and Height: +1.6 mm (+1/16"), -0.8 mm (-1/32").
- 2.4.8.1.2. Face, Stop and Rabbet: +/-0.8 mm (+/-1/32").
- 2.4.8.1.3. Jamb Depth: +/-1.6 mm (+/-1/16").

2.4.8.2. Doors:

2.4.8.2.1. Width and Height: +/-1.2 mm (+/-3/64").

	2.4.8.2.2.	Thickness: +/-1.6 mm (+/-1/16").
	2.4.8.2.3.	Edge Flatness: 1.6 mm (1/16") maximum.
	2.4.8.2.4.	Surface Flatness: 3 mm (1/8") maximum.
	2.4.8.2.5.	Door Twist: +/-1.6 mm (+/-1/16").
2.4.8.3.	Hardware:	
	2.4.8.3.1.	Cutouts: Template dimension +0.38 mm (+0.015"), -0 mm (-0").
	2.4.8.3.2.	Location: +/-0.8 mm (+/-1/32").
	2.4.8.3.3.	Between Hinge Centrelines: +/-0.4 mm (+/-1/64").

2.4.9. Prime Painting: Apply factory touch up primer at areas where zinc coating has been damaged during fabrication.

PART 3 - EXECUTION

3.1. INSTALLATION

- 3.1.1. Hollow Metal Doors:
 - 3.1.1.1. Install hollow metal doors in accordance with manufacturer's instructions.
- 3.1.2. Hollow Metal Frames:
 - 3.1.2.1. Install hollow metal frames in accordance with manufacturer's instructions.
 - 3.1.2.2. Set frames plumb, square, level and at correct elevation, maintaining uniform door width and height. Check and correct as necessary opening width, opening height, square, alignment, twist and plumb, in accordance with the CSDMA, "Recommended Dimensional Standards for Commercial Steel Doors and Frames".
 - 3.1.2.3. Secure anchorages and connections to adjacent construction.
 - 3.1.2.4. Remove temporary steel shipping jamb spreaders prior to setting 1-piece welded frames. Brace frames rigidly in position while being built in. Use precisely-dimensioned installation spreaders at sill and third-points of door opening height to maintain door opening width during building-in. Follow manufacturer's instructions regarding proper use of floor and jamb anchors. Remove installation spreaders only after mortar has set, where applicable.
 - 3.1.2.5. Allow for deflection to prevent structural loads from being transmitted to frame.
 - 3.1.2.6. Provide batt insulation to completely fill pressed steel frames of exterior doors and adjacent cavities.
 - 3.1.2.7. Spot Grouting:

3.1.2.7.1.	Coordinate spot grouting with Section 09 22 16 - Non-Structural Metal
	Framing.

- 3.1.2.7.2. Provide spot grout to increase rigidity of frame and improve resistance to frame rotation caused by weight of door.
- 3.1.2.7.3. Comply with manufacturer's recommendations for surface preparation, cleaning, forming, mixing, placement and curing of grout.
- 3.1.2.7.4. Mix grout in accordance with ASTM C305 requirements.
- 3.1.2.7.5. Spot grout at strike and hinge side jambs at steel door frames set in gypsum board partitions, walls and other similar locations in accordance with manufacturer's recommendations. Immediately insert gypsum panels

into jamb and attach to framing.	Do not terminate	gypsum board	against
trim.			

3.1.2.7.6. Do not use pumped slurry method to perform spot grouting.

3.1.2.8. Continuous Grouting:

- 3.1.2.8.1. Coordinate continuous grouting with Section 04 20 00.
- 3.1.2.8.2. Comply with manufacturer's recommendations for surface preparation, cleaning, forming, mixing, placement and curing of grout.
- 3.1.2.8.3. Mix grout in accordance with ASTM C305 requirements.
- 3.1.2.8.4. Provide grouting employing established procedures recommended by manufacturers. Use minimum water required to produce placement consistency.

END OF SECTION

PART 1 - GENERAL

1.1. SUMMARY

- 1.1.1. Section Includes: Provide access doors and frames including but not limited to following:
 - 1.1.1.1. Access doors and frames.

1.2. ADMINISTRATIVE REQUIREMENTS

- 1.2.1. Coordination:
 - 1.2.1.1. Verification: Determine specific locations and sizes for access doors needed to gain access to concealed equipment and indicate on schedule specified in "Submittals" Article.
- 1.2.2. Preinstallation Meetings:
 - 1.2.2.1. Conduct a pre-installation meeting in accordance with requirements of Section 01 10 00.
 - 1.2.2.2. The following minimum items shall be reviewed at the pre-installation meeting:
 - 1.2.2.2.1. Verify project requirements.
 - 1.2.2.2.2. Review installation conditions under which work is to be performed including possible site concerns.
 - 1.2.2.2.3. Inspection of surfaces to receive the work.
 - 1.2.2.2.4. Coordination requirements with other subtrades.

1.3. ACTION SUBMITTALS

- 1.3.1. Product Data Sheets:
 - 1.3.1.1. Submit manufacturer's product data sheets for products to be used in the work of this section.
- 1.3.2. Shop Drawings:
 - 1.3.2.1. Submit Shop Drawings for work of this Section. In addition to the minimum requirements indicate following:
 - 1.3.2.1.1. Face or ceiling placement.
 - 1.3.2.1.2. Tolerances and clearances.
 - 1.3.2.1.3. Method of attaching door frames to surrounding construction.
 - 1.3.2.1.4. Finishes.
 - 1.3.2.1.5. Hardware.

PART 2 - PRODUCTS

2.1. MANUFACTURERS

- 2.1.1. Manufacturer List: Products of following manufacturers are acceptable subject to conformance to requirements of Drawings, Schedules and Specifications:
 - 2.1.1.1. Acudor Products, Inc.; www.acudor.com
 - 2.1.1.2. Bar-Co, Inc. by Alfab, Inc.; www.alfabinc.com
 - 2.1.1.3. Cendrex Inc.; www.cendrex.com
 - 2.1.1.4. Cesco Products; www.cescoproducts.com

- 2.1.1.5. Elmdor/Stoneman Manufacturing Company; www.elmdorstoneman.com
- 2.1.1.6. Jensen Industries; www.jensen-ind.com
- 2.1.1.7. Karp Associates, Inc.; www.karpinc.com
- 2.1.1.8. Larsen's Manufacturing Company; www.larsensmfg.com
- 2.1.1.9. Nystrom Building Products Co.; www.nystrom.com
- 2.1.1.10. Williams Brothers Corporation of America; www.wbdoors.com

2.2. MATERIALS

- 2.2.1. Steel Plates, Shapes and Bars: ASTM A36/A36M.
- 2.2.2. Hot-Dip Galvanized Steel: Coat to comply with ASTM A123/A123M for steel and iron products and ASTM A153/A153M for steel and iron hardware.
- 2.2.3. Steel Sheet:
 - 2.2.3.1. Hot-Rolled: ASTM A1011/A1011M, Commercial Steel (CS), Type B; free of scale, pitting, and surface defects; pickled and oiled.
 - Cold-Rolled: ASTM A1008/A1008M, Commercial Steel (CS); stretcher-leveled standard of flatness.
 - 2.2.3.3. Electrolytic Zinc Coated: ASTM A879/A879M, Commercial Steel (CS), with Class C coating and phosphate treatment to prepare surface for painting.
 - 2.2.3.4. Metallic Coated: ASTM A653/A653M, Commercial Steel (CS), Type B, with A60 zinc-iron-alloy (galvannealed) coating or G60 mill-phosphatized zinc coating; stretcher-leveled standard of flatness.
- 2.2.4. Drywall Beads: Edge trim formed from 0.759 mm (22 ga) zinc-coated steel sheet formed to receive joint compound and in size to suit thickness of gypsum panels indicated.

2.3. MANUFACTURED UNITS

- 2.3.1. Flush Access Doors and Frames with Exposed Trim:
 - 2.3.1.1. Material: Prime-painted steel sheet.
 - 2.3.1.2. Surface Type: Masonry.
 - 2.3.1.3. Locations: Walls and ceilings.
 - 2.3.1.4. Door: Minimum 0.912 mm (20 ga) thick sheet metal, set flush with exposed face flange of frame.
 - 2.3.1.5. Frame: Minimum 1.519 mm (16 ga) thick sheet metal with 32 mm (1-1/4") wide, surface-mounted trim.
 - 2.3.1.6. Hinges: Spring-loaded concealed pin type.
 - 2.3.1.7. Latch: Screwdriver- operated cam latch.
- 2.3.2. Flush Access Doors and Trimless Frames:
 - 2.3.2.1. Material: Prime-painted steel sheet.
 - 2.3.2.2. Surface Type: Gypsum board.
 - 2.3.2.3. Locations: Walls and ceilings.
 - 2.3.2.4. Door: Minimum 1.519 mm (16 ga) thick sheet metal, set flush with surrounding finish surfaces.

- 2.3.2.5. Frame: Minimum 1.519 mm (16 ga) thick sheet metal with bead for type of surface indicated.
- 2.3.2.6. Hinges: Spring-loaded concealed pin type.
- 2.3.2.7. Latch: Screwdriver- operated cam latch.
- 2.3.3. Recessed Access Doors and Trimless Frames:
 - 2.3.3.1. Material: Prime-painted steel sheet.
 - 2.3.3.2. Surface Type: Gypsum board.
 - 2.3.3.3. Locations: Walls and ceilings.
 - 2.3.3.4. Door: Minimum 1.519 mm (16 ga) thick sheet metal in the form of a pan recessed 16 mm (5/8") for infill of finish matching surface type indicated.
 - 2.3.3.5. Reinforce panel as required to prevent buckling.
 - 2.3.3.6. Frame: Minimum 1.519 mm (16 ga) thick sheet metal with bead or edge for surface type indicated.
 - 2.3.3.7. Hinges: Spring-loaded concealed pin type.
 - 2.3.3.8. Latch: Screwdriver-operated cam latch with plastic grommet for access through pan recess.

2.4. FABRICATION

- 2.4.1. Shop Assembly: Latching Mechanisms: Furnish number required to hold doors in flush, smooth plane when closed as follows:
 - 2.4.1.1. For cylinder lock, furnish 2 keys per lock and key locks alike.
 - 2.4.1.2. For recessed panel doors, provide access sleeves for each locking device. Furnish plastic grommets and install in holes cut through finish.

2.5. FINISHES

- 2.5.1.1. Shop Primer for Ferrous Metal: Fast-curing, lead- and chromate-free, universal modified-alkyd primer complying with performance requirements in SSPC-Paint 25; selected for good resistance to normal atmospheric corrosion, compatibility with finish paint systems indicated and capability to provide sound foundation for field-applied topcoats despite prolonged exposure.
- 2.5.1.2. Shop Primer for Metallic-Coated Steel: Organic zinc-rich primer complying with SSPC-Paint 20 and compatible with topcoat.
- 2.5.1.3. Galvanizing Repair Paint: High-zinc-dust-content paint for re-galvanizing welds in steel, complying with SSPC-Paint 20.

PART 3 - EXECUTION

3.1. EXAMINATION

- 3.1.1. Verification of Conditions:
 - 3.1.1.1. Verify actual site dimensions and location of adjacent materials prior to commencing work. Notify Consultant in writing of any conditions which would be detrimental to the installation.
 - 3.1.1.2. Size and Location Verification: Determine specific locations and sizes for access doors needed to gain access to concealed equipment and indicate on schedule.
- 3.1.2. Evaluation and Assessment: Commencement of work implies acceptance of previously completed work.

3.2. INSTALLATION

- 3.2.1. Advise installers of other work about specific requirements relating to access door and floor door installation, including sizes of openings to receive access door and frame, as well as locations of supports, inserts and anchoring devices.
- 3.2.2. Set frames accurately in position and attach securely to supports with plane of face panels aligned with adjacent finish surfaces.
- 3.2.3. Install access doors flush with adjacent finish surfaces or recessed to receive finish material.

3.3. ADJUSTING

3.3.1. Adjust doors and hardware after installation for proper operation.

END OF SECTION

PART 1 - GENERAL

1.1. SUMMARY

1.1.1. Section Includes:

- 1.1.1.1. Testing and preparation of substrate for installation of flooring.
- 1.1.1.2. Moisture vapour control topping.
- 1.1.2. Related Sections: Following description of work is included for reference only and shall not be presumed complete:
 - 1.1.2.1. Filling of major holes, crack repairs, patching chases and trenches in concrete substrate Flatness and levelness requirements for floor to receive resilient sheet flooring: Section 03 01 30 Repairs to Concrete.
 - 1.1.2.2. Ceramic and porcelain tile: Section 09 30 00 Tiling
 - 1.1.2.3. Vinyl flooring: Section 09 65 19 Resilient Tile Flooring

1.2. ADMINISTRATIVE REQUIREMENTS

1.2.1. Coordination:

- 1.2.1.1. Coordinate preparation of concrete flooring with installation of flooring materials. Ensure that proposed materials are compatible and will achieve correct results.
- 1.2.1.2. Determine acceptable limits for moisture vapour emissions, and pH with each of the finish flooring manufacturers.
- 1.2.1.3. Schedule surface preparation work with the concrete trade and flooring installation trade.

1.2.2. Preinstallation Meeting:

- 1.2.2.1. Prior to start of concrete work, arrange for Project site meeting of all parties associated with work of this Section, including Contractor, various flooring installers, and concrete finisher in accordance with Section 01 10 00.
- 1.2.2.2. Review Specification for work included under this Section and determine complete understanding of requirements and responsibilities relative to work included, storage and handling of materials, materials to be used, installation of materials, sequence and quality control, Project staffing, restrictions flooring installation and other matters affecting construction, to permit compliance with intent of this Section. Ensure Division 03 requirements for concrete are compatible with requirements of this Section; floor flatness and floor levelness requirements for various floor finishes and their acceptability by flooring manufacturer; surface texture of finished floor required for various floor finishes; acceptable approaches to remediation of high moisture and high pH floors; adhesive application and floor covering installation.

1.3. SUBMITTALS

1.3.1. Product Data Sheets:

- 1.3.1.1. Submit product data sheets for all products proposed for use in this Section.
- 1.3.1.2. Submit WHMIS Safety Data Sheets for each product.
- 1.3.2. Shop Drawing: submit floor plan showing the locations of all field testing of concrete floors.
- 1.3.3. Test and Evaluation Reports:, submit field test reports from recognized approved independent testing laboratory for following requirements:

- ._...
- 1.3.3.1. Submit letters of acceptance from each manufacturer of flooring products specified in related Sections that the combination of products and methods used in the overall flooring preparation and installation are compatible and appropriate for their intended application.
- 1.3.3.2. Submit moisture vapour emissions testing for all concrete floor areas.
- 1.3.3.3. Submit calcium chloride test results in accordance with requirements specified herein.
- 1.3.3.4. Submit pH test results and verify their acceptability to resilient sheet flooring manufacturer in accordance with requirements specified herein.

1.4. CLOSEOUT SUBMITTALS

1.4.1. Update floor plan shop drawing with notes to confirm field testing locations and final test readings.

1.5. QUALITY ASSURANCE

- 1.5.1. Qualifications:
 - 1.5.1.1. Field Testing Inspectors: Independent 3rd party inspectors with minimum three years experience with concrete testing.
 - 1.5.1.2. Installers: Provide work of this Section executed by competent installers with minimum of 5 years experience in concrete preparation and application of concrete Products specified.

1.6. DELIVERY, STORAGE AND HANDLING

- 1.6.1. Delivery and Acceptance Requirements:
 - 1.6.1.1. Deliver materials in good condition to site in manufacturer's original unopened containers that bears name and brand of manufacturer, Project identification, shipping and handling instructions.

1.7. SITE CONDITIONS

- 1.7.1. Ambient Conditions:
 - 1.7.1.1. Maintain appropriate environmental conditions and protect work during and after installation. Comply with trade standards and manufacturer's Product instructions. Follow Product MSDS and label instructions concerning safety, health and other related precautionary and environmental protection.
 - 1.7.1.2. Maintain relative humidity in accordance with manufacturer's instructions.
 - 1.7.1.3. Exhaust temporary heaters to building exterior to prevent health hazards and damage to work from toxic fumes and emanations.
 - 1.7.1.4. Maintain ambient air temperature and temperature of floor covering areas at not less than 10 deg C (50 deg F) or more than 29 deg C (85 deg F) 48 hours before, during installation and for 48 hours after application unless otherwise required in Product instructions.

1.8. WARRANTY

- 1.8.1. Manufacturer Warranty: Warrant work of this Section for period of 25 years against defects and/or deficiencies in accordance with General Conditions of the Contract. Promptly correct any defects or deficiencies which become apparent within warranty period, at no expense to Owner.
- 1.8.2. Defects include but are not limited to; failure of floor finish remaining in place and bonding to structural slab and finish becoming defective and spalling and/or cracking.

PART 2 - PRODUCTS

2.1. MANUFACTURERS

- 2.1.1. Manufacturer List: Products of following manufacturers are acceptable subject to conformance to requirements of Drawings, Schedules and Specifications:
 - 2.1.1.1. Ardex Canada, Inc.; www.ardex.ca
 - 2.1.1.2. Flextile Ltd.; www.flextile.net
 - 2.1.1.3. Laticrete International, Inc.; www.laticrete.com
 - 2.1.1.4. Mapei Corporation; www.mapei.ca

2.2. MATERIALS

- 2.2.1. Concrete Moisture Emission Reducer: Characteristics, performance requirements:
 - 2.2.1.1. Epoxy cement, compliant with ASTM F3010.
 - 2.2.1.2. Antimicrobial additive
 - 2.2.1.3. Reduce the moisture vapour emission rate of concrete slabs ≤ 3 lbs. per 1,000 ft² per 24 hours.
 - 2.2.1.4. Reduce the surface alkalinity of concrete slabs down to pH levels of 9
 - 2.2.1.5. Provide 1 of following:
 - 2.2.1.5.1. "Planiseal™ VS" by Mapei Corporation.
 - 2.2.1.5.2. "Sikafloor® 81 EpoCemCA" by Sika Canada Inc.
 - 2.2.1.5.3. "Ardex MC Rapid" by Ardex Canada

2.2.2. Primer:

- 2.2.2.1. Provide 1 of following:
 - 2.2.2.1.1. "4040 Acrylic Primer" by Flextile Ltd except where epoxy moisture mitigation systems.
 - 2.2.2.1.2. "Primer X" by Mapei Corporation
 - 2.2.2.1.3. "Sikafloor 155 WN" by Sika Canada
 - 2.2.2.1.4. "Ardex P4" by Ardex Canada

PART 3 - EXECUTION

3.1. EXAMINATION

- 3.1.1. Verification of Conditions for New Concrete:
 - 3.1.1.1. Ensure new concrete slab has been properly cured and dry for minimum of 28 Days and has reached minimum compressive strength of 25 MPa (3625 psi) and a minimum of 1.5 MPa (218 psi) in tension.
 - 3.1.1.2. Ensure no curing and sealing compounds, hardeners or other chemical additives have been used on concrete.
 - 3.1.1.3. Notify Consultant in writing of any conditions which would be detrimental to the installation.

3.2. TESTING FOR ALL CONCRETE FLOORS:

- 3.2.1. Conduct concrete testing on all concrete floors prior to application of moisture vapour control topping and following corrective work.
- 3.2.2. Moisture Vapour Testing:
 - 3.2.2.1. Perform calcium chloride test no earlier than 28 Days after concrete has been placed in accordance with requirements of ASTM F1869 for new and existing concrete floors, and insitu probe RH testing in accordance with ASTM F2170 for new concrete prior to installation of flooring material.
 - 3.2.2.2. Conduct 3 tests for each of the RH test methods for first 93 m2 (1000 sq ft) and 1 additional test for every 93 m² (1000 sq ft) of flooring. Ensure moisture emission from concrete floor does not exceed 2.27 kg/93 m² (5 lbs/1000 sq ft) in 24 hours or has a maximum RH of 80%.
 - 3.2.2.3. Provide results to Consultant prior to commencement of installation including diagram of area tested showing location of each moisture test.
 - 3.2.2.4. When concrete moisture emission rate is between 2.27 kg/93 m² (5 lbs/1000 sq ft) and 6.79 kg/93 m² (15 lbs/1000 sq ft) and in 24 hours use a concrete moisture emission reducer.
 - 3.2.2.5. Do not proceed with installation until moisture problem has been corrected.
- 3.2.3. Alkalinity Testing (pH):
 - 3.2.3.1. Measure pH of concrete in accordance with ACI PRC-364.17: How to Measure pH of a Concrete Surface Prior to Installation of a Floor Covering.
 - 3.2.3.2. Perform pH test no earlier than 28 Days after concrete has been placed to ensure alkali salt residue is within limitation acceptable to manufacturer and to avoid adhesive failure, discoloration, shrinkage and softening of floor covering. If pH results are higher than 9.0, report to Consultant, Contractor or Owner for investigation and remedial work.
 - 3.2.3.3. Perform at least three pH tests must be performed for the first 93 m² (1,000 square feet) of space. One additional test should be performed for each additional 93 m² (1,000 square feet 0 thereafter.
 - 3.2.3.4. Refer to manufacturer for ways to neutralize floor prior to beginning of installation. Neutralize by sanding, vacuuming and/or by water plus mild sulfuric or sulfamic acid application as recommended by manufacturer.
 - 3.2.3.5. Retest to assure pH has been neutralized.
- 3.2.4. Capillary Moisture Testing:
 - 3.2.4.1. Moisture content of concrete substrate must be ≤ 4 % by mass (PBW part by weight) as measured with a Tramex®CME / CMExpert type concrete moisture meter.
 - 3.2.4.2. Before proceeding with application, test surfaces for moisture content in accordance with ASTM D4263 and in consultation with manufacturer to ensure they are suitable for application.
 - 3.2.4.3. Provide all test results to Consultant prior to commencement of installation including diagram of area tested showing location of each moisture test, alkalinity test and capillary moisture test.
- 3.2.5. Evaluation and Assessment:
 - 3.2.5.1. Report all testing results to manufacturer's representative and submit written acceptance of these results approval before proceeding.
 - 3.2.5.2. Commencement of work implies acceptance of previously completed work.

3.3. SURFACE PREPARATION

- 3.3.1. For all new and existing concrete floor areas:
 - 3.3.1.1. Prepare existing and new concrete floors over entire area with steel shot blasting or other method recommended by manufacturer. Remove uneven joints, rough areas, foreign and projection off surfaces. Surface to be hard, sound and roughened to irregular surface with weak concrete removed and surface holes and voids exposed. Equip dry blasting machine with vacuum to minimize dust.
 - 3.3.1.2. Shot blast floor to remove soft material and to achieve a profile equivalent to ICRI / CSP 3 4.
 - 3.3.1.3. Shot blast to expose cracks in concrete surface. For cracks lesser than 1.5 mm (1/16") employ crack reinforcing tape in accordance manufacturer's recommendations. Repair cracks, holes or other deficiencies in accordance with manufacturer's recommendations.
 - 3.3.1.4. Blow clean control joints, sawcuts and cracks with compressed air.
 - 3.3.1.5. Prepare concrete floors to receive sheet flooring in accordance with requirements of ASTM F710. Achieve CSP of #2 #3. Consult individual manufacturer for their specific recommendations and follow them as required.

3.4. MOISTURE BARRIER APPLICATION

- 3.4.1. If moisture levels exceed acceptable limit, apply moisture emission reducer in accordance with ASTM F710 and ASTM F3010.
- 3.4.2. Follow manufacturer's recommendations to determine whether cracks are filled before or after application of moisture barrier cement.
- 3.4.3. Mix moisture barrier in accordance with manufacturer's printed instructions.
- 3.4.4. Material components minimum 15°C (60°F) at time of mixing.
- 3.4.5. Apply coating using roller to achieve thickness as per manufacturer's instructions. Allow to cure.
- 3.4.6. Apply second coat of moisture barrier coating, dry film thickness of 12.8 mils. Allow to cure.
- 3.4.7. Re-test for moisture vapour emission and pH level.

3.5. CLEANING

- 3.5.1. Remove excess adhesive from floor, base and wall surfaces without damage.
- 3.5.2. Clean floor and base surface to flooring manufacturer's instructions.

3.6. PROTECTION

- 3.6.1. Protect installed flooring as recommended by flooring manufacturer against damage from rolling loads, other trades or placement of fixtures and equipment.
- 3.6.2. Prohibit foot traffic on floor for 24 hours after installation. Prohibit heavy traffic, rolling loads and furniture or appliance placement for a minimum of 72 hours after installation.

END OF SECTION

PART 1 - GENERAL

1.1. SUMMARY

- 1.1.1. Section Includes: Provide gypsum board assemblies work including but not limited to following:
 - 1.1.1.1. Gypsum board ceilings, partitions and repairs to existing gypsum board.
 - 1.1.1.2. Corner beads, casing beads, trim, control joints and corner reinforcement.
 - 1.1.1.3. Taping and filling.
 - 1.1.1.4. Sound attenuation batts.
 - 1.1.1.5. Installation of access doors, and panels supplied by other Sections in gypsum board walls and ceilings as required.

1.2. QUALITY ASSURANCE

1.2.1. Qualifications:

1.2.1.1. Installers: Provide work of this Section executed by competent installers with minimum 5 years experience in the application of Products, systems and assemblies specified and with approval and training of the Product manufacturers.

1.3. DELIVERY, STORAGE AND HANDLING

- 1.3.1. Storage and Handling Requirements:
 - 1.3.1.1. No outside storage permitted. Store in clean, dry area, off ground. Provide adequate ventilation to avoid excess moisture, surface relative humidity and mould or fungal growth. Remove immediately any board showing signs of mould, mildew or fungal growth.
 - 1.3.1.2. Stack gypsum board flat on level and dry surface without overhanging boards. Prevent sagging and damage to edges, ends and surfaces. Protect bagged Products from moisture or wetting.

1.4. SITE CONDITIONS

1.4.1. Ambient Conditions:

- 1.4.1.1. Do not install work of this Section in any area unless satisfied that work in place has dried out and that no further installation of materials requiring wetness, moisture or dampness is contemplated. Ensure relative humidity in area of work of this Section does not exceed 55% for duration of Project.
- 1.4.1.2. Ensure temperature of surrounding areas is min 13 deg C (55 deg F) and max 21 deg C (70 deg F) for 7 Days before and during application of gypsum board; maintain for 4 Days thereafter. Ensure heat is provided at appropriate time before work has started to bring surrounding and adjacent materials up to required temperature and maintained as specified. Avoid concentrated or irregular heating during drying by means of deflectors or protective screens.
- 1.4.1.3. Ensure ventilation is provided for proper drying of joint filler and adhesive and to prevent excessive humidity. Do not force dry adhesives and joint treatment.

PART 2 - PRODUCTS

2.1. MANUFACTURERS

2.1.1. Manufacturer List: Products of following manufacturers are acceptable subject to conformance to requirements of Drawings, Schedules and Specifications:

- 2.1.1.1. Bailey Metal Products Ltd.; www.bmp-group.com
- 2.1.1.2. CertainTeed Corporation; www.certainteed.com
- 2.1.1.3. CGC Inc; www.cgcinc.com
- 2.1.1.4. Georgia-Pacific Canada, Inc.; www.gpgypsum.com
- 2.1.1.5. Johns Manville; www.jm.com
- 2.1.1.6. Roll Formed Specialty; www.rollformed.com
- 2.1.1.7. Trim-Tex Inc.; www.trim-tex.com

2.2. GYPSUM BOARD

- 2.2.1. Gypsum Board: Conforming to ASTM C1396/C1396M. Unless indicated otherwise use 1200 mm (4') wide standard facing board in maximum continuous lengths up to 3600 mm (12'), beveled and/or tapered edges to suit design requirements with butted square ends:
 - 2.2.1.1. Gypsum Board (Walls): Provide 15.9 mm (5/8") thick with tapered edges unless otherwise specified as follows:
 - 2.2.1.1.1. Provide 9.5 mm (3/8") thick gypsum board on curved walls.
 - 2.2.1.2. Gypsum Board (Ceiling): Provide 15.9 mm (5/8") thick with tapered edges unless otherwise specified as follows:
 - 2.2.1.2.1. Use anti sag sheets.
- 2.2.2. Moisture Resistant Gypsum Board: ASTM C1658/C1658M, glass mat faced, silicone treated core gypsum board, ASTM D3273 with a rating of 10, no mould growth after 4 weeks exposure, 12.7 mm (1/2") or Type X, 15.9 mm (5/8"). Acceptable products:
 - 2.2.2.1. "DensArmor Plus® High Performance Interior Panel" by Georgia-Pacific Canada, Inc.
 - 2.2.2.2. "CGC Sheetrock® Brand Glass-Mat Panels Mold Tough®" by CGC Inc.
- 2.2.3. Fire Rated Gypsum Board having Testing Agency Fire Rating Identification Stamp on Each Sheet: ASTM C1396/C1396M, Type X, 12.7 mm (1/2") and/or 15.9 mm (5/8") thick gypsum board 1200 mm (4') wide, maximum practical length and tapered edge as required by each fire resistance assembly. Acceptable products:
 - 2.2.3.1. "Gyproc Fireguard Type X or Type C" by Georgia-Pacific Canada, Inc.,
 - 2.2.3.2. "CGC Sheetrock Firecode X or Firecode C" by CGC Inc.
 - 2.2.3.3. "ProRoc Type X or Type C" by CertainTeed Corporation.
- 2.2.4. Gypsum Board Tile Backer Board: ASTM C1178/C1178M, glass mat faced, water-resistant gypsum core board, with a rating of 10 in accordance with ASTM D3273, no mould growth after 4 weeks exposure, 15.9 mm (5/8") thick plain or Type X;. Acceptable products:
 - 2.2.4.1. "DensShield® Tile Backer" by Georgia-Pacific Canada, Inc.
 - 2.2.4.2. "Durock® Glass-Mat Tilebacker" by CGC Inc.
 - 2.2.4.3. "GlasRock® Diamondback® Tile Backer" by CertainTeed Corporation.
- 2.2.5. Abuse Resistant Gypsum Board: Provide 1 of following:
 - 2.2.5.1. Enhanced gypsum core encased in heavy duty paper facers on front and back, 15.9 mm (5/8"), conforming to ASTM C1396/C1396M and attaining a maximum of 0.014" as tested to ASTM D4060 (H-18 abrasion wheel, 500 grams, 200 cycles), a maximum of 0.123" indentation as tested to ASTM D5420 (72 in lbs) and a minimum of (133 ft lbs) as tested to ASTM E695 (50 lb bag) and ASTM C1629/C1629M Type X in fire rated assemblies. Acceptable products:

- 2.2.5.1.1. "Extreme Abuse with M2Tech" by CertainTeed Corporation
- 2.2.5.1.2. "CGC Sheetrock® Brand Mold Tough® AR Firecode Core" by CGC Inc.
- 2.2.5.2. Enhanced gypsum core encased in fibreglass facers on front and back, 15.9 mm (5/8"), conforming to ASTM C1396/C1396M and attaining a maximum of 0.014" as tested to ASTM D4060 (H-18 abrasion wheel, 500 grams, 200 cycles), a maximum of 0.123" indentation as tested to ASTM D5420 (72 in lbs) and a minimum of (133 ft lbs) as tested to ASTM E695 (50 lb bag) and ASTM C1629/C1629M Type X in fire rated assemblies. Acceptable products:
 - 2.2.5.2.1. "DensAmor Plus® Abuse Guard" by Georgia-Pacific Canada, Inc.
 - 2.2.5.2.2. "Sheetrock Mold Tough Glass Mat Abuse Resistant" by CGC Inc.

2.3. FASTENERS

- 2.3.1. Screws for Sheet Steel Members: ASTM C954, self-drilling, self-tapping gypsum board screws, 25 mm (1") long #6 for single layer application, 41 mm (1-5/8") long #7 for double layer application and as follows:
 - 2.3.1.1. For single layer application over steel framing; self-drilling, self-tapping, case hardened, No. 6 contoured Phillips head or Type S bugle head, sized for minimum 15.9 mm (5/8") penetration into steel framing. Ensure fasteners are corrosion resistant. Use drill point screws for abuse resistant gypsum fibre panels.
 - 2.3.1.2. For double layer application over gypsum backing board and existing gypsum board; 38 mm (1-1/2") Type G bugle head. For each additional layer of board, increase length of fasteners proportionally.
- 2.3.2. Screws; for exterior sheathing board: in accordance with manufacturer's installation instructions to comply with design wind loads.
- 2.3.3. Laminating Compound: Asbestos-free, as recommended by manufacturer. Manufacturer's standard, multi-purpose construction adhesive. At fire-rated construction, use adhesive which conforms to that used in applicable fire tests. Acceptable products:
 - 2.3.3.1. "Sheetrock Brand Laminating Compound" by CGC Inc.,
 - 2.3.3.2. "Dehydratine 9T" by Grace Construction Products
 - 2.3.3.3. "Stangard Foamastic" by Standard Chemicals Ltd.

2.4. JOINT TREATMENT MATERIALS

- 2.4.1. Joint Tape: Conforming to ASTM C475/C475M, provide following:
 - 2.4.1.1. Regular Gypsum Board: Use kraft paper joint tape with feathered edges and minute perforations 50 mm (2") wide.
 - 2.4.1.2. Moisture Resistant Gypsum Board or Cement Board: Use glass fibre tape only, open weave, with pressure sensitive adhesive 1 side. Acceptable products:
 - 2.4.1.2.1. "Durock Cement Board Tape" by CGC Inc.
- 2.4.2. Joint Fillers and Topping Compound: Either slow or fast setting, low shrinkage type free of asbestos fillers and as recommended by manufacturer. Use "Gyproc 90" by Georgia-Pacific Canada, Inc. or "Durabond 90" by CGC Inc. at exterior soffits.
- 2.4.3. Finish coat for level 5 finish: vinyl acrylic latex based coating to ASTM C840, spray applied, "Tuff-Hide Primer-Surfacer" by CGC Inc.

2.5. ACCESSORIES

2.5.1. Dust Barrier: Minimum 0.152 mm (6 mil) polyethylene, CAN/CGSB-51.33-M, Type 2.

- 2.5.2. Resilient Sponge Tape: Self-sticking adhesive on 1 side, closed cell neoprene sponge tape. Acceptable products:
 - 2.5.2.1. "Rubatex®" by Rubatex Corp.,
 - 2.5.2.2. "Foamflex # 1220" by Jacobs & Thompson Inc.; www.foamparts.com
 - 2.5.2.3. "Backerseal™ (Greyflex)™" by Emseal LLC; www.emseal.com.
- 2.5.3. Sealant for Moisture Resistant Gypsum Board Edges: "Sheetrock Brand W/R Sealant" by CGC Inc., or similar type acceptable to Consultant.
- 2.5.4. Corner Beads: "PG1 Platinum Square Nose Tape-On Trims" by Bailey Metal Products Ltd. "No-Coat®" by CertainTeed or "Fast Edge" paper by Trim-Tex at corners, reveals, or similar. Provide custom shapes of similar materials and design as noted.
- 2.5.5. Trim: "PG4 Platinum Tape-On L-Trims" by Bailey Metal Products Ltd.
- 2.5.6. Flexible Casing Beads: 0.531 mm (25 ga) steel, wipe coated, angle shaped in size to fit over edge of gypsum board, to suit curved applications.
- 2.5.7. Control Joints: Pre-fabricated control joints prepared to suit site conditions. Certified by manufacturer for use at fire resistance rated assemblies. Acceptable products:
 - 2.5.7.1. "No. 093" zinc alloy control joint by CGC Inc.
 - 2.5.7.2. "DRM-50-25 2-PC" by Fry Reglet
 - 2.5.7.3. "093V Expansion Bead" by Trim-Tex Drywall Products Inc.
- 2.5.8. Access Doors and Panels:
 - 2.5.8.1. Supplied as part of Section 08 31 13 and Divisions 21, 22, 23, 26, 27 and 28 for installation as part of this Section.

2.6. SOUND CONTROL MATERIALS

- 2.6.1. Acoustical Insulation: CAN/ULC S702, Type 1, of sufficient thickness to meet required STC rating for sound-rated partitions and of width to suit metal framing spacing
 - 2.6.1.1. Acoustical Insulation Batts in non-fire rated assemblies: glass fibre
 - 2.6.1.1.1. Acceptable Products:
 - 2.6.1.1.1.1 "EcoTouch™ QuietZone® PINK™ FIBERGLAS® Acoustical Insulation" by Owens Corning Canada LP; <u>www.insulation-owenscorning.ca</u>
- 2.6.2. Strip Impalement Clips: 25 mm (1") wide strip of "Insul-Hold" by Insul-Hold Co., Inc.; www.insulhold.com, fabricated from 0.531 mm (25 ga) galvanized sheet metal in 30 m (100') rolls with punch-out insulation securement arrows. Alternatively, use special studs with punch-out impalement strips.
- 2.6.3. Acoustic Sealant:
 - 2.6.3.1. Concealed locations: Single component, non-hardening, non-skinning synthetic rubber sealant; "Tremco Acoustical Sealant" by Tremco Canada; www.tremcosealants.com.
 - 2.6.3.2. Fire resistance locations: Smoke-seal sealant with flame-spread not more than 25 and smoke developed classification not more than 50 to CAN/ULC-S102.
- 2.6.4. Elastomeric Sealant: As recommended by manufacturer of fibre-reinforced gypsum sheathing board.
- 2.6.5. Gaskets: Closed cell neoprene, 3 mm (1/8") thick x 64 mm (2-1/2") wide.

PART 3 - EXECUTION

3.1. EXAMINATION

- 3.1.1. Verification of Conditions: Verify actual site dimensions and location of adjacent materials prior to commencing work. Notify Consultant in writing of any conditions which would be detrimental to the installation.
- 3.1.2. Evaluation and Assessment: Commencement of work implies acceptance of previously completed work.

3.2. PREPARATION

- 3.2.1. Ensure that services, blocking and supports to be installed in partitions have been installed and inspected before closing in with gypsum board.
- 3.2.2. Vacuum clean stud track, suspended support framing, and spaces to be concealed before starting the days installation.

3.3. INSTALLATION

3.3.1. Gypsum Board Application:

- 3.3.1.1. Provide gypsum board in accordance with manufacturer's written installation instructions and finish to requirements of ASTM C840. Install Moisture Resistant Gypsum Board on any wall/partition with a paint finish containing a plumbing fixture (i.e. water closets, sinks, tubs, etc.). Install gypsum board tile backer board on any wall partition or ceiling requiring a tile finish.
- 3.3.1.2. Provide metal trim casing bead at junctions with dissimilar materials. Provide reveals at junctions with dissimilar materials where indicated.
- 3.3.1.3. Provide finished work plumb, level and true, free from perceptible waves or ridges and square with adjoining work.
- 3.3.1.4. Cut and fit gypsum board to accommodate or fit around other parts of the Work. Provide work of this Section accurately and neatly.
- 3.3.1.5. Butt gypsum board sheets together in moderate contact. Do not force into place. Place tapered or wrapped edges next to 1 another.
- 3.3.1.6. Provide gypsum board perpendicular to framing and in lengths that will span ceilings and walls without creating end (butt) joints. If butt joints do occur stagger and locate them as far from centre of walls and ceilings as possible. Accurately fit exposed butt joints together and make edges smooth.
- 3.3.1.7. Support ends and edges on framing.
- 3.3.1.8. Fasten gypsum board to metal furring and steel studs with screws. Space screws at 200 mm (8") oc at board edges and 300 mm (12") oc on board field.
- 3.3.1.9. Gypsum Board Single Layer:
 - 3.3.1.9.1. Ceilings: Apply gypsum board to metal furring with screws. Erect board with long dimension parallel to supports. Locate end joints over supporting members. Space screws at 200 mm (8") oc.
 - 3.3.1.9.2. Partitions: Apply gypsum board to steel studs with screws. Erect board with long dimension parallel to supports. Locate end joints over supporting members. Locate vertical joints at least 300 mm (12") from jamb lines of openings. Space screws at 200 mm (8") oc at board edges and 300 mm (12") oc on board field.

- 3.3.1.9.3. Ceiling and Partition Fasteners: Ensure perimeter screws are not less than 9 mm (3/8") nor more than 13 mm (1/2") from edges and ends are opposite screws on adjacent boards. Drive screws with power screw-gun and set with countersunk head slightly below surface of board.
- 3.3.1.9.4. Joints: Finish all joints unless specified otherwise.

3.3.1.10. Gypsum Board - Double Layer:

- 3.3.1.10.1. Lay out work to minimize end joints on face layer; to offset parallel joints between face and base layers by at least 250 mm (10") and to apply face layer at right angles to base layer.
- 3.3.1.10.2. Base Layer: Ensure base layer is same as face layer, or backing board, and applied at right angles to framing members. Secure base layer with screws spaced 300 mm (12") oc to each member. Ensure perimeter screws are not more than 13 mm (1/2") from edges and ends are opposite screws on adjacent boards. Ensure surface of erected base layer is straight, plumb or level and without protrusions before face layer is applied.
- 3.3.1.10.3. Face Layer: Apply face layer at right angles to base layer with screws.
- 3.3.1.10.4. Joints: Finish joints in face layers only, unless otherwise required to achieve fire resistant ratings indicated, as hereinafter specified. Ensure setting compound for fire rated construction conforms to requirements of authorities having jurisdiction to obtain fire rating shown on Drawings.

3.3.2. Interior Ceilings:

- 3.3.2.1. Comply with recommendations of CGC Drywall Steel-Framed Systems Folder 09250-SA 923.
- 3.3.2.2. Provide hanger wires spaced at maximum 1200 mm (4') oc along carrying channels and within 150 mm (6") of ends of carrying channel runs. Secure hanger wires to inserts in structure above.
- 3.3.2.3. Provide carrying channels maximum 1200 mm (4') oc and within 150 mm (6") of walls. Secure with hanger wire saddle-tied along channels. Provide 25 mm (1") clearance between runners and walls. Provide splicers behind joints. Level channels to a maximum tolerance of 3 mm (1/8") over 3600 mm (12').
- 3.3.2.4. Provide metal furring channels at right angles to carrying channels at maximum 600 mm (24") oc and within 150 mm (6") of walls. Provide 25 mm (1") clearance between furring ends and abutting walls. Attach furring channels to carrying channels with saddle-tie of double strand tie wire.
- 3.3.2.5. Provide additional cross-reinforcing at bulkheads and other openings.
- 3.3.2.6. Provide ceiling gypsum board, smooth and level. In areas with a high humidity content (ie. Washrooms, janitor closets, etc.) install MRGB.

3.3.3. Metal Trim and Accessories:

- 3.3.3.1. Provide metal trim casing beads at reveals; at ceiling-wall intersections and partition perimeters; and at intersection of dissimilar constructions such as gypsum board to concrete.
- 3.3.3.2. Provide metal trim casing beads where gypsum board abutts against a surface having no trim concealing junction.
- 3.3.3.3. Provide a 13 mm (1/2") separation gasket between metal trim casing beads and window frames or other cold surfaces or provide sponge tape between gypsum board partition or furring framing, where such framing abuts exterior door or window frame, sponge tape

- between floor and gypsum board partition track. Ensure tape is either full width or 1 strip 9 mm (3/8") wide on each side of framing member.
- 3.3.3.4. Provide casing bead and sponge tape where gypsum board abuts materials other than itself and acoustic tile ceilings including at exterior door and window frames, where juncture is not concealed with trim; or elsewhere where indicated on Drawings. Unless indicated otherwise, use tape 3 mm (1/8") narrower than casing bead to provide recess at exposed side. Compress tape by 25%.
- 3.3.3.5. Provide metal trim casing beads where indicated on Drawings.
- 3.3.3.6. Access Doors and Panels: Install access doors and panels supplied as part of work of Divisions 22, 23 and 26 and where required as part of work of this Section in walls, bulkheads, ceilings and soffits.

3.3.4. Control Joints:

- 3.3.4.1. Provide either manufactured control joint devices or field fabricated control joints from suitable materials to suit site conditions in accordance with manufacturer's instructions and/or ASTM C840.
- 3.3.4.2. Set in gypsum facing board, supporting control joints with studs or furring channels on both sides of joint. Ensure double studs with discontinuous tracks and double suspended ceiling furring channels have been installed prior to commencing board and bead application at control joints. Provide control joints as required to prevent cracks at following locations:
 - 3.3.4.2.1. Where a partition, wall or ceiling traverses a construction joint (expansion, seismic or building control element) in base building structure
 - 3.3.4.2.2. Where a wall or partition runs in an uninterrupted straight plane exceeding 9.1 m (30') (Note: A full height door frame may be considered a control joint).
 - 3.3.4.2.3. interior ceilings with perimeter relief: installed so linear dimensions between control joints do not exceed 15 m (50') and total area between control joints does not exceed 230 m² (2,500 sq ft).
 - 3.3.4.2.4. Interior ceilings without perimeter relief: installed so linear dimensions between control joints do not exceed 9.1 m (30') and total area between control joints does not exceed 84 m² (900 sq ft).
 - 3.3.4.2.5. Exterior ceilings and soffits: installed so linear dimensions between control joints do not exceed 15 m (50') and total area between control joints does not exceed 230 m² (2,500 sq ft).
 - 3.3.4.2.6. At stress points (ie corners of openings or changes in direction of surfaces).
- 3.3.4.3. Provide additional control joints at long and narrow surfaces.
- 3.3.4.4. Provide control joints full height floor to ceiling or door header to ceiling in partitions and furring runs.
- 3.3.4.5. Provide control joints from wall to wall in ceiling areas.
- 3.3.4.6. Provide continuous polyethylene dust barrier behind and across control joints.
- 3.3.4.7. Ensure Consultant reviews exact locations of control joints.

3.3.5. Sound Control:

- 3.3.5.1. Where indicated on Drawings, provide sound rated partitions and ceiling in locations indicated to meet required minimum STC rating. Apply gypsum board on both sides of sound-proofed partitions. Follow manufacturer's details and recommendations.
- 3.3.5.2. Provide sound attenuation insulation to completely fill height of stud cavities. Tightly butt ends and sides of blankets within cavities. Cut blankets to fit small spaces. Carefully fit

- blankets behind electrical outlets, bracing, fixture attachments and mechanical and electrical services.
- 3.3.5.3. Mechanically fasten blankets to back of gypsum board as recommended by gypsum board manufacturer.
- 3.3.5.4. At sound attenuating suspended ceiling and enclosures having spring isolator hangers, terminate ceiling or enclosure at adjacent construction by providing continuous isolator strip and sealed joint.
- 3.3.6. Joint Treatment Gypsum Board:
 - 3.3.6.1. Verify board is firm against framing members and screw heads are properly depressed.
 - 3.3.6.2. Mix joint compound or ready-to-use compounds according to manufacturer's directions. Use pure, unadulterated, clean water for mixing. Permit mixed material to stand 30 minutes before using. Do not mix more material than can be used within 1 hour. Do not use set or hardened compound. Clean tools and equipment after mixing each batch.
 - 3.3.6.3. Tape and fill joints and corners in accordance with gypsum board manufacturer's printed instructions. Fill either manually, using hand tools of trade, or by a mechanical taping and filling machine of proven efficiency.
 - 3.3.6.4. Remove plastic tape from control joints after finishing with joint compound.
 - 3.3.6.5. After final coats of filler have dried at least 24 hours, sand surface lightly with No. 00 sandpaper to leave it smooth, ready for decoration.
 - 3.3.6.6. Provide finished work smooth, seamless, plumb and true, flush and with square plumb neat corners.
 - 3.3.6.7. Levels of Finish: Provide Level 4 finish in accordance with ASTM C840.
- 3.3.7. Cutting and Patching: Cooperate and coordinate with other Sections to obtain satisfactory gypsum board finish work. Do cutting, patching and Make Good as required by installation of work of other Sections.

3.4. CLEANING

3.4.1. Clean off beads, casings, joint cement droppings and similar items and remove surplus materials and rubbish on completion and as directed.

3.5. PROTECTION

3.5.1. Provide protection of materials and work of this Section from damage by weather and other causes. Perform work in areas closed and protected from damage due to weather. Protect work of other trades from damage resulting from work of this Section. Make Good such damage immediately.

END OF SECTION

PART 1 - GENERAL

1.1. SUMMARY

- 1.1.1. Section Includes: Provide acoustical panel ceilings including but not limited to following:
 - 1.1.1.1. Ceiling suspension systems.
 - 1.1.1.2. Lay-in acoustical ceiling panels.
- 1.1.2. Related Sections: Following description of work is included for reference only and shall not be presumed complete:
 - 1.1.2.1. Provision of suspended support framing: Section 09 22 16 Non-Structural Metal Framing.
 - 1.1.2.2. Provision of mechanical fixtures: refer to mechanical.
 - 1.1.2.3. Provision of electrical, communication and security fixtures: refer to electrical.

1.2. ADMINISTRATIVE REQUIREMENTS

1.2.1. Coordination:

- 1.2.1.1. Do not begin installation of ceiling suspension system until work above ceiling has been completed and inspected.
- 1.2.1.2. Coordinate ceiling work to accommodate components of other Sections built into acoustical ceilings.

1.2.2. Preinstallation Meetings:

- 1.2.2.1. Arrange preinstallation meeting 1 week prior to commencing work with all parties associated with trade as designated in Contract Documents or as requested by Consultant. Presided over by Contractor include Consultant who may attend, Subcontractor performing work of this trade, Owner's representative.
- 1.2.2.2. Purpose of meeting:
 - 1.2.2.2.1. Verify Project requirements,
 - 1.2.2.2.2. Discuss coordination with work of other Sections,
 - 1.2.2.2.3. Review manufacturer's installation instructions [and warranty conditions],
 - 1.2.2.2.4. Discuss and coordinate exact locations of ceiling-mounted components,
 - 1.2.2.2.5. Discuss accepted shop drawings for special installation details, and
 - 1.2.2.2.6. Review existing substrate conditions.

1.2.3. ACTION AND INFORMATIONAL SUBMITTALS

- 1.2.4. Product Data: Submit Product data on ceiling grid system, acoustical panels; clearly indicate specific items proposed for use if manufacturer's catalogues are submitted.
- 1.2.5. Shop Drawings: Submit Shop Drawings for work of this Section. In addition to minimum requirements indicate following:
 - 1.2.5.1. Reflected plans of ceilings, joint pattern, position of suspension grids, seismic requirements, methods of suspension and termination at walls, partitions, bulkheads, lighting fixtures and mechanical fixtures.
 - 1.2.5.2. Indicate insert and hanger spacing and fastening details, splicing method for main and cross runners, location of access splines, change in level details, access door dimensions and locations, lateral bracing and accessories.

- 1.2.5.3. Submit reflected ceiling plans detailed in measurement system (e.g. imperial or metric) to match Drawings.
- 1.2.5.4. Ensure a licensed engineer specified herein is responsible for:
 - 1.2.5.4.1. Production and review of Shop Drawings.
 - 1.2.5.4.2. Sealing and signing each Shop Drawing and any associated calculations performed.
- 1.2.6. Samples: Submit following samples in sizes indicated:
 - 1.2.6.1. Submit 300 mm (12") long samples of suspension system parts, including trim and seismic items.
 - 1.2.6.2. Submit 300 mm x 300 mm (12" x 12") samples of acoustical panels.
- 1.2.7. Delegated Design Submittals:
 - 1.2.7.1. Submit delegated design shop drawings stamped and signed by professional engineer registered or licensed in Ontario, Canada.
 - 1.2.7.2. Indicate that components and installation methods conform to specified seismic design and construction requirements of Contract Documents and in accordance with ASTM E580/E580M.
 - 1.2.7.3. Include supporting details, treatment of cross runners, main runners, and wall closures at terminal ends, suspension wire, lateral force bracing, light fixtures, services within the ceiling, seismic isolation joints, and partition bracing.

1.3. CLOSEOUT SUBMITTALS

1.3.1. Operational and Maintenance Data: Submit maintenance instructions to Owner for recommended cleaning materials and methods for panels and trim. Include precautions for use of and composition of cleaning materials detrimental to acoustic materials and trim.

1.4. QUALITY ASSURANCE

- 1.4.1. Qualifications:
 - 1.4.1.1. Installers: Provide work of this Section executed by competent installers with minimum 5 years experience in the application of Products, systems and assemblies specified and with approval and training of the Product manufacturers.
 - 1.4.1.2. Licensed Professionals: Employ a licensed engineer registered in the Province of Ontario.
- 1.4.2. Mock-Ups:
 - 1.4.2.1. Construct mock-up a minimum 10 m ² of each type of acoustical ceiling assembly including one inside corner and one outside corner. Ceiling system mock-up to show basic construction and assembly, treatment at walls, splicing, interlocking, finishes, acoustical unit installation, seismic reinforcing, one recessed light fixture, and one sprinkler head.
 - 1.4.2.2. Construct mock-up at Project site where directed by Consultant.
 - 1.4.2.3. Allow minimum 48 hours for review of the mock-up.
 - 1.4.2.4. Mock-up may remain as part of the finished work and serve as standard of workmanship for the balance of the work.

1.5. DELIVERY, STORAGE AND HANDLING

1.5.1. Delivery and Acceptance Requirements: Deliver materials in original packages, containers and bundles, bearing brand and manufacturer's name and ULC or cUL labels.

- 1.5.2. Storage and Handling Requirements:
 - 1.5.2.1. Store materials in a covered area, off ground, on flat, smooth, dry surfaces. Protect from moisture. Remove damaged or deteriorated materials from site.
 - 1.5.2.2. Comply with ceiling panel manufacturer's recommendations regarding temperature and humidity conditions before, during and after ceiling installation.

1.6. WARRANTY

1.6.1. Manufacturer Warranty: Warrant work of this Section for period of 3 years against defects and/or deficiencies in accordance with General Conditions of the Contract. Promptly correct any defects or deficiencies which become apparent within warranty period, to satisfaction of Consultant and at no expense to Owner.

PART 2 - PRODUCTS

2.1. MANUFACTURERS

- 2.1.1. Manufacturer List: Products of following manufacturers are acceptable subject to conformance to requirements of Drawings, Schedules and Specifications:
 - 2.1.1.1. Armstrong World Industries Canada Ltd.; www.armstrongceilings.com
 - 2.1.1.2. Bailey Metal Products Ltd.: www.bmp-group.com
 - 2.1.1.3. CertainTeed Ceilings; www.certainteed.com
 - 2.1.1.4. CGC Inc.; www.cgcinc.com
 - 2.1.1.5. Rockfon; www.rockfon.com
- 2.1.2. Substitution Limitations: Comparable Products from manufacturers listed herein will be accepted provided they meet requirements of this Specification.

2.2. MATERIALS

- 2.2.1. Description:
 - 2.2.1.1. Regulatory Requirements: Ensure complete ceiling assemblies including panel and suspension system are fire rated and labelled in accordance with ULC Design number noted on Drawings.
- 2.2.2. Performance/Design Criteria:
 - 2.2.2.1. Design suspension system to support safely and without distortion, superimposed loads of:
 - 2.2.2.1.1. Lighting fixtures.
 - 2.2.2.1.2. Air supply diffusers, boots, fire alarm grilles and exhaust and return air grilles.
 - 2.2.2.1.3. Curtain tracks and window blinds.
 - 2.2.2.1.4. Power grid system, where indicated.
 - 2.2.2.1.5. Suspended equipment where indicated.
 - 2.2.2.2. Design suspension system to support lighting fixtures according to Hydro One regulations and submit certification in accordance with ESA Rule 30-302 (1).
 - 2.2.2.3. Design suspension system to accommodate movement caused by thermal expansion or contraction.
 - 2.2.2.4. Design and space hangers and carrying members to support entire ceiling system, including lighting fixtures, diffusers and equipment openings in locations indicated on Drawings.

- 2.2.2.5. Maximum Deflection: Limit deflection to L/360 in accordance with ASTM C635/C635M deflection test.
- 2.2.2.6. Prepare panels for sprinkler head penetrations and suspension members of curtain tracks.
- 2.2.2.7. Coordinate installation and cooperate with Mechanical and Electrical Subcontractors, to accommodate mechanical and electrical items, or any other Work required to be incorporated in or coordinated with the ceiling system.
- 2.2.2.8. Structural Design: Employ a licensed engineer specified herein to:
 - 2.2.2.8.1. Design components for work of this Section requiring structural performance.
 - 2.2.2.8.2. Be responsible for determining sizes, yield strengths, gauge thicknesses and joint spacing to allow thermal movement and loading of components in accordance with applicable codes and regulations.
 - 2.2.2.8.3. Seismic Restraints: Design system to withstand seismic forces in accordance with CSA S832 and as outlined in Ontario Building Code for post-disaster Importance Category facilities based on a full uniform ceiling load acceleration in accordance with ASTM A580/A580M. Ceiling areas less than 13.4 m² and surrounded by walls connected to structure above do not require seismic restraints.

2.3. MATERIALS

2.3.1. Unless otherwise indicated, manufacture ceiling suspension Products to minimum requirements of ASTM C635/C635M, for Medium Duty, modified as required to suit grid design shown.

2.4. ACOUSTICAL CEILING SUSPENSION

- 2.4.1. Exposed Grid System:
 - 2.4.1.1. Factory finished satin white on Z90 (G30) hot dipped galvanized cold rolled steel. Ensure system provides lock joint intersections of cross and main tees
 - 2.4.1.2. 15/16" exposed face
 - 2.4.1.3. Acceptable products:
 - 2.4.1.3.1. "DONN DX/DXL® Suspension System" by CGC Inc.,
 - 2.4.1.3.2. "Prelude® XL" Exposed Tee System" by Armstrong World Industries,
 - 2.4.1.3.3. "Chicago Metallic 1200 Seismic" by Rockfon
 - 2.4.1.3.4. "15/16" Classic Stab Systems" by CertainTeed Ceilings.
- 2.4.2. Basic Steel Material and Finish: Commercial quality cold rolled steel 0.455 mm (26 ga) minimum thickness, galvanized to zinc coating designation Z90 (G30) for normal interior spaces, Z180 (G60) for high humidity spaces and Z275 (G90) for exterior spaces. Ensure exposed surfaces of metal products are factory finished in non-yellowing, low sheen satin white enamel to Consultant's acceptance to match whiteness in panels. Provide paint formulation of grid system to lighting fixture, speaker grille, sprinkler and diffuser manufacturers to ensure consistency of colour, sheen and texture of all exposed metal components in the ceiling assemblies. Provide slip-on trim mouldings or metal mouldings with baked enamel finish, as standard with grid manufacturer, to trim around light fixtures.
- 2.4.3. Accessories for Suspension System: Complete with splices, clips and perimeter moulding of manufacturer's standard and aluminum types to suit the applicable conditions unless special conditions and access areas are shown or specified. In washroom area provide galvanized suspension system.
- 2.4.4. Hanger Wire: Minimum 2.642 mm (12 ga) overall thickness galvanized steel wire to zinc coating designation Z275 (G90), meeting "Heavy-duty" classification of ASTM C635/C635M.

- 2.4.4.1. Access Panel Ceilings: Minimum 3.6 -mm diameter
- 2.4.4.2. Fire-Rated Assemblies: To ULC design requirements,
- 2.4.4.3. Seismic assemblies. To seismic Design Category
- 2.4.4.4. Other Ceilings: Minimum 2.642 mm (12 ga) diameter
- 2.4.5. Main Tees: 3.66 m (12') long, 23.8 mm (15/16") face width double web design, rectangular bulb at top of web, 38 mm (1-1/2") web height. Expansion cut-outs in main tees controlling buckling caused by heat expansion.
- 2.4.6. Main Tee Splices: Designed to lock lengths of main tees together so joined lengths of tee function structurally as single unit with tee faces at joint perfectly aligned and presenting tight seam.
- 2.4.7. Cross Tees: 1220 mm (4') long, 25 mm (1") web height structural cross-section, design same as main tees, designed to connect at main tees forming positive lock without play, loss or gain in grid dimensions with offset over-ride of face flange over main tee flange to provide flush joint. Provide 38 mm (1-1/2") web height of cross-tee for fire rated assemblies.
- 2.4.8. Edge Moulding Around Ceiling Perimeters: Materials and finish to match tees.
- 2.4.9. Panel Hold-Down Clips: As recommended by lay-in panel manufacturer. Purpose made clips to secure panel to suspension system approved for use in fire-rated systems, and to resist wind uplift near exterior doors.
- 2.4.10. Inserts for Concrete Slabs: Certified type for setting in concrete or self drilling expansion inserts for placing afterwards. Tie wire anchors:
 - 2.4.10.1. Red Head TW-1614 by ITW Canada, Inc.,
 - 2.4.10.2. Parabolt Wire Anchor by Acrow Richmond
 - 2.4.10.3. T-14 Eyebolt by Ramset Ltd., or Tire Wire Drive TW-932 by Isometric Ltd.
- 2.4.11. Fasteners: Galvanized and of size suited to loading conditions.
- 2.4.12. Metal Closures and Trim: Bonderized and with factory-applied white baked enamel finish. Provide anchors as standard with manufacturer.
- 2.4.13. Supplementary Steel Supports: Steel conforming to Section 05 50 00 Metal Fabrications.

2.5. ACOUSTICAL CEILING PANELS

- 2.5.1. Acoustical Lay-in Panels: CAN/CGSB-92.1-M, acoustical units, prefabricated, with white painted textured and/or smooth face, qualified for use in fire rated ceiling assembly; ULC or cUL labelled and meeting following performance criteria as determined by CAN/ULC-S101 and as specified:
 - 2.5.1.1. Flame Spread Rating: 25 or under to CAN/ULC S102.
 - 2.5.1.2. Smoke Developed:50 or under to CAN/ULC S102.
 - 2.5.1.3. Fire Rating: Class A
 - 2.5.1.4. Acoustical Lay-In Panels in Corridors:
 - 2.5.1.4.1. Basis of Design: "Radar Education Acoustic Panels", by CGC:
 - 2.5.1.4.2. Item no. 2407
 - 2.5.1.4.3. Size: 24" x 48" x 5/8" thick
 - 2.5.1.4.4. Edge: Square
 - 2.5.1.4.5. Suspension grid: 15/16 in
 - 2.5.1.4.6. Colour: 050 Flat White

	2.5.1.4.7.	Light Reflectance: 0.84
	2.5.1.4.8.	Ceiling Attenuation Class (CAC): 35
	2.5.1.4.9.	Noise Reduction Coefficient (NRC): Noise Absorption 0.55
	2.5.1.4.10.	Minimum Recycled Content: 26%
2.5.1.5.	Acoustical I	Lay-In Panels in Music Room:
	2.5.1.5.1.	Basis of Design: "Mars High-NRC/High-CAC 60/40", by CGC:
	2.5.1.5.2.	Item no. 87187
	2.5.1.5.3.	Size: 24" x 24" x 3/4" thick
	2.5.1.5.4.	Edge: Square
	2.5.1.5.5.	Suspension grid: 15/16 in
	2.5.1.5.6.	Colour: 050 Flat White
	2.5.1.5.7.	Light Reflectance: 0.90
	2.5.1.5.8.	Ceiling Attenuation Class (CAC): 40
	2.5.1.5.9.	Noise Reduction Coefficient (NRC): Noise Absorption 0.60
	2.5.1.5.10.	Minimum Recycled Content: 70%

PART 3 - EXECUTION

3.1. EXAMINATION

- 3.1.1. Verification of Conditions: Verify actual site dimensions and location of adjacent materials prior to commencing work. Notify Consultant in writing of any conditions which would be detrimental to the installation.
- 3.1.2. Do not start installation until exterior glazing has been completed and exterior openings are closed in. Ensure wet work is completed and dried out to a degree acceptable to panel manufacturer before installation is commenced. Maintain uniform temperatures of at least 21 deg C (72 deg F) for 72 hours prior to commencement of work and maintain temperature until 72 hours after completion.
- 3.1.3. Install ceiling panels and metal suspension system in accordance with applicable requirements of ASTM C636/C636M, seismic design and manufacturer's directions. Where manufacturer's directions are at variance with Contract Documents, notify Consultant before proceeding with work.
- 3.1.4. Do not commence installation until all work above suspended ceiling has been completed, inspected and accepted.
- 3.1.5. Evaluation and Assessment: Commencement of work implies acceptance of previously completed work.

3.2. INSTALLATION - SUSPENSION SYSTEM

- 3.2.1. Comply with manufacturer's installation instructions and recommendations, including product technical bulletins, installation instructions, and data sheets.
- 3.2.2. Install suspension system in accordance with accepted shop drawings, and ASTM C636/C636M except where specified otherwise.
- 3.2.3. Install suspension system by suspending ceiling hangers from building's structural members, and as follows:
 - 3.2.3.1. Install hangers plumb and free from contact with insulation or other objects within ceiling plenum that are not part of supporting structure or of ceiling suspension system.

- 3.2.3.2. Attach hangers to structural members or intermediate structural supports.
- 3.2.3.3. Exposed Concrete Slab: Use anchors, cast-in hanger wires or inserts, specifically designed for hanger use. Do not use powder activated fasteners.
- 3.2.3.4. Suspension to Metal Floor Deck: Punch lower part of metal deck with special puncher at required distances. Put hanger wire through holes, turn down, make a loop and securely wrap 3 times.
- 3.2.3.5. Steel Beams: Use beam clips.
- 3.2.3.6. Steel Joists: Wrap hanger wire around lower chord member.
- 3.2.3.7. Permanent Metal Forms and Cellular Floor Deck: Tabs, holes or slots specifically provided for hanger attachment. Prevent hanger twisting or turning by cross tying.
- 3.2.4. If ductwork or equipment located in ceiling plenum area interferes with hanger spacing, provide a trapeze or other arrangement reviewed by Consultant to support main beams at proper spacing.
- 3.2.5. Do not secure hangers to metal roof deck, ductwork, conduit, piping, equipment or support system for any of these.
- 3.2.6. Provide an additional hanger at each corner of each opening to receive a recessed lighting fixture and each opening that has been framed by main beam members. Provide additional hangers at each diffuser, grille and other points of extra loading.
- 3.2.7. Lay out centre line of ceiling both ways, to provide balanced borders at room perimeter with border units not less than 50% of standard unit width.
- 3.2.8. Space hangers for suspended ceilings to support grillage independent of walls, columns, pipes and ducts at maximum 1220 mm (4') centres along support grillage and not more than 150 mm (6") from ends. Provide additional hangers at light fixtures and diffusers.
- 3.2.9. Run main tees at right angles to length of light fixtures.
- 3.2.10. Space main tees 1220 mm (4') oc in 1 direction and securely tie to hangers.
- 3.2.11. Space cross tees 610 mm (2') oc at right angles to main tees and properly lock at intersections.
- 3.2.12. Use longest practical lengths of tees, furring and running channels to minimize joints. Make joints square, tight, flush and reinforced with concealed splines. Assemble framework to form a rigid and interlocking system.
- 3.2.13. Use edge moulding where ceiling abutts vertical surface.
- 3.2.14. Use corner moulding along external edges at ceiling steps.
- 3.2.15. Level suspended systems with a maximum tolerance of 3 mm (1/8") over 3.66 m (12').
- 3.2.16. Expansion Joints:
 - 3.2.16.1. Provide Z-shaped metal trim pieces at each side of expansion joint. Design to accommodate plus or minus 25-mm movement and maintain visual closure. Finish metal components to match adjacent exposed metal trim. Provide backing plates behind butt joints.
- 3.2.17. Fire-Resistance Rated Ceilings: Provide fire-resistance rated ceilings where required, including proper construction of framing and furring and proper thickness of acoustical units, to produce hourly fire-resistance ratings called for. Requirements for materials, methods of erection and application specified under appropriate headings of this Section apply, except where more stringent requirements are defined for particular fire-resistance rating by ULC.

3.3. INSTALLATION - ACOUSTICAL CEILING PANEL SYSTEM

- 3.3.1. Install lay-in acoustical panels in ceiling suspension system in accordance with manufacturer's instructions and as indicated.
- 3.3.2. Install panels with edges fully hidden from view by flanges of suspension system runners and mouldings.
- 3.3.3. In fire-rated ceiling systems, secure lay-in panels with hold-down clips and protect over light fixtures, diffusers, air return grilles and other appurtenances according to Certification Organizations design requirements.

3.4. SITE QUALITY CONTROL

- 3.4.1. Site Test and Inspection:
 - 3.4.1.1. After interior finishing work has been substantially completed, or when directed by Consultant, inspect acoustical treatment work.
 - 3.4.1.2. Structural Inspection: Ensure a licensed engineer specified herein inspects work of this Section during erection/installation and submits sealed and signed Field Review Report within 5 Days of site visit.
- 3.4.2. Manufacturer Services: Arrange for periodic site visits by manufacturer's representative to review installed work for conformity to manufacturer's installation instructions and recommendations.
 - 3.4.2.1. Submit written site reports within three days of visit.
- 3.4.3. Non-Conforming Work:
 - 3.4.3.1. Do not support ceilings directly from permanent metal forms, floor deck, or other non-structural framing.
 - 3.4.3.2. Do not attach hangers to steel roof deck or steel deck tabs.
 - 3.4.3.3. Do not level ceilings by putting kinks in suspension wires. Kinks in suspension wires are not acceptable.
 - 3.4.3.4. Conceal fasteners including pop rivets on mouldings and trims.
- 3.4.4. Replace damaged work which cannot be satisfactorily repaired, restored or cleaned, to satisfaction of Consultant at no cost to Owner.

3.5. CLEANING

3.5.1. Clean exposed surfaces of acoustical panel ceilings, including trim and edge mouldings. Comply with manufacturer's written instructions for cleaning and touch-up of minor finish damage. Remove and replace tiles and other ceiling components that cannot be successfully cleaned or repaired to permanently eliminate evidence of damage.

END OF SECTION

PART 1 - General

1.1. SUMMARY

- 1.1.1. Section Includes:
 - 1.1.1.1. Testing and preparation of substrate for installation of flooring.
 - 1.1.1.2. Resilient vinyl tile flooring
 - 1.1.1.3. Reducing strips and thresholds at junction with adjacent architectural finishes.
 - 1.1.1.4. Resilient base.
- 1.1.2. Related Sections: Following description of work is included for reference only and shall not be presumed complete:
 - 1.1.2.1. Filling of major holes, chases and trenches in concrete substrate Flatness and levelness requirements for floor to receive resilient sheet flooring: Section 03 01 30 Repairs to Concrete.
 - 1.1.2.2. Moisture vapour control topping: Section 09 05 61 Common Work Results for Flooring Preparation.
 - 1.1.2.3. Resilient base: Section 09 65 13 Resilient Base and Accessories

1.2. ADMINISTRATIVE REQUIREMENTS

- 1.2.1. Coordination:
 - 1.2.1.1. Ensure that substrate treatments for moisture, repair, or levelling are compatible with the manufacturer of work in this Section.
- 1.2.2. Preinstallation Meeting:
 - 1.2.2.1. Prior to start of work, arrange for site meeting of parties associated with work of this Section. Presided over by Contractor, include Consultant, Subcontractor, and manufacturer's representative.
 - 1.2.2.2. Review work included under this Section and determine complete understanding of requirements and responsibilities relative to work included, storage and handling of materials to be used, installation, methods and procedures, quality control, Project staffing, restrictions on areas of work and other matters affecting construction, to permit compliance with intent of this Section. Also discuss following items:
 - 1.2.2.2.1. Surface preparation.
 - 1.2.2.2.2. Concrete testing for RH, pH, and capillary moisture.
 - 1.2.2.2.3. Installation.
 - 1.2.2.2.4. Coordination with other Work.

1.3. SUBMITTALS

- 1.3.1. Make Submittals in accordance with Section Division 01 General Requirements
 - 1.3.1.1. Product Data:
 - 1.3.1.1.1. Submit manufacturer's product data sheets for products to be for used in the work of this section. Manufacturer's product data sheets shall include:
 - 1.3.1.1.1. Material and product physical properties and characteristics including size and colour.
 - 1.3.1.1.2. Limitations of products

- 1.3.2. Shop Drawings: Submit Shop Drawings for all areas indicating the following:
 - 1.3.2.1. Each resilient floor tile type, installation method, locations of building movement joints, and intricate floor tile patterns.
 - 1.3.2.2. Locations and types of edge strips and reducer strips at flooring penetrations.
- 1.3.3. Samples: Submit following samples in sizes indicated:
 - 1.3.3.1. Resilient base 300 mm (12") long.
 - 1.3.3.2. Reducing strips 300 mm (12") long.
- 1.3.4. Manufacturer's Instructions: Submit manufacturer's storage, handling, and installation instructions.

1.4. CLOSEOUT SUBMITTALS

- 1.4.1. Operating and Maintenance Data: Provide maintenance data for resilient flooring for incorporation into maintenance manual specified in Division 01. Include methods for maintaining installed products and precautions against cleaning materials and methods detrimental to finishes and performance.
- 1.4.2. Record Documentation: Submit a list of materials installed, including adhesives, and accessories. Indicate manufacturers, products, types, patterns, and colour names and numbers. Indicate room/area where installed.

1.5. QUALITY ASSURANCE

- 1.5.1. Installers:
 - 1.5.1.1. Provide work of this Section executed by competent installers with minimum of 5 years experience in application of Products, systems and assemblies specified and with approval and training of Product manufacturers.
 - 1.5.1.2. Submit documentation signed by the manufacturer to show that installers have been trained and meet their warranty criteria for installation requirements.
- 1.5.2. Bond Test:
 - 1.5.2.1. Install multiple bond tests using selected tile adhered with the appropriate adhesive to verify quality of adhesion. Remove 1 tile after 24 hours, then another after 48 hours.

1.6. SITE CONDITIONS

- 1.6.1. Ambient Conditions:
 - 1.6.1.1. Maintain appropriate environmental conditions and protect work during and after installation. Comply with trade standards and manufacturer's Product instructions. Follow Product MSDS and label instructions concerning safety, health and other related precautionary and environmental protection. Comply with applicable federal, provincial, local and statutory regulations.
 - 1.6.1.2. Close doors and windows. Turn off radiant floor heating systems and protect work area from direct draft, sun and heat exposure during installation and for at least 72 hours after completion.
 - 1.6.1.3. When necessary, build a temporary shelter and use indirect auxiliary heaters to maintain an adequate temperature level in work environment.
 - 1.6.1.4. Ventilation: Provide temporary ventilation:
 - 1.6.1.4.1. Provide high ventilation rate with maximum outside air 24 to 48 hours before, during installation, and 48 to 72 hours after installation. If possible, vent directly to outside.

- 1.6.1.4.2. Do not let contaminated air recirculate through air distribution system. Continue high ventilation rate for at least four weeks after building occupation.
- 1.6.1.5. Maintain relative humidity in accordance with manufacturer's instructions.
- 1.6.1.6. Exhaust temporary heaters to building exterior to prevent health hazards and damage to work from toxic fumes and emanations.
- 1.6.1.7. Maintain temperature of floor covering areas at not less than 18 deg C (65 deg F) or more than 38 deg C (100 deg F) 48 hours before, during installation and for 48 hours after application unless otherwise required in Product instructions.

1.7. WARRANTY

- 1.7.1. Submit warranty, signed and issued in the name of Owner warranting the Work of this Section against defects in materials and workmanship for a period of 20 year from the date of Substantial Performance of the Work.
- 1.7.2. Warranty covers excessive wear, and defects in materials.

PART 2 - PRODUCTS

2.1. MATERIALS

- 2.1.1. Vinyl Tile Flooring:
 - 2.1.1.1. Vinyl Composition Tyles, ASTM F1066, Class 2
 - 2.1.1.2. Thickness 3.18 mm (0.125") ASTM F386
 - 2.1.1.3. Tile Size: 305 mm X 305 mm
 - 2.1.1.4. Colours and Patterns: allow for 2 different colours
 - 2.1.1.5. Tile Squareness: Passes ASTM F2055
 - 2.1.1.6. Tile Dimensional Stability: Passes ASTM F2199
 - 2.1.1.7. Flexibility: Passes ASTM F137
 - 2.1.1.8. Static Load Limit: 150 psi " ASTM F970
 - 2.1.1.9. Slip Resistance: SCOF ≥ 0.5 ASTM D2048
 - 2.1.1.10. Maintenance: Conventional VCT maintenance, 3-5 coats of finish.
 - 2.1.1.11. Basis of Design: "Tarket VCT II" by Tarkett; www.tarkettna.com

2.1.2. Accessories:

- 2.1.2.1. Adhesive:
 - 2.1.2.1.1. Water-resistant reactive adhesives or of types recommended by resilient homogenous flooring manufacturer for specific material on applicable substrate, above, on or below grade.
 - 2.1.2.1.2. Vinyl Tile Flooring: "Tarkett 100 or 975 or 901" as recommended by the manufacturer.
- 2.1.2.2. Subfloor Filler and Leveler:
 - 2.1.2.2.1. Fast setting, polymer-modified Portland cement based patching compound mixed with either a latex additive or water only depending on substrate conditions and Product instructions. "Self-Leveler Plus" by Mapei.
- 2.1.2.3. Reducing Strips: aluminum, Schluter, profile and thickness to suit adjacent flooring.

2.1.2.4. Metal edge strips:

2.1.2.4.1. Aluminum extruded, smooth, mill finish and polished with lip to extend under floor finish, shoulder flush with top of adjacent floor finish, Schluter, VPSL; thickness to match VCT flooring thickness.

PART 3 - EXECUTION

3.1. EXAMINATION

- 3.1.1. Verification of Conditions for New Concrete:
 - 3.1.1.1. Ensure new concrete slab has been properly cured and dry for minimum of 28 Days and has reached minimum compressive strength of 25 MPa (3625 psi) and a minimum of 1.5 MPa (218 psi) in tension.
 - 3.1.1.2. Ensure no curing and sealing compounds, hardeners or other chemical additives have been used on concrete.
 - 3.1.1.3. Notify Consultant in writing of any conditions which would be detrimental to the installation.

3.2. SURFACE PREPARATION

- 3.2.1. For all new and existing concrete floor areas:
 - 3.2.1.1. Prepare existing and new concrete floors over entire area with steel shot blasting or other method recommended by manufacturer. Remove uneven joints, rough areas, foreign and projection off surfaces. Surface to be hard, sound and roughened to irregular surface with weak concrete removed and surface holes and voids exposed. Equip dry blasting machine with vacuum to minimize dust.
 - 3.2.1.2. Shot blast floor to remove soft material and to achieve a profile equivalent to ICRI / CSP 3 –
 - 3.2.1.3. Shot blast to expose cracks in concrete surface. For cracks lesser than 1.5 mm (1/16") employ crack reinforcing tape in accordance manufacturer's recommendations. Repair cracks, holes or other deficiencies in accordance with manufacturer's recommendations.
 - 3.2.1.4. Blow clean control joints, sawcuts and cracks with compressed air.
 - 3.2.1.5. Prepare concrete floors to receive sheet flooring in accordance with requirements of ASTM F710. Achieve CSP of #2 #3. Consult individual manufacturer for their specific recommendations and follow them as required.

3.3. INSTALLATION - GENERAL

- 3.3.1. Install materials of this section in accordance with material manufacture's written requirements.
- 3.3.2. Move resilient products and installation materials into spaces where they will be installed at least 48 hours in advance of installation. Do not install resilient products until they are same temperature as space where they are to be installed.
- 3.3.3. Spray paints, permanent markers and other indelible ink markers shall not be used to write on the back of the flooring material or used to mark the substrate as they could bleed through and permanently stain the flooring material. If such contaminants are present on the substrate they shall be mechanically removed prior to the installation of the flooring material.
- 3.3.4. Terminate vinyl tile in straight lines at centreline of door in openings where adjacent floor finish or vinyl composite tile colour is dissimilar.
- 3.3.5. At door opening locations where finished flooring is adjacent to weather-stripping or automatic door bottoms provide patching and levelling compound to provide full contact between finished flooring and weather-stripping or automatic door bottoms. Taper patching and levelling compound

- to transition with adjacent flooring substrate to be provide smooth and seamless transition at maximum slope of 3:1000 (height to distance) ratio.
- 3.3.6. Install vinyl tile accurately fitted at perimeter of rooms, cut with precision at columns, door frames and at other obstructions.
- 3.3.7. Extend floor coverings into toe spaces, door reveals, closets, and similar openings.
- 3.3.8. Maintain reference markers, holes, or openings that are in place or marked for future cutting by repeating on floor coverings as marked on substrates. Use chalk or other nonpermanent marking device.
- 3.3.9. Install floor coverings on covers for telephone and electrical ducts and similar items in installation areas. Maintain overall continuity of color and pattern with pieces of floor coverings installed on covers. Tightly adhere floor covering edges to substrates that abut covers and to cover perimeters.
- 3.3.10. Adhere floor coverings to substrates using a full spread of adhesive applied to substrate to produce a completed installation without open cracks, voids, raising and puckering at joints, telegraphing of adhesive spreader marks, and other surface imperfections.
- 3.3.11. Allow no traffic over installation until adhesives have fully cured, minimum twenty-four (24) hours.

3.4. INSTALLATION – TILE

- 3.4.1. Lay out tiles from center marks established with principal walls, discounting minor offsets, so tiles at opposite edges of room are of equal width. Adjust as necessary to avoid using cut widths that equal less than one-half tile at perimeter.
- 3.4.2. Lay tiles square with room axis, unless otherwise indicated or directed.
- 3.4.3. Match tiles for color and pattern by selecting tiles from cartons in the same sequence as manufactured and packaged, if so numbered. Discard broken, cracked, chipped, or deformed tiles.
- 3.4.4. Lay tiles with grain running in one direction as indicated on drawings.
- 3.4.5. Lay tiles in simple pattern as decided during construction
- 3.4.6. Tiles to be rolled with a 3 section coated 100 lb roller in accordance with manufacturer's installation instructions.
- 3.4.7. Finished flooring installation shall not show telegraphing of defects in substrate. Finished flooring installation shall be homogenous free of substrate lines, adhesive trowel lines, pockets, bumps and unevenness which are outside of specified tolerances.
- 3.4.8. Reducing Strips: Protect exposed edges of resilient flooring, where finished and unfinished area adjoin, by means of reducing strips butting to and flush with finished surface of floor covering material.

3.5. CLEANING

- 3.5.1. Remove excess adhesive from floor, base and wall surfaces without damage.
- 3.5.2. Clean floor and base surface to flooring manufacturer's instructions.
- 3.5.3. Perform the following operations immediately after completing resilient product installation:
 - 3.5.3.1. Remove adhesive and other blemishes from exposed surfaces.
 - 3.5.3.2. Sweep and vacuum surfaces thoroughly.
 - 3.5.3.3. Damp-mop surfaces to remove marks and soil.

3.5.4. 72 hours after installation is completed, initial maintenance procedures must be implemented in accordance with manufacturer's requirements. Refer to Tarkett Vinyl Composition Tile Maintenance Instructions for complete maintenance details.

3.6. PROTECTION

- 3.6.1. Protect resilient products from mars, marks, indentations, and other damage from construction operations and placement of equipment and fixtures during remainder of construction period. Use protection methods recommended in writing by manufacturer.
- 3.6.2. Cover products installed on horizontal surfaces with undyed, untreated building paper until Substantial Performance.
- 3.6.3. Do not move heavy and sharp objects directly over surfaces. Place hardboard or plywood panels over flooring and under objects while they are being moved. Slide or roll objects over panels without moving panels.
- 3.6.4. Prohibit foot traffic on floor for 24 hours after installation. Prohibit heavy traffic, rolling loads and furniture or appliance placement for a minimum of 72 hours after installation.

END OF SECTION

PART 1 - GENERAL

1.1. GENERAL INSTRUCTIONS

- 1.1.1. Read and conform to:
 - 1.1.1.1. Division 01 requirements and documents referred to therein.

1.2. SUMMARY

- 1.2.1. Section Includes: Provide resinous epoxy flooring including but not limited to following:
 - 1.2.1.1. Provide labour, materials, tools and equipment required to install complete resinous flooring system specified in this Section including surface preparation.
 - 1.2.1.2. Reducing strips and thresholds at junction with adjacent finishes.
 - 1.2.1.3. Coved base cap.
- 1.2.2. Related Sections: Following description of work is included for reference only and shall not be presumed complete:
 - 1.2.2.1. Filling of major holes, chases and trenches in concrete substrate Flatness and levelness requirements for floor to receive resilient sheet flooring: Section 03 01 30 Repairs to Concrete.
 - 1.2.2.2. Testing and preparation of concrete to receive resinous flooring: Section 09 05 61 Common Work Results for Flooring Preparation.

1.3. REFERENCES

- 1.3.1. Abbreviations and Acronyms:
 - 1.3.1.1. ANSI; American National Standards Institute
 - 1.3.1.2. CSP: Concrete Surface Profile
 - 1.3.1.3. DCOF: Dynamic Coefficient of Friction
 - 1.3.1.4. DFT: dry film thickness
 - 1.3.1.5. IRCI: International Concrete Repair Institute
 - 1.3.1.6. MSDS: Material Safety Data Sheets.
 - 1.3.1.7. RH: Relative Humidity.
 - 1.3.1.8. WFT: wet film thickness.
- 1.3.2. Reference Standards:
 - 1.3.2.1. ANSI A326.3-2021 American National Standard Test Method For Measuring Dynamic Coefficient Of Friction Of Hard Surface Flooring Materials
 - 1.3.2.2. ASTM C579-2023 Standard Test Methods for Compressive Strength of Chemical-Resistant Mortars, Grouts, Monolithic Surfacing, and Polymer Concretes.
 - 1.3.2.3. ASTM C580-18(2023) Standard Test Method for Flexural Strength and Modulus of Elasticity of Chemical-Resistant Mortars, Grouts, Monolithic Surfacings, and Polymer Concretes.
 - 1.3.2.4. ASTM C920-18 Standard Specification for Elastomeric Joint Sealants
 - 1.3.2.5. ASTM D635-22 Standard Test Method for Rate of Burning and/or Extent and Time of Burning of Plastics in a Horizontal Position.
 - 1.3.2.6. ASTM D638-22 Standard Test Method for Tensile Properties of Plastics.

- 1.3.2.7. ASTM D695-23 Standard Test Method for Compressive Properties of Rigid Plastics.
- 1.3.2.8. ASTM D2240- 15 (2021) Standard Test Method for Rubber Property-Durometer Hardness.
- 1.3.2.9. ASTM D2369-20 Standard Test Method for Volatile Content of Coatings.
- 1.3.2.10. ASTM D2794-93 (2024) Standard Test Method for Resistance of Organic Coatings to the Effects of Rapid Deformation (Impact).
- 1.3.2.11. ASTM D3273-2021 Standard Test Method for Resistance to Growth of Mold on the Surface of Interior Coatings in an Environmental Chamber.
- 1.3.2.12. ASTM D4060-19 Standard Test Method for Abrasion Resistance of Organic Coatings by the Taber Abraser.
- 1.3.2.13. ASTM D4541-22 Standard Test Method for Pull-Off Strength of Coatings Using Portable Adhesion Testers.
- 1.3.2.14. ASTM E303-22 Standard Test Method for Measuring Surface Frictional Properties Using the British Pendulum Tester
- 1.3.2.15. ASTM G21-15(2021)e1 Standard Practice for Determining Resistance of Synthetic Polymeric Materials to Fungi

1.4. ADMINISTRATIVE REQUIREMENTS

1.4.1. Coordination:

1.4.1.1. Ensure that substrate treatments for moisture, repair, or levelling are compatible with the manufacturer of work in this Section.

1.4.2. Preinstallation Meeting:

- 1.4.2.1. Prior to start of work, arrange for site meeting of parties associated with work of this Section. Presided over by Contractor, include Consultant, Subcontractor, and manufacturer's representative.
- 1.4.2.2. Review work included under this Section and determine complete understanding of requirements and responsibilities relative to work included, storage and handling of materials to be used, installation, methods and procedures, quality control, Project staffing, restrictions on areas of work and other matters affecting construction, to permit compliance with intent of this Section. Also discuss following items:
 - 1.4.2.2.1. Surface preparation.
 - 1.4.2.2.2. Priming.
 - 1.4.2.2.3. Application.
 - 1.4.2.2.4. Curing and protection.
 - 1.4.2.2.5. Coordination with other Work.

1.5. SUBMITTALS

- 1.5.1. Submittals in accordance with Submittal Procedures specifies in Division 01.
- 1.5.2. Product Data:
 - 1.5.2.1. Material List: An inclusive list of required coating materials. Identify each material by manufacturer's catalog number and general classification.
 - 1.5.2.2. Manufacturer's Information: Manufacturer's technical information, including label analysis and instructions for handling, storing, and applying each coating material proposed for use.
 - 1.5.2.3. SDS: Submit Manufacturer's Safety Data Sheet for each Product being used.

1.5.3. Samples for Verification:

- 1.5.3.1. Submit samples of each colour and material being applied, with texture to simulate actual conditions, on representative samples of the actual substrate and as follows for Consultant's verification.
- 1.5.3.2. Use representative colours when preparing samples for review; resubmit until required sheen, colour, and texture are achieved.
- 1.5.3.3. List of material and application for each coat of each sample; label each sample for location and application.
- 1.5.3.4. Submit samples on 100 mm square hardboard for Consultant's review of colour and texture:

1.5.4. Certificates:

- 1.5.4.1. Installer Certificates: Signed by manufacturer certifying that installers comply with specified requirements.
- 1.5.4.2. Material Certificates: For each resinous floor coating component, signed by manufacturer.

1.6. CLOSEOUT SUBMITTALS

- 1.6.1. Operating and Maintenance Data: Provide maintenance data for resinous flooring for incorporation into maintenance manual specified in Closeout Submittals in Division 01.
 - 1.6.1.1. Include methods for maintaining installed products and precautions against cleaning materials and methods detrimental to finishes and performance.
 - 1.6.1.2. Include name of original installer and contact information

1.7. QUALITY ASSURANCE

1.7.1. Applicator Qualifications:

- 1.7.1.1. Applicators: Use experienced applicators having a record of successful in-service resinous flooring system applications similar in material and extent to those specified in this Section and as follows:
 - 1.7.1.1.1 Applicators must have completed flooring manufacturer's training program for Products specified.
 - 1.7.1.1.2. Applicators must be licensed, certified or approved in writing by the flooring manufacturer for the Products specified.
- 1.7.1.2. Applicator Experience: Minimum 5 years' experience in the application of the type of system specified. Applicator shall submit a list of five (5) projects of similar size, scope and complexity.

1.7.2. Mock-Up:

- 1.7.2.1. Construct one 10 sq.m. (100 sq.ft.) mock-up of each type and colour of resinous flooring in location acceptable to Consultant to demonstrate quality of finished system, complying with manufacturer's installation instructions and requirements of this Section and in accordance with Quality Requirements specified in Division 01.
- 1.7.2.2. Arrange for Consultant's review and acceptance, obtain written acceptance before proceeding with Work.
- 1.7.2.3. Upon acceptance, mock-up shall serve as a minimum standard of quality for the balance of the Work of this Section. Mock-up shall be left in place for the duration of the Work.

1.8. DELIVERY, STORAGE AND HANDLING

1.8.1. Delivery:

- 1.8.1.1. Deliver materials to site in manufacturer's original, unopened containers and packaging, with labels clearly identifying product name, manufacturer, batch or lot number and date of manufacture.
- 1.8.1.2. Material should be delivered to job site and checked for completeness and shipping damage prior to job start.

1.8.2. Storage:

- 1.8.2.1. Store materials in accordance with manufacturer's written instructions.
- 1.8.2.2. Keep containers sealed until ready for use. Material should be stored in a dry, enclosed, well-ventilated, protected area from the elements.
- 1.8.2.3. Do not subject material to excessive heat or freezing.
- 1.8.2.4. Shelf life: Established based on manufacturer's written recommendation for each material being used.

1.8.3. Handling:

- 1.8.3.1. Protect materials during handling and application to prevent damage or contamination.
- 1.8.3.2. Condition materials for use accordingly to manufacturer's written instructions prior to application.
- 1.8.3.3. Record material lot numbers and quantities delivered to jobsite/storage.
- 1.8.3.4. All materials used shall be pre-packaged in single, easy to manage batches to eliminate on site mixing errors. No on site weighing or volumetric measurements allowed.

1.9. SITE CONDITIONS

1.9.1. Ambient Conditions:

- 1.9.1.1. Maintain appropriate environmental conditions and protect work during and after installation. Comply with trade standards and manufacturer's Product instructions. Follow Product MSDS and label instructions concerning safety, health and other related precautionary and environmental protection. Comply with applicable federal, provincial, local and statutory regulations.
- 1.9.1.2. Close doors and windows. Turn off radiant floor heating systems and protect work area from direct draft, sun and heat exposure during installation and for at least 72 hours after completion.
- 1.9.1.3. When necessary, build a temporary shelter and use indirect auxiliary heaters to maintain an adequate temperature level in work environment.
- 1.9.1.4. Maintain relative humidity in accordance with manufacturer's instructions. Maximum ambient humidity 85% during application and curing.
- 1.9.1.5. Exhaust temporary heaters to building exterior to prevent health hazards and damage to work from toxic fumes and emanations.
- 1.9.1.6. Maintain temperature of floor covering areas at not less than 18 deg C (65 deg F) or more than 38 deg C (100 deg F) 48 hours before, during installation and for 48 hours after application unless otherwise required in Product instructions.

1.9.1.7. Ensure adequate ventilation and air flow.

1.10. WARRANTY

1.10.1. Submit Applicator's written warranty, signed and issued in the name of Owner warranting the Work of this Section against defects in materials and workmanship for a period of one year from the date of Substantial Performance of the Work.

PART 2 - PRODUCTS

2.1. MANUFACTURERS

- 2.1.1. Manufacturer List: Products of following manufacturers are acceptable subject to conformance to requirements of Drawings, Schedules and Specifications:
 - 2.1.1.1. BASF; www.master-builders-solutions.basf.com
 - 2.1.1.2. Dur-A-Flex; www.dur-a-flex.com
 - 2.1.1.3. Neogard; www.neogard.com
 - 2.1.1.4. Niagara Protective Coatings; www.niacoat.com
 - 2.1.1.5. R & D Technical Solutions Ltd.; www.kelmar.com
 - 2.1.1.6. Sherwin Williams; www.
 - 2.1.1.7. Sika Canada Inc.; www.sikacanada.com
 - 2.1.1.8. Tnemec Inc.; www.tnemec.com
 - 2.1.1.9. MPC Coatings; www.mpcoatings.ca
- 2.1.2. Products from manufacturers listed will be considered provided they meet the performance requirements.
- 2.1.3. Products from manufacturers not listed will not be considered. Proposed substitutions for products by any manufacturer not listed above will be rejected.
- 2.1.4. Source Limitations: Obtain primary resinous floor coatings through one source from a single manufacturer. Provide secondary materials, including patching and fill material, joint sealant, and repair materials, of type and from source recommended by manufacturer of primary materials.

2.2. DESIGN/PERFORMANCE REQUIREMENTS

- 2.2.1. Slip Resistance for level surfaces in wet areas: 0.50 Dynamic Coefficient of Friction (DCOF) rating or greater to ANSI A326.3.
- 2.2.2. Material Compatibility: Provide primers, undercoats, and finish-coat materials that are compatible with one another and the substrates indicated under conditions of service and application, as demonstrated by manufacturer based on testing and field experience.

2.3. MATERIALS

- 2.3.1. Concrete primer for slab on grade:
 - 2.3.1.1. Basis of Design: Sikafloor 1620 by Sika Canada Inc. one coat moisture vapour control clear epoxy primer
- 2.3.2. Suspended slab waterproofing:
 - 2.3.2.1. Basis of Design: Sikalastic 390 by Sika Canada Inc. two-component, solvent-free, elastomeric and crack bridging polyurethane waterproofing membrane
 - 2.3.2.2. Primer: Sika® MT Primer:
 - 2.3.2.2.1. Applied thickness: 2 coats at 8 10 mils WFT per coat

- 2.3.3. Broadcast and sealed decorative epoxy floor, composed of multi-coloured decorative flakes:
 - 2.3.3.1. Basis of Design Sikafloor Decoflake system by Sika Canada Inc. (EF)
 - 2.3.3.2. Performance Requirements:
 - 2.3.3.2.1. Compressive Strength: 70 MPa (10,152 psi) at 28 days in accordance with ASTM C579.
 - 2.3.3.2.2. Flexural Strength: 83 MPa (12,038 psi) at 28 days in accordance with ASTM C580.
 - 2.3.3.2.3. Hardness: 85 Shore D at 7 days in accordance with ASTM D2240.
 - 2.3.3.2.4. VOC Content: ≤ 50 g/L in accordance with ASTM D2369.
 - 2.3.3.2.5. Pull-off Strength: > 2.0 MPa (290 psi) with 100% concrete failure in accordance with ASTM D4541.
 - 2.3.3.2.6. Flammability: Self-extinguishing in accordance with ASTM D635.
 - 2.3.3.2.7. System Thickness: minimum 3 mm (1/8")
 - 2.3.3.3. Components:
 - 2.3.3.3.1. Primer and Body Coat: two component, solid colour, high solids, silicone free, low viscosity, self-priming, glossy epoxy finish, Sikafloor® 261.
 - 2.3.3.3.1.1. Applied Thickness:
 2.3.3.3.1.1.1. Prime Coat: 203 μm (8 mils) WFT
 2.3.3.3.1.1.2. Body Coat: 726 μm (30 mils) WFT
 2.3.3.3.1.2. Compressive Strength: 56 MPa (8,122 psi) in accordance with ASTM D695.
 - 2.3.3.3.1.3. Tensile Strength: 7.4 MPa (1,073 psi) in accordance with ASTM D638.
 - 2.3.3.3.1.4. Pull-off Strength: 2 MPa (290 psi) in accordance with ASTM D4541.
 - 2.3.3.3.1.5. Hardness: 76 Shore D in accordance with ASTM D2240.
 - 2.3.3.3.1.6. VOC Content: ≤ 50 g/L in accordance with ASTM D2369.
 - 2.3.3.3.1.7. Impact Resistance: 5.88 joules in accordance with ASTM D2794.
 - 2.3.3.3.1.8. Abrasion Resistance: 0.11g loss in accordance with ASTM D4060 (CS17/1000cycles/1000g).
 - 2.3.3.3.2. Aggregate: Colored vinyl chips, DecoFlakes, sizes to be determined by Consultant as per submitted and accepted samples.
 - 2.3.3.3.3. Grout Coat: two component, high solids, low odour, low VOC, high strength, high gloss, clear epoxy resin, Sikafloor® 2002.
 - 2.3.3.3.3.1. Applied Thickness: 254 µm (10 mils) WFT
 - 2.3.3.3.2. Compressive Strength: 49.9 MPa (7250 psi.) in accordance with ASTM C579.
 - 2.3.3.3.3.3. Tensile Strength: 39.5 MPa (5728 psi.) in accordance with ASTM D638.
 - 2.3.3.3.4. VOC Content: ≤ 25 g/L in accordance with ASTM D2369.
 - 2.3.3.3.5. Elongation: 11% in accordance with ASTM D638.
 - 2.3.3.3.6. Hardness: 80 Shore D in accordance with ASTM D2240.

2.3.3.3.4.	Top Coat: two-component, clear aliphatic urethane, Sikafloor® 942 with slip resistant aggregate. Gloss level: to be advised by Consultant.
2.3.3.3.4.1.	Applied Thickness: 2 coats at 4 mils WFT per coat
2.3.3.3.4.2.	Tensile Strength: 37.2 MPa (5400 psi.) in accordance with ASTM D638.
2.3.3.3.4.3.	VOC Content: ≤ 240 g/L in accordance with ASTM D2369.
2.3.3.3.4.4.	Elongation: 6.2% in accordance with ASTM D638.
2.3.3.3.4.5.	Cove Mortar: three-component, solid colour, low odour, low VOC, vertical grade coving and detailing mortar with primer, Sikafloor® Morritex Epoxy Cove Mortar
2.3.3.3.4.6.	Compressive Strength: 41 MPa (5946 psi) at 28 days in accordance with ASTM D695.
2.3.3.3.4.7.	Tensile Strength: 36 MPa (5221 psi) at 28 days in accordance with ASTM D638.
2.3.3.3.4.8.	Hardness: 83 Shore D in accordance with ASTM D2240.
2.3.3.3.4.9.	VOC Content: ≤ 5 g/L in accordance with ASTM D2369.
2.3.3.3.4.10	 Pull-off Strength: > 1.7 MPa (246 psi) with 100% substrate failure in accordance with ASTM D4541.

2.3.4. Epoxy Floor for Wet Areas (EFW):

- 2.3.4.1. Basis of Design: Sikafloor Quartzite HDB System by Sika Canada, two layer epoxy floor system.
- 2.3.4.2. Performance Requirements:
 - 2.3.4.2.1. Hardness: 85 Shore D in accordance with ASTM D2240.
 - 2.3.4.2.2. Tensile Strength: 6 MPa (870 psi.) in accordance with ASTM D638.
 - 2.3.4.2.3. Compressive Strength: 91 MPa (13198 psi) at 28 days in accordance with ASTM C579.
 - 2.3.4.2.4. Flexural Strength: 28 MPa (4061 psi) at 28 days in accordance with ASTM C580
 - 2.3.4.2.5. Hardness: 85 Shore D at 7 days in accordance with ASTM D2240.
 - 2.3.4.2.6. VOC Content: ≤ 25 g/L in accordance with ASTM D2369.
 - 2.3.4.2.7. Pull-off Strength: > 2.7 MPa (400 psi) with 100% concrete failure in accordance with ASTM D7234.
 - 2.3.4.2.8. Flammability: Self-extinguishing in accordance with ASTM D635.
 - 2.3.4.2.9. System Thickness: minimum 5 mm (3/16")

2.3.4.3. Components:

- 2.3.4.3.1. Primer and Body Coat: two component, solvent free, low viscosity, epoxy, Sikafloor® 156.
- 2.3.4.3.1.1. Applied Thickness:
- 2.3.4.3.1.1.1. First coat: 3 mm (1/8 in).
- 2.3.4.3.1.1.2. Second coat: 2 mm (5/64 in)
- 2.3.4.3.2. Top Coat: two component, high solids, low odour, low VOC, high strength, high gloss, clear epoxy resin, Sikafloor® 2002 with non-slip aggregate:

2.3.4.3.2.1.1. Aggregate: Sikafloor Aggregate PT.2.3.4.3.2.1.2. Applied Thickness: 20 mils WFT

2.4. ACCESSORY MATERIALS

- 2.4.1. Patching and Fill Material: Resinous product of or approved by resinous flooring manufacturer and recommended by manufacturer for application indicated.
- 2.4.2. Crack Reinforcing Tape: Elastic 100% nylon double weave tape that only stretches in 1 direction sideways. Ensure tape is capable of imparting dimensional strength with elasticity. Ensure tape allows for crack movement. "Crack Reinforcing Tape (CRT)" by R & D Technical Solutions Ltd.
- 2.4.3. Silica Broadcast Aggregates: Medium texture #32 (spherical) 0.3 0.85 mm by Bell & MacKenzie Co. Ltd.
- 2.4.4. Divider Strips: 'L' shape to required floor thickness, white alloy zinc.
- 2.4.5. Cove Cap: stainless steel.
- 2.4.6. Base top strip: L shape white alloy or zinc base bead top strips as recommended by manufacturer.
- 2.4.7. Joint Backing: Preformed, compressible strips of closed cell polyethylene or urethane foam, rubber tubing or non-migrating plasticized vinyl with shore 'A' hardness of 20 and tensile strength between 140 kPa and 200 kPa. Sizes and shapes to suit various conditions, diameter 25% greater than joint width. Compatible with sealant, primer, resinous flooring and substrate.
- 2.4.8. Joint Sealant: Pour grade, multi-component, polyurethane sealant conforming to ASTM C920, Type M, Grade P, Class 25, Use T, M, A, I and O. Supply 1 of following:
 - 2.4.8.1. "MasterSeal® SL 2™" by BASF.
 - 2.4.8.2. "Sikaflex® 2c SL" by Sika Canada Inc.
 - 2.4.8.3. "THC-900/901 or Vulkem® 245" by Tremco Canada.
- 2.4.9. Metal edge trim:
 - 2.4.9.1. For junctions of resilient sheet vinyl and resinous flooring Aluminum extruded, smooth, mill finish, "Visedge DS & VR Series by Howegreen; www.howegreen.com

PART 3 - EXECUTION

3.1. EXAMINATION

- 3.1.1. Verification of Conditions for New Concrete:
 - 3.1.1.1. Ensure new concrete slab has been properly cured and dry for minimum of 28 Days and has reached minimum compressive strength of 25 MPa (3625 psi) and a minimum of 1.5 MPa (218 psi) in tension.
 - 3.1.1.2. Verify that moisture vapour emissions testing, pH testing has been completed and results are within manufacturers acceptable limits.
 - 3.1.1.3. Examine flooring preparation work and levelling underlayment is suitable. Profile equivalent to ICRI / CSP 3 6.
 - 3.1.1.4. Notify Consultant in writing of any conditions which would be detrimental to the installation.
 - 3.1.1.5. Evaluation and Assessment: Commencement of work implies acceptance of previously completed work.

3.2. SURFACE PREPARATION

- 3.2.1. Prepare surface to receive flooring systems in accordance with manufacturer's written instructions.
- 3.2.2. Remove dirt, oil, grease, wax, laitance, curing compounds, water-soluble concrete hardeners, and other surface contaminants.
- 3.2.3. Remove sealers, finishes, and paints.
- 3.2.4. All projections, rough spots, etc. should be removed and patched to achieve a level surface prior to the application.
- 3.2.5. Remove unsound concrete by appropriate mechanical means.
- 3.2.6. Concrete: Clean and prepare to achieve laitance-free and contaminant-free, open textured surface by shot blasting or equivalent mechanical means. Provide CSP level in accordance with ICRI Guideline No. 310-2R and manufacturer's written recommendation.
- 3.2.7. Chemical Surface Preparation: Chemical surface preparation (acid etching) is unacceptable.
- 3.2.8. Control Joints and Cracks: Repair and treat control joints and surface cracks utilizing manufacturer's standard materials and installation details.

3.3. INSTALLATION

3.3.1. General:

- 3.3.1.1. Prepare, mix materials and apply each component of resinous flooring system in accordance with manufacturer's printed directions to produce uniform monolithic wearing surface of thickness indicated, with integral cove bases, uninterrupted except at divider strips, sawn joints or other types of joints required.
- 3.3.1.2. Apply flooring with care to ensure no laps, pin holes, voids, crawls, skips or other marks or irregularities are visible and to provide uniform appearance.
- 3.3.1.3. Work coating into corners and other restricted areas, up and over equipment bases and into recesses in floors to ensure full coverage.
- 3.3.1.4. Make clean true junctions with no visible overlap between adjoining applications of coatings.
- 3.3.1.5. Match approved sample for colour, sheen, texture and slip resistance.
- 3.3.1.6. For large areas, stop each Day's production at metal dividing strip at lines reviewed by Consultant.
- 3.3.2. Application Moisture Control Primer:
 - 3.3.2.1. Apply primer by squeegee at the rate of 105 135 ft2/ mixed US gal.(2.75 3.32 m2/ L) (at 12–15 mils (0.30-0.38 mm) WFT
- 3.3.3. Application Waterproofing Membrane:
 - 3.3.3.1. Apply membrane at a rate of 1.6 m2/L (65 ft2/US gal.) using a notched squeegee and backroll to provide a uniform 30 mil (750 microns) WFT
 - 3.3.3.2. Allow a minimum of 6 hours and maximum 24 hours cure time at 23 °C (73 °F) prior to installing wear course.

3.3.4. Application Screed Mortar:

- 3.3.4.1. Pour mortar onto surface and spread to appropriate thickness using a notched squeegee, trowel or screed bar.
- 3.3.4.2. Spread newly mixed materials across the transition of previous applied mixes before the surface begins to set.

- 3.3.4.3. Immediately spike roll the surface to release trapped air in the matrix.
- 3.3.4.4. Broadcast aggregates to the wet surface to rejection. Ensure complete aggregate coverage to all areas to avoid bald spots.

3.3.5. Application Cove Mortar:

- 3.3.5.1. Primer: Apply primer over prepared substrate, at manufacturer's recommended spreading rate with timing of application coordinated with subsequent application of cove mortar to ensure optimum adhesion between resinous flooring materials and substrate.
- 3.3.5.2. While primer is tacky, spread cove mortar onto vertical surfaces using steel trowels, ensuring the mortar is well compacted onto the primer and within itself.
- 3.3.5.3. Cove radius: 25 mm (1 in).
- 3.3.5.4. Install base bead top strips at heights indicated on drawings straight and level.
- 3.3.5.5. Shape fillets at wall/floor junctions using the appropriate tools, to match approved mock-up example. Round interior and exterior corners. Close any surface voids in accordance with manufacturer's recommendations.
- 3.3.5.6. Install cove caps in locations where cove will remain exposed, not covered with wall protection sheets. Apply anti-microbial sealant.

3.3.6. Application Topcoat:

- 3.3.6.1. Apply topcoat in accordance with manufacturer's recommendations to achieve satin antislip finish.
- 3.3.6.2. Sweep-up and vacuum loose unbonded silica aggregate.
- 3.3.6.3. Apply top coat using a squeegee, followed by backrolling to provide a uniform texture and finish.
- 3.3.6.4. Allow minimum 24 hours cure period at 20 °C (68 °F) before foot traffic.

3.3.7. Thresholds:

- 3.3.7.1. Where resinous flooring terminates at doorways and difference in height occurs between resinous flooring and other finishes, install tapered aluminum thresholds not less than 25 mm (1") wide and full thickness of difference in level.
- 3.3.7.2. Where resinous flooring terminates at doorways and difference in height occurs between polyurethane flooring and other floor finishes, cut back slab for 32 mm (1-1/4") width to allow full thickness of polyurethane flooring to be flush with adjacent floor finish (chasing).
- 3.3.7.3. Where resinous flooring terminates at doorways and floor finishes are of same thickness, provide metal divider strips flush with surfaces.

3.3.8. Floor Drains:

- 3.3.8.1. Slope flooring to drains minimum of 3 mm in 300 mm (1/8" in 12") from furthest surface point.
- 3.3.8.2. Grind concrete around perimeter to provide 6 mm (1/4") thickness of resinous flooring material which is flush with top of drain and slopes as indicated on Drawings.
- 3.3.9. Chasing: Provide chase where resinous flooring does not abut against vertical surface by chiseling out 38 mm (1-1/2") wide chase to straight saw-cut 13 mm (1/2") depth.
- 3.3.10. Joints: Where substrate is interrupted by isolation, control or expansion joints, provide saw-cut joint in polyurethane flooring after floor installation. Install backer rod and fill with manufacturer's recommended sealant.

3.3.11. Site Tolerances: Finish resinous flooring surfaces to produce plumb and level floor, or straight where sloped to drains, within tolerance of 3 mm in 3 m (1/8" in 10').

3.4. SITE QUALITY CONTROL

- 3.4.1. Non-Conforming Work: Replace damaged work which cannot be satisfactorily repaired, restored or cleaned, to satisfaction of Consultant at no cost to Owner.
- 3.4.2. Manufacturer Services:
 - 3.4.2.1. Ensure resinous flooring manufacturer representative's presence at pre-installation site meeting and on site Day resinous flooring application is commenced and periodically thereafter, to ensure work is properly performed.
 - 3.4.2.2. Submit field inspection reports. Submit final inspection report confirming that materials have been correctly applied, in accordance with the manufacturer's instructions and in accordance with warranty requirements for proper workmanship.

3.5. CLEANING

3.5.1. Remove promptly as work progresses spilled or splattered resinous flooring materials from adjacent surfaces. Clean resinous floors on completion of Work. Do not mar surfaces while removing splatters.

3.6. PROTECTION

- 3.6.1. Protect adjacent surfaces from damage resulting from work of this Section. If necessary, cover or mask adjacent surfaces to those receiving flooring including fixtures and equipment.
- 3.6.2. Protect freshly applied Products from dampness, condensation and water for at least seventy-two (72) hours.
- 3.6.3. Monitor air flow and changes in air flow. Protect against introduction of dust, debris, and particles, etc. that may result in surface imperfections and other defects.
- 3.6.4. Erect barriers to prevent entry and presence of workers not performing work of this Section during application of resinous flooring and for 72 hours following completion of application.
- 3.6.5. Post "No Smoking" signs while work is in progress and curing. Ensure sparkproof electrical equipment is used in areas where inflammable materials are being applied. Prevent use of open flames or equipment that may cause sparks during this phase of work.
- 3.6.6. Protect completed work from traffic for at least 1 week to allow proper curing of resinous floor finish. Protect work from any trades using area after completion of installation.

END OF SECTION

PART 1 - GENERAL

1.1. SUMMARY

- 1.1.1. Section Includes: painting new and existing surfaces as indicated on the drawings and specifications. Work under this contract shall also include, but not necessarily be limited to following:
 - 1.1.1.1. Surface preparation of substrate: cleaning and preparation of surfaces for application of paint systems.
 - 1.1.1.2. Priming except where pre-primed with an approved primer under other Sections of work and painting of structural steel, miscellaneous metal, ornamental metal and primed steel equipment.
 - 1.1.1.3. Priming and back-priming of wood materials as noted herein.
 - 1.1.1.4. Painting of all semi-concealed areas e.g. inside of light troughs and valances, behind grilles, and projecting edges above and below sight lines.
 - 1.1.1.5. Painting and finishing of all door frames.
 - 1.1.1.6. Provision of safe and adequate ventilation as required over and above temporary ventilation supplied by others, where toxic and/or volatile / flammable materials are being used.

1.2. REFERENCES

1.2.1. Definitions:

- 1.2.1.1. Exposed: Visible in completed work. In case of closets, cabinets and drawers, it includes their interiors.
- 1.2.1.2. Gloss or Sheen: Capacity of a finish on a surface to reflect light at specific angles as tested in accordance with ASTM D523.
- 1.2.1.3. Hazardous Waste: Construction and demolition materials that are regulated for disposal by local, city, county, province or federal authorities having jurisdiction.
- 1.2.1.4. Painting: In this Section refers to application of various types of paint, stain, varnishes and lacquers, etc.
- 1.2.1.5. Surface Preparation: Cleaning or treating of surface to be painted to ensure best possible bond between surface and painting to be applied to surface; remove surface contaminants that will affect performance of painting, without limitations such as oil, grease, salts, dust, dirt, rust, rust scale, mill scale and old coatings where applicable; remove surface imperfections without limitation including but not limited to such as weld spatter, sharp edges, burrs, slivers, laminations, pits, porosities and crevices; prepare surfaces to provide anchor profile or surface profile which improve mechanical bonding of coating to prepared surface by increasing surface area.

1.3. SUBMITTALS

1.3.1. Product Data:

- 1.3.1.1. Submit Product data and a Schedule of Finishes listing manufacturer's Product name, colour, textures, MSDS and test reports requested for each paint system. Submit test reports for odourless, low or zero VOC Products when requested.
- 1.3.1.2. Painting Subcontractor to receive written confirmation of specific surface preparation procedures and primers used for fabricated steel items from fabricator/supplier to ensure appropriate and manufacturer compatible finish coat materials prior to commencement of painting.
- 1.3.1.3. Submit Product data for concrete and concrete block primers.

- 1.3.2. Samples: Submit samples 30 Days before materials are required.
 - 1.3.2.1. Submit following samples in sizes indicated:
 - 1.3.2.1.1. 2 copies of brushouts minimum 200 mm x 250 mm (8" x 10") of each finish including colour, sheen and texture. Identify each sample with job, finish, colour name, number, sheen and gloss values, substrate to be applied to, date and name of Subcontractor.

1.4. SITE CONDITIONS

- 1.4.1. Ambient Conditions:
 - 1.4.1.1. Paint and finish in clean, dust-free, properly ventilated and adequately lit areas minimum 323 Lx (30 ft candles) on surfaces to be painted or decorated.
 - 1.4.1.2. Provide each paint materials in accordance with manufacturer's recommended tolerances for:
 - 1.4.1.2.1. Substrate Moisture Content: Perform tests with a properly calibrated electronic moisture meter to ensure compliance with manufacturer's recommendations. Without limitation, maximum moisture content as follows:
 - 1.4.1.2.1.1. Concrete and Concrete Unit Masonry: Maximum 12 14% for solvent coatings and as recommended by manufacturer for each water based system.
 - 1.4.1.2.1.2. Gypsum Based Board and Plaster: Maximum 12 14%.
 - 1.4.1.2.1.3. Wood: Maximum 15%.

PART 2 - PRODUCTS

2.1. MANUFACTURERS

- 2.1.1. Manufacturer List: Products of following manufacturers are acceptable subject to conformance to requirements of Drawings, Schedules and Specifications
 - 2.1.1.1. Benjamin-Moore <u>www.benjaminmoore.com</u>
 - 2.1.1.2. Dulux Paints www.dulux.ca
 - 2.1.1.3. Sherwin Williams www.sherwin-williams.com
- 2.1.2. Basis of Design: for interior latex applications (PT-1): "Promar 200 HP Zero VOC" by Sherwin Williams
- 2.1.3. Substitution Limitations: Substitution Limitations: Comparable Products from other manufacturers not listed herein will be considered provided:
 - 2.1.3.1. They are submitted in accordance with Substitution Procedures specified in Division 01
 - 2.1.3.2. Meet requirements of this Specification.
 - 2.1.3.3. Acceptance by Consultant.

2.2. MATERIALS

- 2.2.1. General: paint systems for existing surfaces shall be same finish system as for new work as specified below, but primer for existing painted or wallpapered surfaces: 1 coat X-Pert Gripper 250 by PPG, or as otherwise recommended by the finish paint manufacturer.
- 2.2.2. Finishes:
 - 2.2.2.1. Colours: to be selected by Consultant
 - 2.2.2.2. Gloss Values Definition, as determined by ASTM D523:

		Light Reflection Unit
G1	Gloss Level 1 – Traditional matte finish, Flat	< 5
G2	Gloss Level 2 – High side sheen Flat, "Velvet-like" finish	< 10
G3	Gloss Level 3 – Traditional "Eggshell-like" finish	10 - 25
G4	Gloss Level 4 – "Satin-like" finish	20 - 35
G5	Gloss Level 5 – Traditional Semi- Gloss	35 - 70
G6	Gloss Level 6 – Traditional Gloss	70 - 85
G7	Gloss Level 7 – High Gloss	> 85

2.2.2.3. Gloss Values unless otherwise specified:

2.2.2.3.1. Walls: G4

2.2.2.3.2. Floors: G5 or G6

2.2.2.3.3. Ceilings: G1

2.2.2.3.4. Trim and Doors: G5

2.2.2.3.5. Signage: G1

2.2.3. Mixing and Tinting:

2.2.3.1. Unless otherwise specified herein or pre-approved, all paint shall be ready-mixed and pretinted. Re-mix all paint in containers prior to and during application to ensure break-up of lumps, complete dispersion of settled pigment, and color and gloss uniformity.

2.3. INTERIOR FINISH SCHEDULE:

- 2.3.1. Concrete Vertical Surfaces:
 - 2.3.1.1. 1 coat primer alkali resistant water based: Dulux Gripper Universal Acrylic Primer/ Sealer code 60000A
 - 2.3.1.2. 2 coats latex: Dulux Lifemaster code 59311
 - 2.3.1.3. Finish: G3 -Eggshell.
- 2.3.2. Concrete Masonry Units (CMU's): (concrete block and concrete brick):
 - 2.3.2.1. 1 coat latex block filler: Dulux X-Pert Acryluc
 - 2.3.2.2. 2 coats latex: Dulux Lifemaster code 59311
 - 2.3.2.3. Finish: G3 -Eggshell.
- 2.3.3. Structural Steel and Metal Fabrications: (with existing shop coat primer):
 - 2.3.3.1. Unexposed: No further finishing required except for touch-up of damaged surfaces.
 - 2.3.3.2. Exposed:
 - 2.3.3.2.1. 1 coat quick dry metal primer: PPG Pitt-Tech Plus EP WB Acrylic Primer

- 2.3.3.2.2. 2 coats quick dry enamel: PPG HPC Alkyd Industrial Semi-Gloss Enamel code 4336H
- 2.3.3.2.3. Finish: G5 Semi-Gloss.
- 2.3.4. Galvanized Metal (Not Chromate Passivated): (High contact/high traffic areas (doors, frames, railings, pipes, etc.) low contact/low traffic areas (overhead decking, pipes, ducts, etc.):
 - 2.3.4.1. 1 coat waterborne primer: PPG Pitt-Tech Plus EP WB Acrylic Primer
 - 2.3.4.2. 2 coats latex: Dulux acrylic eggshell code 14220
 - 2.3.4.3. Finish: G3 Eggshell
- 2.3.5. Gypsum Board:
 - 2.3.5.1. 1 coat latex primer sealer: Dulux X-Pert code 11000
 - 2.3.5.2. 2 coats latex:
 - 2.3.5.2.1. Walls: Dulux Lifemaster code 59311
 - 2.3.5.2.1.1. Finish: G3 Eggshell
 - 2.3.5.2.2. Ceilings: Dulux Lifemaster code 59111
 - 2.3.5.2.2.1. Finish: G1 Flat.
- 2.3.6. Plywood Backer Panels:
 - 2.3.6.1. 2 coats Albi Cote FRL-X
 - 2.3.6.2. Finish: G1 Flat

PART 3 - EXECUTION

3.1. EXAMINATION

- 3.1.1. Verification of Conditions:
 - 3.1.1.1. Do work only when surfaces and conditions are satisfactory for production of quality work. Report to Consultant in writing any surfaces which are found to be unsatisfactory.
 - 3.1.1.2. Ensure temperature of surfaces to be finished are as required for application of finish.

 Refer to "Temperature and Ventilation" article specified herein. Ensure surfaces are dry and free of dirt, grease or other contaminants that may affect applied finish.
 - 3.1.1.3. Verify moisture content of surfaces with electronic moisture meter. Do not proceed without written directions if moisture reading is higher than as required for application. Refer to "Ambient Conditions" article specified herein for substrate moisture content requirements.
 - 3.1.1.4. If substrate is masonry, allow to cure for 30 to 90 Days. Ensure moisture content is between 12% and 14% and test for alkalinity and neutralize (pH 6.5 7.5) before proceeding with priming.
 - 3.1.1.5. If substrate is gypsum board, inspect to ensure joints are completely filled and sanded smooth. Inspect surfaces for "nail popping", screw heads not recessed and taped, breaks in surface or other imperfections and have repaired as required.

3.2. PREPARATION

- 3.2.1. Protection of In-Place Conditions:
 - 3.2.1.1. Provide scaffolding, staging, platforms and ladders, as required for execution of work. Erect scaffolding to avoid interference with work of other trades. Comply with Occupational Health and Safety Act.

- 3.2.1.2. During work of this Section, provide drop cloths, plastic, plywood or metal sheets to protect floors in areas assigned for storage and mixing of paints. Cover finished floors, walls, ceilings and other work in vicinity and protect from paint and damage.
- 3.2.1.3. Protect work of other trades against paint splattering and Make Good at own expense any such damage.
- 3.2.1.4. Vacuum clean floors in areas to be painted.
- 3.2.1.5. Remove and securely store miscellaneous and finish hardware and surface fittings, electrical switch and outlet covers, receptacle plates, louvres, fittings and fastenings, to protect from paint splatter. Mask items not removable. Use sufficient drop cloths and protective coverings for full protection of floors, furnishings, mechanical, electrical and special equipment, other components of building which do not require painting or to be removed, from paint spotting and other soiling. Carefully clean and re-install items when paint is dry. Clean any components that are paint spotted or soiled. Do not use solvent or reactive cleaning agents on items that will mar or remove finishes (e.g. lacquer finishes).
- 3.2.1.6. Prohibit traffic, where possible, from areas where painting is being carried out and until paint is cured. Post "wet paint" or other warning signage during and on completion of work. Provide also warning signs at points of entry to areas where painting is applied and drying.

3.2.2. Surface Preparation:

- 3.2.2.1. Prepare defective surfaces to obtain a satisfactory substrate and in accordance with paint manufacturer's instructions.
- 3.2.2.2. Prior to painting, wipe down wall surfaces, vacuum clean floors, ensure all surfaces are dust-free.
- 3.2.2.3. Clean soiled surfaces to be painted. Wash existing surfaces with a biodegradable detergent, and bleach where applicable, and clean warm water using a stiff bristle brush to remove dirt, oil and other surface contaminants. Rinse scrubbed surfaces with clean water until foreign matter is flushed from surface. Allow surfaces to drain completely and allow to dry thoroughly.
- 3.2.2.4. Remove efflorescence, chalk, dust, dirt, oil, grease, rust, form oil, release agents, loose mill scale and other extraneous matter from surfaces.
- 3.2.2.5. Remove mildew by scrubbing affected area with solution of 150 g (5.3 oz) TSP and 125 g (4.4 oz) bleach in 3.5 ℓ (0.92 gal) water. Rinse well with clean water and allow to dry. If condition is serious, source out finishes with extra mildew resistance.
- 3.2.2.6. Be responsible for surface preparation to suit surface condition and conform to level of cleaning based on SSPC, recommended metal cleaning procedures most commonly used to suit site conditions.
- 3.2.2.7. Existing surfaces general: Remove or set screws, nails, hooks, tacks, and fasteners. Make repairs to damaged surfaces.
 - 3.2.2.7.1. Existing gypsum board: Repair cracks and fissures by cutting away broken, damaged or loose material to expose substrate. Fill crack or damaged area with suitable new material in accordance with Section 09 29 00 Gypsum Board.

3.2.2.8. Concrete and Masonry:

- 3.2.2.8.1. Form Oil Removal: Remove with Xylol or TSP.
- 3.2.2.8.2. Efflorescence Removal: Remove by dry brushing or washing with 1 part commercial muriatic acid to 20 parts water by volume and thoroughly rince with clean water.

- 3.2.2.8.3. Mildew Removal: Remove by scrubbing affected area with 1 part sodium hypochlorite to 3 parts water. Where dirt is also evident, add 1.36 kg (3 lbs) TSP to 6.8 ℓ (1.5 gal) of above solution.
- 3.2.2.8.4. Concrete Vertical Surfaces: Use sand blasting, high pressure water blasting, high pressure water blasting with abrasives, vacuum blasting with abrasives or alternatively, needle guns or power grinders equipped with suitable grinding stone, to remove concrete, loose mortar, fins, projections and surface contaminants. Vacuum or blow down and remove dust and loose particles from surface. Fill large cracks and/or voids in consultation with design engineer using either polyester, epoxy or acrylic resin, block filler or cement sand mixture in accordance with design engineer's written instructions. Fill only flush to surface and allow to set.
- 3.2.2.8.5. Concrete Block Masonry: Fill voids and cracks in masonry block wall to provide uniform surface for subsequent coats.

3.2.2.9. Metals:

- 3.2.2.9.1. Ensure application of paint and coatings occurs within appropriate time frame after cleaning when environmental conditions encourage flash-rusting, rusting, contamination or manufacturer's paint specifications require earlier applications.
- 3.2.2.9.2. SSPC-SP 3 (Power Tool Cleaning): Use of power sanders and wire brushes, impact tools, grinders and power chipping hammers to remove loose mill scale, loose rust, paint or other foreign matter. Do not employ power tool cleaning excessively causing burnished mill scale preventing primers to adhere properly.
- 3.2.2.9.3. Ferrous Metal: Clean to SSPC-SP 1/2/3, to suit site conditions. Remove loose rust and prime bare metal with rust inhibitive steel primer. Touch-up damaged shop applied primer using compatible Product. Provide full coat primer only if damage is extensive. Treat weld areas with phosphoric acid (5% solution).
- 3.2.2.9.4. Structural Steel/Miscellaneous Steel (previously painted and exposed by alterations work): Remove oil, grease, dirt, rust scale, loose mill scale, loose paint or coating by brush-off blast cleaning to SSPC-SP 7.
- 3.2.2.9.5. Hot Dipped Galvanized Steel (Unweathered): Allow to weather minimum of 26 weeks and Xylene clean to SSPC-SP 1 specified herein prior to coating to remove dust, dirt, grease, oxides and other foreign material. Remove silicates or similar surface treatments or any deposits of white rust by sanding or similar abrasive methods (bronze wool). Use of acetic acid to prepare galvanized surfaces is not acceptable.
- 3.2.2.9.6. Galvanized Steel (Weathered): Remove dust, dirt, grease, oxides and other foreign material and clean to SSPC-SP 1 specified herein prior to coating.
- 3.2.2.9.7. Galvanized Steel (Pre-Treated)(Non-Crystal Appearance): Follow manufacturer's recommendations for preparation, priming and coating of pretreated galvanized steel.
- 3.2.2.9.8. Light Zinc Coated or Satin Coated Products (ZF075) mostly found in environmentally controlled areas. Follow manufacturer's recommendations for preparation, priming and coating.
- 3.2.2.9.9. Heavy Coated Zinc Z275 (G90) for high humidity areas and as specified. Follow manufacturer's recommendations for preparation, priming and coating.
- 3.2.2.9.10. Metal Doors: Remove doors before painting to paint bottom and top edges and re-hang once dry. Do not paint stainless steel or bronze door butts. Paint or

finish top and bottom edges of doors. Touch-up or refinish tops and edges after fitting.

3.2.2.10. Previously Finished Surfaces:

- 3.2.2.10.1. Clean existing interior and exterior surfaces to be repainted or varnished to provide bond. Remove rust, scale, oil, grease, mildew, chemicals and other foreign matter. Remove loose paint and fill flush with suitable patching material. Clean off bubbled, cracked, peeling or otherwise defective paint by stripping with suitable environmental strippers or by burning. Do not burn off paints suspected of having lead content. Treat residue from stripping as Hazardous Waste.
- 3.2.2.10.2. Flatten gloss paint and varnish with sandpaper and wipe off dust. If previous coatings have failed so as to affect proper performance or appearance of coatings to be applied, remove previous coatings completely and prepare substrates properly and refinish as specified for new work.
- 3.2.2.10.3. Remove or set screws, nails, hooks, tacks, and fasteners. Make repairs to damaged surfaces.
- 3.2.2.10.4. Existing gypsum board: Repair cracks and fissures by cutting away broken, damaged or loose material to expose substrate. Fill crack or damaged area with suitable new material in accordance with Section 09 29 00 Gypsum Board.
- 3.2.2.10.5. Leave entire surface suitable to receive designated finishes and in accordance with finish manufacturer's instructions.

3.2.2.11. Woodwork:

- 3.2.2.11.1. Verify and determine wood species, grain direction and structure, properties of finish, application method and exposure to elements. Check moisture content to avoid movement of wood caused by expansion and contraction due to changes in moisture content. Verify grain cut as it may interfere with adhesion of paint.
- 3.2.2.11.2. Apply wood finishing Product in following order and as needed for specific appearance and application specified herein. Sanding sealer to control penetration of subsequent coats to create more uniform finish. Stain to colour wood and highlight grain for final finish. Filler to fill pores of wood and control penetration of subsequent coats. Apply filler across grain forcing it into pores followed with rubbing and sanding when dried. For staining requirements mix stain with filler before applying for uniform finish. Finish coats to provide protection to wood.
- 3.2.2.11.3. Wood work for Opaque Coating: Seal knots and sapwood in surfaces to receive paint with alcohol-based primer-sealer. Seal door edges. Sand smooth rough surfaces of woodwork to be finished using No. 150 grit paper followed by a second sanding using No. 220 grit paper. Sand in direction of grain. Clean surfaces free of dust before applying first coat using brush, compressed air or tack rags. Fill nail holes, splits and scratches with non-shrinking filler after first coat is dry.
- 3.2.2.11.4. Prepare plywood surface by removing dirt and debris. Fill screw and nail holes or minor imperfections with recommended filler and sand properly to receive finish coating. Ensure plywood requiring stained or painted finish is primed with top quality alkyd primer. Use only penetrating quality stain over plywood.
- 3.2.2.11.5. Woodwork for Clear Finish or Stain: Sand smooth woodwork to be finished using No. 150 grit paper followed by a second sanding using No. 220 grit paper and clean surfaces free of dust using brush, compressed air or tack rags before applying first coat. Abrade surfaces with stiff brush to remove loose fibres and splinters. Fill nail holes, splits and scratches with non-shrinking filler tinted to

- match local grain condition after first coat is dry. Sand lightly between coats with No. 220 grit sandpaper and remove dust.
- 3.2.2.11.6. Remove salt deposits that may appear on wood surfaces treated with fire retarder.
- 3.2.2.11.7. Obtain inspection of glue laminated beams by assigned painting inspector to ensure shop sealer has been applied. Where non-specified shop sealer has been applied to beams or columns, remove and refinish in accordance with manufacturer's written instructions.
- 3.2.2.11.8. Wood Doors: Remove doors before painting to paint bottom and top edges and re-hang once dry. Paint or finish top and bottom edges of doors to be painted or stained. Touch-up or refinish tops and edges after fitting.

3.2.2.12. Gypsum Board:

- 3.2.2.12.1. Examine and ensure gypsum board surfaces are without defects or deficiencies and suit able to receive painting applications. Commencement implies acceptance of gypsum board work. Examine surfaces after for imperfections showing through and fill small nicks or holes with patching compound and sand smooth. Examine surfaces after priming for imperfections showing through.
- 3.2.2.12.2. Clean surfaces dry, free of dust, dirt, powdery residue, grease, oil, wax or any other contaminants.

3.3. APPLICATION

- 3.3.1. Safety Precautions: When handling solvent coating materials, wear approved vapour/particulate respirator as protection from vapours. Dust respirators do not provide protection from vapours.
- 3.3.2. Material Compatibility: Provide primers and finish coat materials compatible with each other and substrate including fillers.
- 3.3.3. Obtain colour chart giving colour schemes and gloss value for various areas from Consultant. Ensure colour chart gives final selection of colours and surface textures of finishes and whether finishes are transparent (natural) or opaque (paint).
- 3.3.4. Provide finish uniform in sheen, colour and texture, free from streaks, shiners and brush or roller marks or other defects.
- 3.3.5. Apply materials in accordance with manufacturer's directions and specifications paying particular attention to appropriate time frame after cleaning when environmental conditions encourage flash-rusting, rusting, contamination or manufacturer's paint specifications require earlier applications. Do not use adulterants. Do any reduction of coating's viscosity in accordance with manufacturer's directions.
- 3.3.6. Use up paints within period of shelf life recommended by paint manufacturer.
- 3.3.7. Ensure successive coatings are harmonious chemical compositions and materials of same manufacturer.
- 3.3.8. Apply primer coat soon after surface preparation is completed to prevent contamination of substrate.
- 3.3.9. Primer/Sealers: Apply primer-sealer coats by brush or roller. Permit to dry in accordance with manufacturer's recommendations before applying succeeding coats. Touch up suction spots and sand between coats with No. 120 sandpaper.
- 3.3.10. Sand and dust between each coat to provide an anchor for next coat and to remove defects visible from a distance up to 1 m (39").
- 3.3.11. Ensure each coat is dry and hard before a following coat is applied.
- 3.3.12. Continue through paint finish behind wall-mounted items (e.g. chalk and tack boards).

- 3.3.13. Finish listed surfaces indicated on Room Finish Schedule(s) and/or noted on Drawing(s) and as specified. Refer to Finish Room Schedule for type, location and extent of finishes required and include touch-ups and field painting necessary to complete work shown, scheduled or specified.
- 3.3.14. Finishes and number of coats specified in Room Finish Schedule are intended as minimum requirements guide only. Refer to manufacturer's recommendations for exact instructions for thickness of coating to obtain optimum coverage and appearance. Some materials and colours may require additional coats and deeper colours may require use of manufacturers' special tinted primers. Apply additional paint coats, beyond number of coats specified for any surface, to completely cover and hide substrate and to produce a solid, uniform appearance
- 3.3.15. Painting previously painted surfaces:
 - 3.3.15.1. Paint entire plane of wall or ceiling.
 - 3.3.15.2. Where there has been patching or repair work paint entire plane of wall or ceiling. Patching is not acceptable.
- 3.3.16. Do not paint baked paint surface, chrome plated, stainless steel, aluminum or other surfaces finished with final finish in factory. Finish paint primed surfaces.
- 3.3.17. Metals:
 - 3.3.17.1. Apply primer coat to unprimed ferrous metal surfaces. Where sandblast preparation is specified, apply specified primer immediately after blast cleaning.
- 3.3.18. Woodwork:
 - 3.3.18.1. Fill open grain woods with filler tinted to match wood and work well into grain. Wipe excess from surface before filler sets.
 - 3.3.18.2. Sand smooth paint and varnish undercoats prior to recoating.
 - 3.3.18.3. Prime woodwork designated for painting as soon as possible after delivery to site and before installation. Prime cut surfaces, whether exposed or not, i.e. 6 edges of wood doors, before installation. Prime cut surfaces of woodwork to receive transparent finish with 1 coat of transparent finish reduced 25% or as directed by manufacturer.
 - 3.3.18.4. Apply final coats on smooth surfaces by roller or brush. Hand brush wood trim surfaces.
- 3.3.19. Allow each coat of paint to cure and become dry and hard before application of succeeding coats (unless manufacturer's directions require otherwise).
- 3.3.20. Before finishing paint coats are applied, inspect and touch-up shop coats of primers previously applied by other trades or fabricators.
- 3.3.21. Provide paint coating thicknesses indicated, measured as minimum DFT.
- 3.3.22. Apply a minimum of 4 coats of paint where deep or bright colours are used to achieve satisfactory results.
- 3.3.23. Ledges: Finish projecting ledges, both above and below sight lines, as specified for adjacent surfaces.
- 3.3.24. Light Coves: Paint light coves white whether a light lens is installed or not, unless otherwise indicated.
- 3.3.25. Interior Columns: Finish interior columns same as walls of room unless otherwise indicated.
- 3.3.26. Mechanical and Electrical Services:
 - 3.3.26.1. Co-ordinate painting of mechanical and electrical equipment, piping, conduit, system Identification with appropriate Mechanical and Electrical Specification Sections. Unless otherwise specified or noted, paint "unfinished" conduits, piping, hangers, ductwork and other mechanical and electrical equipment with colour and texture to match adjacent surfaces, where exposed-to-view in exterior and interior areas.

- 3.3.26.2. Prime and paint exposed, unfinished electrical raceways, fittings, outlet boxes, junction boxes, pull boxes and similar items.
- 3.3.26.3. Take steps to protect gauges, identification plates and similar items from being painted over or paint splattered.
- 3.3.26.4. Remove grilles, covers, access panels for mechanical and electrical systems from installed location and paint separately, if these items are not factory finished. Paint adjacent surfaces after removal and reinstall when surfaces are dry.
- 3.3.26.5. Paint work to match surfaces they are seen against unless directed otherwise.
- 3.3.26.6. Paint interior surfaces of air ducts visible through grilles and louvres, with 1 coat of flat black metal paint to limit of sight line.
- 3.3.26.7. In unfinished areas leave exposed conduits, piping, hangers, ductwork and other mechanical and electrical equipment in original finish and touch up scratches and marks.
- 3.3.26.8. Touch up scratches and marks on factory painted finishes and equipment with paint as supplied by manufacturer of equipment.
- 3.3.26.9. Do not paint over nameplates.
- 3.3.26.10. Paint behind louvres grilles and diffusers for minimum of 460 mm (18") or beyond sight line, whichever is greater, to be painted with primer and 1 coat of matt black (non-reflecting) paint.
- 3.3.26.11. Paint each surface inside of light valances.
- 3.3.26.12. Paint disconnect switches for fire alarm system and exit light systems in red enamel.
- 3.3.26.13. Paint or band fire protection piping and sprinkler lines in accordance with mechanical requirements. Keep sprinkler heads free of paint.
- 3.3.26.14. Paint yellow or band natural gas piping in accordance with mechanical requirements.
- 3.3.26.15. Back prime and paint face and edges of plywood service panels for telephone and electrical equipment before installation to match adjacent wall surface. Leave equipment in original finish except for touch-up as required and paint conduits, mounting accessories and other unfinished items.

3.4. SITE QUALITY CONTROL

3.4.1. Non-Conforming Work:

- 3.4.1.1. Replace damaged work which cannot be satisfactorily repaired, restored or cleaned, to satisfaction to Consultant at no cost to Owner. Touch up small affected areas, repaint large affected areas or areas without sufficient DFT of paint. Remove runs, sags of damaged paint by scraper or by sanding prior to application of paint.
- 3.4.1.2. Following are considered non-conforming qualities:
 - 3.4.1.2.1. Lack of Uniformity:
 - 3.4.1.2.1.1. Brush/roller marks, streaks, laps, runs, sags, drips, heavy stippling, hiding or shadowing by inefficient application methods, skipped or missed areas and foreign materials in paint coatings.
 - 3.4.1.2.1.2. Evidence of poor coverage at rivet heads, plate edges, lap joints, crevices, pockets, corners and re-entrant angles.
 - 3.4.1.2.1.3. Damage due to touching before paint is sufficiently dry or any other contributory cause.

.

3.4.1.2.1.4.	Damage due to application on moist surfaces or caused by inadequate protection from weather.
3.4.1.2.1.5.	Damage and/or contamination of paint due to blown contaminants (dust, spray paint, etc.).
3.4.1.2.2.	Aesthetic Problems: If following are evident under final lighting source (including daylight) for interior surfaces:
3.4.1.2.2.1.	Visible defects are evident on vertical surfaces when viewed at normal viewing angles from a distance of not less than 1 m (39").
3.4.1.2.2.2.	Visible defects are evident on horizontal surfaces when viewed at normal viewing angles from a distance of not less than 1 m (39").
3.4.1.2.2.3.	Visible defects are evident on ceiling, soffit and other overhead surfaces when viewed at normal viewing angles.
3.4.1.2.2.4.	When final coat on any surface exhibits a lack of uniformity of colour, sheen, texture and hiding across full surface area.

3.5. CLEANING

- 3.5.1. Keep waste rags in covered metal drums containing water and remove from building at end of each Day. Remove other combustible rubbish materials and empty paint cans each Day from site and safely dispose of same in accordance with requirements of authorities having jurisdiction.
- 3.5.2. Clean equipment and dispose of wash water/solvents as well as other cleaning and protective materials (e.g. rags, drop cloths, masking papers, etc.), paints, thinners, paint removers/strippers in accordance with safety requirements of authorities having jurisdiction.
- 3.5.3. Clean containers used for storage, mixing and application of materials free of foreign materials and residue.
- 3.5.4. Keep work area free from an unnecessary accumulation of tools, equipment, surplus materials and debris.
- 3.5.5. Clean adjacent surfaces which have been painted, soiled or otherwise marred. Remove spilled, splashed, splattered or sprayed paint as work progresses using means and materials that are not detrimental to affected surfaces.
- 3.5.6. Remove masking and other protection provided under this Section.
- 3.5.7. Remove temporary protective wrappings provided by others for protection of work after completion of painting operations unless instructed otherwise.
- 3.5.8. Painting work will not be considered complete until spatters, drippings, smears and overspray have been cleaned and removed to satisfaction of Consultant.
- 3.5.9. Make Good any damage to structure building surfaces or furnishings resulting from painting operations at no cost to Owner.
- 3.5.10. Waste Management:
 - 3.5.10.1. Dispose paint waste in accordance with local regulations.
 - 3.5.10.2. Set aside and protect surplus and uncontaminated finish materials not required by Owner and deliver or arrange collection for verifiable re-use or re-manufacturing.

END OF SECTION

PART 1 - GENERAL

1.1. GENERAL INSTRUCTIONS

- 1.1.1. Read and conform to:
 - 1.1.1.1. Division 01 requirements and documents referred to therein.

1.2. SUMMARY

- 1.2.1. Section Includes:
 - 1.2.1.1. Headrail-braced metal toilet partitions
 - 1.2.1.2. Urinal Privacy Screens (PS).
 - 1.2.1.3. Barrier free type hardware.
 - 1.2.1.4. Combined hook and bumper
 - 1.2.1.5. Anchors, brackets and fastenings.

1.3. SUBMITTALS

- 1.3.1. Product Data:
 - 1.3.1.1. Submit manufacturer's instructions, printed product literature and data sheets for metal toilet compartments and urinal screens and include product characteristics, performance criteria, physical size, finish and limitations
- 1.3.2. Shop Drawings: Submit Shop Drawings for work of this Section.
 - 1.3.2.1. Indicate fabrication details, plans, elevations, hardware, and installation details
- 1.3.3. Samples: Submit following samples in sizes indicated:
 - 1.3.3.1. One coat hook, top and bottom hinge, slide latch, stainless steel shoe, panel fitting, stirrup bracket and other hardware items and fasteners.
 - 1.3.3.2. Corner section, 200 mm x 200 mm (8" x 8") showing corner, edge and core construction.

1.4. CLOSEOUT SUBMITTALS

- 1.4.1.1. Operation and Maintenance Data: Submit maintenance manual in accordance with Division 01.
 - 1.4.1.1.1. The Manual shall consist of a hard cover three ring binder with the project name in the front. Include in the manual the following information: maintenance instructions, catalogue pages for each product, name/address and phone number of the manufacturer and their sales agent, copy of the final shop drawings.

1.5. QUALITY ASSURANCE

- 1.5.1. Qualifications:
 - 1.5.1.1. Installers: Provide work of this Section executed by competent installers with minimum 5 years experience in the application of Products, systems and assemblies specified and with approval and training of the Product manufacturers.

1.6. DELIVERY, STORAGE AND HANDLING

1.6.1. Delivery and Acceptance Requirements: Deliver materials in sequence to meet installation schedule. Provide protection from marring or other damage.

1.6.2. Storage and Handling Requirements: Carefully unload materials; handle and store in a manner to prevent damage. Remove unsatisfactory materials and replace to Consultant's satisfaction at no cost to Owner.

1.7. WARRANTY

1.7.1. Manufacturer Warranty: Warrant work of this Section for period of 3 years against defects and/or deficiencies in accordance with General Conditions of the Contract. Promptly correct any defects or deficiencies which become apparent within warranty period, to satisfaction of Consultant. Defects include but are not limited to; buckling, opening of seams, bond failure and extensive colour fading.

PART 2 - PRODUCTS

2.1. MANUFACTURERS

- 2.1.1. Manufacturer List: Products of following manufacturers are acceptable subject to conformance to requirements of Drawings, Schedules and Specifications:
 - 2.1.1.1. ASI Global Partitions; www.asigroup-canada.com
 - 2.1.1.2. Bradley Corporation; www.bradleycorp.com
 - 2.1.1.3. Centar Industries; www.centarind.com
 - 2.1.1.4. Global Steel Products Corp.; www.globalpartitions.com
 - 2.1.1.5. Hadrian Manufacturing Inc.; www.hadrian-inc.com
- 2.1.2. Substitution Limitations: This Specification is based on Hadrian. Comparable Products from other manufacturers listed herein will be considered provided they meet requirements of this Specification after full review by Consultant.

2.2. MATERIALS

- 2.2.1. Sheet Steel: Commercial quality to ASTM A653/A653M with ZF001 designation zinc coating.
- 2.2.2. Minimum base steel thickness:
 - 2.2.2.1. Panels, Pilasters and Doors: 0.8 mm (22 gauge)
 - 2.2.2.2. Reinforcement: 3.0 mm
- 2.2.3. Headrails: 25 mm x 41 mm x 1.5 mm thick, clear anodized, extruded aluminum with double-ridge antigrip design.
- 2.2.4. Pilaster shoe: welded one-piece design 0.8 mm (22 gauge) stainless steel with #4 brushed satin finish, 102 mm high.
- 2.2.5. Brackets: Chrome plated zinc die castings
- 2.2.6. Fasteners: tamperproof type screws and bolts.

2.3. COMPONENTS

- 2.3.1. Hinges:
 - 2.3.1.1. Heavy duty, self-lubricating nylon sleeve.
 - 2.3.1.2. Material/Finish: Chrome plated non-ferrous casting.
 - 2.3.1.3. Swing:
 - 2.3.1.3.1. Outward for barrier free installation.
 - 2.3.1.3.2. Inward for all other doors

- 2.3.1.4. Return Movement: Gravity action. Adjustable to hold door open at any angle up to 90 degrees.
- 2.3.1.5. Emergency access feature.
- 2.3.2. Latch: concealed, chrome plated zinc die casting with face mortised flush with edge strip of door
- 2.3.3. Combination door-stop, keeper and bumper, chrome plated non-ferrous, with emergency access feature.
- 2.3.4. Wall and connecting brackets: chrome plated non-ferrous casting.
- 2.3.5. Coat Hook: Combination hook and rubber door bumper, chrome plated non-ferrous.
- 2.3.6. Door Pull: Barrier-free type suited for out swinging doors, chrome plated non-ferrous.
- 2.3.7. Headrail: 25mm (1") x 41mm (1.625") extruded anodized aluminum with double-ridge anti-grip design. Wall thickness to be 1.5mm (0.060")
- 2.3.8. Fasteners: zinc plated 12 x 1-3/4" and 12 x 5/8" TR-27 6-lobe security screws

2.4. FABRICATION

- 2.4.1. Visit site and take necessary measurements required before fabrication.
- 2.4.2. Accurately follow methods of fabrication reinforcement and anchorage shown on reviewed Shop Drawings.
- 2.4.3. Cut, shear, straighten and work steel in a manner to prevent disfigurement of finished work.
- 2.4.4. Ensure finished work is free of warp, open seams, buckles and other surface defects detrimental to appearance.
- 2.4.5. Doors, panels and screens: 25 mm thick, two steel sheets faces pressure bonded to honeycomb core, to sizes indicated.
- 2.4.6. Pilasters: 32 mm thick, constructed same as door, to sizes indicated.
- 2.4.7. Ensure door hinges are fully concealed within thickness of door and adjustable to permit door to come to rest at any position when not latched.
- 2.4.8. Include formed and closed edges for doors, panels and pilasters.
 - 2.4.8.1. Miter and weld corners and grind smooth.
- 2.4.9. Include internal reinforcement at areas of attached hardware and fittings.
 - 2.4.9.1. Temporarily mark location of reinforcement for tissue holders and grab bars.
- 2.4.10. Provide each door with a combined coat hook and bumper and concealed latch with face mortised flush with edge strip of door. Ensure combined stop and keeper have 19 mm (3/4") diameter bumper locked in place.
- 2.4.11. Headrail to be securely attached to wall and pilasters with manufacturer's fittings in such a way as to make a strong and rigid installation. All joints in headrails shall be made at pilaster.
- 2.4.12. Provide barrier free type of hardware for disabled stall unit without limitations as follows:
 - 2.4.12.1. Provide door capable of being locked from inside with locking mechanism operated by 1 hand. Include thumb turn lever to activate latch without fingertip grip application.
 - 2.4.12.2. Both standard and barrier-free latches shall have a turn slot designed to allow emergency access from exterior.
 - 2.4.12.3. Provide door with door pull on outside, near latch side of door.
 - 2.4.12.4. Equip stall with coat hook mounted not more than 1220 mm (48") above floor on side wall and projecting not more than 25 mm (1") from wall.

- 2.4.13. Provide wall channels, factory formed and punched, 75 mm (3") deep, wide enough to fit pilasters and at least 1220 mm (48") long.
- 2.4.14. Provide both standard and barrier free latches with turn slot designed to allow emergency access from exterior.
- 2.4.15. Urinal Privacy Screens (PS): 610 mm x 1219 mm (24" x 48"), same construction as partitions, but wall hung with a minimum of 3 wrap-around brackets.
- 2.4.16. **FINISHES**
- 2.4.17. Clean, degrease, and neutralize steel components with phosphate or chromate treatment.
- 2.4.18. High performance powder coating, electrostatically applied and oven cured to provide a uniform, smooth finish.
- 2.4.19. Colour: no. 504 Linen.

PART 3 - EXECUTION

3.1. EXAMINATION

- 3.1.1. Verification of Conditions: Verify actual site dimensions and location of adjacent materials prior to commencing work. Notify Consultant in writing of any conditions which would be detrimental to the installation.
- 3.1.2. Verify that back-up supports and blocking are in place to secure work of this Section.
- 3.1.3. Evaluation and Assessment: Commencement of work implies acceptance of previously completed work.

3.2. INSTALLATION

- 3.2.1. Do work in accordance with CSA B651
- 3.2.2. Install partitions and screens plumb and square to building lines and according to manufacturer's printed directions. Ensure gap between panel to panel, panel to door and panel to adjacent construction is not greater than 9 mm (3/8").
- 3.2.3. Partition erection.
 - 3.2.3.1. Install partitions secure, plumb and square.
 - 3.2.3.2. Anchor mounting brackets to masonry/concrete surfaces using screws and shields:
 - 3.2.3.3. Attach panel and pilaster to brackets with through type sleeve bolt and nut.
 - 3.2.3.4. Attach panel to wall using continuous 3" channel
 - 3.2.3.5. Allow for adjustment of floor-braced pilasters variations with screw jack through steel saddles made integral with pilaster.
 - 3.2.3.5.1. Conceal floor fixings with stainless steel shoes.
 - 3.2.3.6. Equip doors with hinges, latch set, and each stall with coat hook mounted on door, mounting heights as shown on drawings.
 - 3.2.3.6.1. Adjust and align hardware for easy, proper function. Set door open position at 30 degrees to front.
 - 3.2.3.6.2. Install door bumpers.
 - 3.2.3.7. Equip outswinging doors with door pulls on inside and outside of door in accordance with CSA B651.
- 3.2.4. Floor supported and overhead braced partition erection:

- 3.2.4.1. Attach pilasters to floor with pilaster supports. Adjust and level, plumb, and tighten installation with levelling device.
 - 3.2.4.1.1. Secure pilaster shoes in position.
 - 3.2.4.1.2. Secure headrail to pilaster face with not less than two fasteners per face.
 - 3.2.4.1.3. Set tops of doors parallel with overhead brace when doors are in closed position.
- 3.2.4.2. Floor supported partition erection.
 - 3.2.4.2.1. Secure pilasters to floor with pilaster supports anchored with minimum 50 mm penetration in structural floor.
 - 3.2.4.2.2. Level, plumb and tighten installation with levelling device.
 - 3.2.4.2.3. Secure pilaster shoes in position.
 - 3.2.4.2.4. Set tops of doors level with tops of pilasters when doors are in closed position.
- 3.2.4.3. Urinal screens erection:
 - 3.2.4.3.1. Anchor wall-hung screen panels to walls with 'double ear' brackets.
 - 3.2.4.3.2. Floor mounted post "Stirrup Bracket Installation" with post to be fastened to the panel with "U" brackets that are chrome plated zinc die cast.

3.3. ADJUSTING

- 3.3.1.1. Adjust doors and locks for optimum, smooth operating condition.
- 3.3.1.2. Lubricate hardware and other moving parts.

3.4. CLEANING

- 3.4.1.1. Perform cleaning after installation to remove construction and accumulated environmental dirt.
- 3.4.1.2. Final Cleaning: Upon completion remove surplus materials, rubbish, tools and equipment.
- 3.4.1.3. Clean surfaces after installation using manufacturer's recommended cleaning procedures.
- 3.4.1.4. Clean aluminum with damp rag and approved non-abrasive cleaner.
- 3.4.1.5. Clean and polish hardware and stainless components.

3.5. PROTECTION

3.5.1.1. Protect installed products and components from damage during construction.

END OF SECTION

PART 1 - GENERAL

1.1. GENERAL INSTRUCTIONS

- 1.1.1. Read and conform to:
 - 1.1.1.1. Division 01 requirements and documents referred to therein.

1.2. SUMMARY

- 1.2.1. Section Includes: supply and install washroom and Janitor accessories
- 1.2.2. Install washroom accessories supplied by the Owner
- 1.2.3. Related Sections: Following description of work is included for reference only and shall not be presumed complete:
 - 1.2.3.1. Reinforcing requirements for wall mounted accessories in gypsum board: Section 09 21 16, Non Structural Metal Framing.
 - 1.2.3.2. Plumbing connections: refer to mechanical drawings and specifications.
 - 1.2.3.3. Electrical connections: refer to electrical drawings and specifications.

1.3. ADMINISTRATIVE REQUIREMENTS

1.3.1. Coordination:

- 1.3.1.1. Coordinate location of washroom accessories with other work to prevent interference with clearances required for access, proper installation, adjustment, operation, cleaning and servicing of washroom accessories.
- 1.3.1.2. Provide templates and locations for backing and support framing for accessories.
- 1.3.1.3. Coordinate service locations and connection requirements.

1.4. SUBMITTALS

- 1.4.1. Submittals in accordance with Section 01 33 00 Submittal Procedures.
- 1.4.2. Shop Drawings:
 - 1.4.2.1. Submit Shop Drawings for work of this Section. Ensure Shop Drawings are in the form of catalogue cuts and fully illustrate specified materials with description of components, surface finishes, hardware and securement devices.

1.4.3. Samples:

- 1.4.3.1. If requested, submit complete sample of accessory to Consultant for review of construction quality, materials and finish prior to delivery of required quantities of items. Submit sample of each colour where applicable. Remove trademark and/or labels on exposed finishes prior to acceptance.
- 1.4.3.2. Samples will be returned for installation.

1.5. CLOSEOUT SUBMITTALS

- 1.5.1. Operational and Maintenance Data: Submit maintenance instructions in accordance with Closeout Submittals specified in Division 01. Submit an accessories schedule, keys and parts manual as part of Project closeout documents. Submit 2 sets of following items of manufacturer's literature:
 - 1.5.1.1. Technical Data Sheets of each item used for the Project.
 - 1.5.1.2. Service and Parts Manuals.

1.5.1.3. Name of local representative to be contacted in the event of need of field service of consultation.

1.6. DELIVERY, STORAGE AND HANDLING

1.6.1. Delivery and Acceptance Requirements: Deliver materials in sealed cartons and containers with manufacturer's name and Product description clearly marked thereon.

1.7. WARRANTY

- 1.7.1. Manufacturer Warranty: Warrant mirrors for a period of 10 years against defects and/or deficiencies in accordance with General Conditions of the Contract. Promptly correct any defects or deficiencies which become apparent within warranty period, to satisfaction of Consultant and at no expense to Owner. Defects include but are not limited to; deterioration of mirror's silvering.
- 1.7.2. Float glass mirror shall be guaranteed for 15 years against silver spoilage.
- 1.7.3. Hand dryers: 5 years

PART 2 - PRODUCTS

2.1. MANUFACTURERS

- 2.1.1. Manufacturer List: Products of following manufacturers are acceptable subject to conformance to requirements of Drawings, Schedules and Specifications:
 - 2.1.1.1. ASI Group Canada; www.asigroup-canada.com
 - 2.1.1.2. Bobrick Washroom Equipment of Canada Ltd.; www.bobrick.com
 - 2.1.1.3. Gamco; www.gamcousa.com
 - 2.1.1.4. Elkay; www.elkay.com
 - 2.1.1.5. Frost Products Limited; www.frostproductsltd.com
 - 2.1.1.6. Murdock; www.murdockmfg.com

2.2. MATERIALS

- 2.2.1. Ensure washroom accessories are stainless steel Type 304 or Type 302, of 1 type throughout, NAAMM No. 4 mechanical brushed finish, of contemporary design, with minimum material thicknesses of components as specified herein. Arrange stainless steel sheet so grain of brushed finish runs vertically in finished installation.
 - 2.2.1.1. Minimum thickness, any location or component: 0.607 mm (24 ga)
 - 2.2.1.2. Hygienic accessory exposed double pan doors and panels: 0.607 mm (24 ga)
 - 2.2.1.3. Hygienic accessory exposed single pan doors: 1.214 mm (18 ga)
 - 2.2.1.4. Reinforcement: 1.214 mm (18 ga)
- 2.2.2. Provide washroom accessories as specified with options indicated. Model numbers may not reflect all options required.
- 2.2.3. Provide stainless steel collars to accommodate semi-recessed mounting of units whose depth exceeds wall cavity depth.
- 2.2.4. Units that have keyed tumbler locks shall be keyed alike.

2.3. MANUFACTURED UNITS

- 2.3.1. Accessories supplied by the Owner for installation by this Section:
 - 2.3.1.1. Paper Towel Dispenser (TPD)

- 2.3.1.2. Toilet Paper Dispenser (TPD)
- 2.3.1.3. Soap Dispenser (SD)
- 2.3.2. Mirror (MR):
 - 2.3.2.1. Mirror shall have a one-piece, 18-8 heavy-gauge stainless steel angle frame, 3/4" x 3/4" (19 x 19mm) with continuous integral stiffener on all sides and beveled front to hold frame tightly against mirror; corners shall be heliarc welded, ground, and polished smooth.
 - 2.3.2.2. All exposed surfaces shall have NAAMM No. 4 mechanical brushed satin finish.
 - 2.3.2.3. All edges shall be protected by plastic filler strips and the back shall be protected by full-size, shock-absorbing, water-resistant, nonabrasive, 3/16" (5mm) thick polyethylene padding.
 - 2.3.2.4. Galvanized steel back shall have integral horizontal hanging brackets located at top and bottom for mounting on concealed wall hanger and to prevent the mirror from pulling away from the wall.
 - 2.3.2.4.1. Snap Locking Design: Hang mirror on wall hanger with all four backplate louvers engaged behind horizontal wall hanger members.
 - 2.3.2.4.2. Mirror must be centered in front of the wall hanger horizontally, pressed flat against the wall approximately 1" (25mm) above final position and then lowered into final position.
 - 2.3.2.5. Mirror No. 1 quality, 1/4" (6mm) select float glass (standard glass): selected for silvering, electrolytically copper-plated by the galvanic process
 - 2.3.2.6. Size: 610 mm x 910 mm (24" x 36")
 - 2.3.2.7. Basis of design: Model No, B-290 by Bobrick.
- 2.3.3. Sanitary Napkin Disposal (ND):
 - 2.3.3.1. Surface-mounted sanitary napkin disposal type-304 stainless steel with all-welded construction:
 - 2.3.3.2. Exposed surfaces shall have NAAMM No. 4 mechanical brushed satin finish.
 - 2.3.3.3. Door shall be secured to cabinet with a full-length stainless steel piano-hinge and equipped with keyed tumbler lock.
 - 2.3.3.4. Unit shall have a self-closing panel covering each disposal opening. Panel shall have bottom edge hemmed for safety, be secured to door with spring-loaded, full-length stainless steel piano-hinge, and equipped with international graphic symbols identifying sanitary napkin disposal.
 - 2.3.3.5. Unit shall be furnished with a removable, leak-proof molded polyethylene receptacle. Receptacle shall have a capacity of 1.0-gal. (3.8-L)
 - 2.3.3.6. Basis of design: Model No. B-270 by Bobrick.
- 2.3.4. Surface Mounted Waste Receptacle (WR):
 - 2.3.4.1. Type-304, 22-gauge (0.8mm) stainless steel.
 - 2.3.4.2. Exposed surfaces shall have NAAMM No. 4 mechanical brushed satin finish.
 - 2.3.4.3. Waste receptacle shall be equipped with four interior hooks, have reinforced mounting screw holes, and shall be furnished with a removable heavy-gauge vinyl liner.
 - 2.3.4.4. Unit shall have a capacity of 12.75-gal. (48.3-L).
 - 2.3.4.5. Basis of design: Model No. B-277 by Bobrick.

2.3.5. Shelf (SH):

- 2.3.5.1. Satin-finish stainless steel, 32 mm (1-1/4") high, 100 mm (4") projection, 457 mm (18") wide, 18-8, type 304, 18-gauge (1.2 mm) stainless steel with satin finish, 19 mm (3/4") return edge on front.
- 2.3.5.2. Front corners of shelf ground and polished smooth.
- 2.3.5.3. Basis of design: Model No. MS-18 by Gamco.
- 2.3.6. Clothes Hook (CH) (one in each stall and single washroom):
 - 2.3.6.1. Type 304 stainless steel with NAAMM No. 4 mechanical brushed satin finish
 - 2.3.6.2. Faceplate shall have sloped edges and be constructed of 14-gauge (2mm). Hook shall release at a load of 40lbs or greater.
 - 2.3.6.1. Unit shall be furnished with tamper-resistant mounting screws.
 - 2.3.6.2. Basis of Design: Model B-983 by Bobrick
- 2.3.7. Grab Bars (GB):
 - 2.3.7.1. Type 304 stainless steel with NAAMM Brushed No.4 finish with peened gripping surface.
 - 2.3.7.2. Grab bar shall have 18-gauge (1.2mm) wall thickness and 1-1/2" (38mm) outside diameter.
 - 2.3.7.3. Clearance between the grab bar and wall shall be 1-1/2" (38mm).
 - 2.3.7.4. Concealed mounting flanges shall be 11-gauge (3.2mm) thick stainless steel plate, 2" x 3-1/8" (50 x 80mm), and equipped with at least two screw holes for attachment to wall. Flange covers shall be 22 gauge (0.8mm), 3-1/4" (85mm) diameter x 1/2" (13mm) deep, and shall snap over mounting flange to conceal mounting screws and/or Winglt fasteners.
 - 2.3.7.5. Ends of grab bar shall pass through concealed mounting flanges and be heliarc welded to form one structural unit.
 - 2.3.7.6. Grab bar shall comply with accessible design for structural strength.
 - 2.3.7.7. Basis of Design: Bobrick:
 - 2.3.7.7.1. GB-1, GB-3: Straight Grab Bar: Model B-6806.99 x 24, horizontal, 610 mm (34") long
 - 2.3.7.7.2. GB-2: 'L' Shaped Grab Bar: Model B-6898.99, 90 degree, 760 mm (30") long bars.
- 2.3.8. Hand Dryers (HD): Select one of the following:
 - 2.3.8.1. Surface-mounted, ADA compliant hand dryer, automatic activation "SLIMdri" model L-972 by World Dryer; www.globalindustrial.ca
 - 2.3.8.1.1. Size: Height: 270.9 mm, Width: 290.3 mm, Depth: 98.8 mm
 - 2.3.8.1.2. Polished stainless steel cover
 - 2.3.8.1.3. Wall mounting plate shall be constructed of die-cast aluminum
 - 2.3.8.1.4. Nozzle shall be constructed of die-cast aluminum finished with epoxy paint finish.
 - 2.3.8.1.5. The cover shall be attached to the wall mounting plate with tamper-proof screws.
 - 2.3.8.1.6. Motor shall be a thermally-protected universal brush type motor, 13,000 RPM, delivering 70 CFM air flow at a velocity of 140 MPH (12,320 LFM).
 - 2.3.8.1.7. 115 / 208 / 230VAC input.

- 2.3.8.1.8. Sound rating: 83 db
- 2.3.8.1.9. Heating element: chrome wire heating element protected by an automatic resetting thermal cutoff.
- Activation: automatic infrared sensor with a 3 second run-on time and 60 second vandal shut-off.
- 2.3.8.1.11. Control board shall contain a heater control switch which can be controlled in either ON or OFF position. Dryer shall provide a 48°F temperature rise.
- 2.3.8.2. Surface mounted, "XCE" by Ouellet; www.oulet.com
 - 2.3.8.2.1. Finish: epoxy/polyester powder paint, white
 - 2.3.8.2.2. 110 120 V
 - 2.3.8.2.3. Motor: 20,000 RPM delivering 19,00 lfm
 - 2.3.8.2.4. Heating element: Helical coil nickel-chromium alloy wire protected by mica insulator.
 - 2.3.8.2.5. Adjustable heat control: High, Medium, Low and Off
 - 2.3.8.2.6. Adjustable motor speed
 - 2.3.8.2.7. Sound rating: 71 db
 - 2.3.8.2.8. Activation: infrared optical sensor

2.4. FABRICATION

- 2.4.1.1. Fabricate accessories true, square, rigid, free from distortion and from defects detrimental to appearance and performance. Assemble sheet metal accessories by welding in accordance with CSA W59. Conceal welds, or grind smooth such as to be undetectable in finished work. Unless approved by Owner, ensure assembly fastenings, hardware fixings and mounting or installation devices are concealed in finished work.
- 2.4.1.2. Use non-corrosive metal fasteners of expansion type, toggle type or other approved type of positive, mechanical anchor as required to suit construction to which accessory is to be mounted. Ensure exposed fasteners, where permitted, are finished to match adjacent accessory surface and countersunk. Where accessories are mounted to sheet metal, provide a 3 mm (1/8") thick minimum full-size metal back-up plate drilled and tapped to receive machine screws and finished to match adjacent sheet metal surface.
- 2.4.1.3. Ensure frameless accessories have 1 piece fronts with 90 degree formed returns at their edges and openings. Ensure returns are continuously welded and ground smooth at corners. Where accessory fronts are framed, ensure frame edges, both inside and outside, have 90 degree formed returns continuously welded and ground smooth at corners. Ensure doors also have 90 degree formed returns.
- 2.4.1.4. Use concealed stainless steel piano hinges which extend full-length of hinged element. Ensure hinged elements have concealed, mechanically-retained, rubber bumpers for silent closing, and close flush with faces of fronts or frames. Locate hinges to afford easy and unobstructed access to interiors taking into consideration location of accessory relative to surrounding and adjacent items and finishes.
- 2.4.1.5. Ensure portions of sheet metal accessory interiors visible in completed work are stainless steel. Ensure changes in plane are formed or continuously welded and ground smooth. Ensure sheet metal accessory parts concealed in finished installation are galvanized or stainless sheet steel. Ensure edges of sheet metal accessible by users or maintenance personnel are hemmed for safety with no sharp edges.

2.4.1.6. Ensure lettering or pressure sensitive international symbols on accessories is silk screened with durable paint to withstand wear or is engraved or embossed. Size, location and type face of lettering is subject to approval. Ensure edges of letters are straight and sharp.

PART 3 - EXECUTION

3.1. EXAMINATION

- 3.1.1. Verification of Conditions:
 - 3.1.1.1. Verify actual site dimensions and location of adjacent materials prior to commencing work. Notify Consultant in writing of any conditions which would be detrimental to the installation.
 - 3.1.1.2. Verify gypsum board walls have been reinforced in accordance with Section 09 21 16 Non-Structural Metal Framing for wall mounted accessories.
- 3.1.2. Evaluation and Assessment: Commencement of work implies acceptance of previously completed work.

3.2. INSTALLATION

- 3.2.1. Provide necessary wall reinforcement for grab bars and towel bars as detailed for 227 kg (500 lbs) downward pull.
- 3.2.2. Install washroom accessories in accordance with manufacturer's printed installation instructions.
- 3.2.3. Provide fastenings and mounting kits for washroom accessories.
- 3.2.4. Verify wall opening for correct dimensions, plumbness of blocking or frames and other preparation that would affect installation of washroom accessories.
- 3.2.5. Verify spacing of plumbing fixtures and toilet partitions that affect installation of washroom accessories.
- 3.2.6. Securely fasten accessories, level and plumb using appropriate fastenings as recommended by manufacturer.
- 3.2.7. Provide corrosion resistant fastenings. Where fasteners are exposed, use tamper-proof fasteners finished to match items secured.
- 3.2.8. Locate washroom accessories where indicated on Drawings and where directed by Consultant. Obtain Consultant's acceptance of exact locations.
- 3.2.9. Provide manufacturer's recommended anchoring systems.
- 3.2.10. Fit flanges of accessories snug to wall surfaces.

3.3. SITE QUALITY CONTROL

3.3.1. Non-Conforming Work: Replace damaged work which cannot be satisfactorily repaired, restored or cleaned, to satisfaction of Consultant at no cost to Owner.

3.4. ADJUSTING

- 3.4.1. Test mechanisms, hinges, locks and latches.
- 3.4.2. Adjust and lubricate to ensure washroom accessories are in perfect working order.

3.5. CLEANING

- 3.5.1. Clean and polish mirrors, aluminum and stainless steel surfaces.
- 3.5.2. Remove protective coatings and paper including adhesives.

END OF SECTION

AMRA J Architects Inc. Project No. 24-28 January, 2025



APPENDIX A – Door Hardware Schedule

P02125 Lake Ave Elementary School Washrooms & Changerooms Renovations

157 Lake Ave North, Hamilton, ON

FINISHING HARDWARE SPECIFICATION

FOR **HWDSB** LAKE AVENUE ELEMENTARY SCHOOL RENOVATION 157 LAKE AVE. N. HAMILTON, ON.

ARCHITECT:

AMRA J. ARCHITECTS INC. 63 STOWBRIDGE CRESCENT ANCASTER, ONT. L9G 5E1 PH# 905.920.5121

CONTRACTOR:

SUPPLIER:



GROUP 87

ARCHITECTURAL HARDWARE INC. UNIT #1 - 3245 HARVESTER RD,

BURLINGTON, ON. L7N 3T7

PH# 905.639.4676 FAX# 905.639.7561 E-MAIL: craig@group87.ca WEB: www.group87.ca

CONSULTANT: CRAIG S. WILSON AHC

COORDINATOR: DERRILL A. WILSON

DATE: January 8, 2025

REVISION: March 11, 2025 ISSUED FOR BUILDING |25/02/28

DEVELOPED FROM ARCHITECTURAL DRAWING DATED:

PERMIT

Abbreviations (Categorized)

FRAMES: HOLLOW METAL

Abbreviation	Definition
LH	Left Hand
RH	Right Hand

HARDWARE

Door Type

Abbreviation Definition		HOLLOW METAL DOOR	HMD	
		on Definition	Abbreviation	

Fire Ratings

Abbreviation	Definition
45MIN	45 MIN FIRE RATING, NEGATIVE PRESSURE

Frame Type

Abbreviation	Definition
HMF	HOLLOW METAL FRAME

Handing

Abbreviation	Definition
D/A	Double Acting
LH	Left Hand
LHA	Left Hand Active
LHI	Left Hand InActive
LHR	Left Hand Reverse
LHRA	Left Hand Reverse Active
LHRI	Left Hand Reverse InActive
RH	Right Hand
RHA	Right Hand Active
RHI	Right Hand InActive
RHR	Right Hand Reverse
RHRA	Right Hand Reverse Active
RHRI	Right Hand Reverse InActive

Hardware Finishes

Abbreviation	Definition
26D	SATIN CHROMIUM PLATED
32D	SATIN STAINLESS STEEL, 300 SERIES
626	SATIN CHROMIUM PLATED OVER NICKEL
652	SATIN CHROMIUM PLATED OVER NICKEL
689	ALUMINUM PAINTED

Hardware Mfrs

Abbreviation	Definition
IVE	H.B. IVES
LCN	LCN COMMERCIAL DIVISION
SCH	SCHLAGE LOCK COMPANY
SMH	STANDARD METAL HARDWARE MANUFACTURING

Project : LAKE AVE. E.S.	Control #: 233	Print Date: 03/11/2025	Project No:	
Supplier GROUP 87 ARCHITECTURAL HARDWARE INC.	Revision #:	Rev Date :	Page: 2	

SpecWorks™ ABBREV4 10:53:40 AM, 03/04/2025 Printed By: CRAIG

Abbreviations (Categorized)

HARDWARE

Hardware Miscellaneous

Abbreviation	Definition
JD	JAMB DEPTH
REG	REGULAR

Modes of Operation

Abbreviation	Definition
SGL	SINGLE DOOR

Project : LAKE AVE. E.S.	Control #: 233	Print Date: 03/11/2025	Project No:	
Supplier GROUP 87 ARCHITECTURAL HARDWARE INC.	Revision #:	Rev Date :	Page: 3	-

SpecWorks™ ABBREV4 10:53:40 AM, 03/04/2025 Printed By: CRAIG

SPECIFICATION NOTES

1) To be bid as per specification.

Substitution, and/or omission, of products requires Architects/Consultants approval.

Request for Substitutions must be made a minimum of 10 days prior to Tender Close.

- 2) <u>The Hardware Supplier</u> must be regularly involved in supplying and expediting contract hardware for projects of this nature. The Supplier must employ a Certified <u>"Architectural Hardware Consultant"</u> [AHC] to co-ordinate and oversee scheduling, ordering and the supplying of finishing hardware.
- 3) All locks to be keyed to the existing system. If one does not exist, the hardware supplier will arrange a meeting with the Architect and or Owner to develop and prepare a key schedule to the owners requirements.
- **4)** Auto Door Operator Installation [if required]:

Automatic operators are supplied and installed by the finishing hardware supplier. Rough-in, 110V to head of frame, conduit, backboxes and low voltage wire runs by electrical division. Backing and reinforcement for operator by General Contractor Work must be completed prior to the arrival of the Operator Installation Technician. Installation company must employ an AAADM certified technician.

- 5) *Installation of frames to be site confirmed by G.C. to be Plumb & True prior to commencement of door & hardware installation.
- 6) Standard mounting heights [unless otherwise noted]

A. Locks/Latches 40-5/16" [1023mm] to center line of strike from finished floor.

B. Deadlocks 47 1/4" [1200mm] to center line of strike from finished floor.

*Unless otherwise noted.

C. Exit Devices 40-5/16" [1023mm] to center line of strike from finished floor.

D. Door Pulls 42" [1067mm] to center line of pull from finished floor.

*Where a deadlock is located at the 40-5/16" [1023mm] location

install the door pull immediately above the lock body/case.

E. Push Plate 45" [1143mm] to center line of Push Plate from finished floor.

F. Coat Hook 47" [1200mm] to center line of Hook from finished floor.

G. Door Viewer 43" [1100mm] to center line of Viewer from finished floor.

The above noted mounting heights are a recommended standard and may vary under special applications and conditions.

Project : LAKE AVE. E.S.	Control #: 2335	Print Date: 03/11/2025	Project No:	
Supplier :GROUP 87 ARCHITECTURAL HARDWARE INC.	Revision #:	Rev Date :	Page: 4	

SpecWorks™ CLARIF 10:53:42 AM, 0304/2025 Printed By: CRAIG

					Heading 01 (HwSet)			Degree
			1 S		EX. CORRIDOR 133 TO STORAGE 138A 950 x 2134 x 44 x HMD x HMF x 45MIN		Hand RH	Act InAc
To	tals	Eac	h Asseı	mbly to have:				
(3)	3	EA	HINGE	5BB1 127 X 102	652	IVE	
	1)	1	EA	STOREROOM LOCK	ND80JD RHO	626	SCH	
	1)	1	EA	PERMANENT CORE	23-030 C123 '1' BITTED	626	SCH	
	1)	1	EA	SURFACE CLOSER	4040XP REG ARM	689	LCN	
	1)	1	EA	KICKPLATE	K10A 200 X 912 TAPE MTD	32D	SMH	
	1)	1	EA	COMBO FLOOR STOP	² \$102L	26D	SMH	
					Heading 02 (HwSet)			Dograo
							Hand	Degree Act InAc
					EV CORRIBOR 400 TO OTAFE WASHINGON 400R		D	00
				SGL DOOR(S) D138C-A	EX. CORRIDOR 133 TO STAFF WASHROOM 138B EX. CORRIDOR 133 TO STAFF WASHROOM 138C 950 x 2135 x 44 x HMD x HMF x 45MIN		RH LH	90 90
To	tals	Eac	1 S	SGL DOOR(S) D138C-A	EX. CORRIDOR 133 TO STAFF WASHROOM 138C			
To	tals 6)	Eac 3	1 S	SGL DOOR(S) D138C-A	EX. CORRIDOR 133 TO STAFF WASHROOM 138C	652		
Τα			1 S h Assei	SGL DOOR(S) D138C-A	EX. CORRIDOR 133 TO STAFF WASHROOM 138C 950 x 2135 x 44 x HMD x HMF x 45MIN	652 626	LH	
To	6)	3	1 S h Assei EA	SGL DOOR(S) D138C-A smbly to have: HINGE	EX. CORRIDOR 133 TO STAFF WASHROOM 138C 950 x 2135 x 44 x HMD x HMF x 45MIN 5BB1 127 X 102		LH IVE	
To	6) 2)	3 1	1 S h Assei EA EA	MINGE OFFICE LOCK	EX. CORRIDOR 133 TO STAFF WASHROOM 138C 950 x 2135 x 44 x HMD x HMF x 45MIN 5BB1 127 X 102 L9056J 06A C/W IS-OCC/OS-OCC INDICATORS	626	IVE SCH	
To	6) 2) 2)	3 1 1	1 S h Assei EA EA	Modern Core Moder	EX. CORRIDOR 133 TO STAFF WASHROOM 138C 950 x 2135 x 44 x HMD x HMF x 45MIN 5BB1 127 X 102 L9056J 06A C/W IS-OCC/OS-OCC INDICATORS 23-030 C123 '1' BITTED	626 626	IVE SCH SCH	
T(((((6) 2) 2) 2)	3 1 1 1	1 S h Asser EA EA EA	mbly to have: HINGE OFFICE LOCK PERMANENT CORE SURFACE CLOSER	EX. CORRIDOR 133 TO STAFF WASHROOM 138C 950 x 2135 x 44 x HMD x HMF x 45MIN 5BB1 127 X 102 L9056J 06A C/W IS-OCC/OS-OCC INDICATORS 23-030 C123 '1' BITTED 4040XP REG ARM	626 626 689	IVE SCH SCH LCN	
T(6) 2) 2) 2) 2)	3 1 1 1 1	1 S h Assei EA EA EA EA	Modern Control (S) D138C-A mbly to have: HINGE OFFICE LOCK PERMANENT CORE SURFACE CLOSER KICKPLATE	EX. CORRIDOR 133 TO STAFF WASHROOM 138C 950 x 2135 x 44 x HMD x HMF x 45MIN 5BB1 127 X 102 L9056J 06A C/W IS-OCC/OS-OCC INDICATORS 23-030 C123 '1' BITTED 4040XP REG ARM K10A 200 X 912 TAPE MTD S120	626 626 689 32D	IVE SCH SCH LCN SMH	
((((((((((((((((((((6) 2) 2) 2) 2) 2)	3 1 1 1 1 1	h Assei EA EA EA EA EA	mbly to have: HINGE OFFICE LOCK PERMANENT CORE SURFACE CLOSER KICKPLATE CV HD WALL STOP	EX. CORRIDOR 133 TO STAFF WASHROOM 138C 950 x 2135 x 44 x HMD x HMF x 45MIN 5BB1 127 X 102 L9056J 06A C/W IS-OCC/OS-OCC INDICATORS 23-030 C123 '1' BITTED 4040XP REG ARM K10A 200 X 912 TAPE MTD S120 Miscellaneous	626 626 689 32D 26D	IVE SCH SCH LCN SMH SMH	90
((((((((((((((((((((6) 2) 2) 2) 2)	3 1 1 1 1 1	h Asser EA EA EA EA EA	mbly to have: HINGE OFFICE LOCK PERMANENT CORE SURFACE CLOSER KICKPLATE CV HD WALL STOP	EX. CORRIDOR 133 TO STAFF WASHROOM 138C 950 x 2135 x 44 x HMD x HMF x 45MIN 5BB1 127 X 102 L9056J 06A C/W IS-OCC/OS-OCC INDICATORS 23-030 C123 '1' BITTED 4040XP REG ARM K10A 200 X 912 TAPE MTD S120	626 626 689 32D	IVE SCH SCH LCN SMH SMH	90

End of Schedule

Project: LAKE AVE. E.S.	Control #: 233	Print Date : 03/11/202	5 Project #:
Supplier: GROUP 87 ARCHITECTURAL HARDWARE INC.	Revision #:	Rev Date :	Hdwe Sched Page: 5